# **LKK Auto Consultants** #01-25 Paya Ubi Industrial Park, 51 **Ubi Avenue 1** 408933

**Insurer Reference: SNB6640L** 

Full Report Repairer Reference: M4514/SNB6640L Registration: SNB6640L Date calculated: 02/06/2022 10:17 AM Printed: 02/06/2022 10:18 AM

## **Summary Information**

Claim

Location: Work Provider: Singapore (SG) China Taiping Insurance

Hire Car End:

(Singapore) Pte Ltd

Printed by: KK LAU Claim Reference: SNB6640L

Estimated Repair Time: Actual Repair Days: 6

Currency: SGD Date of Incident: 14/03/22 Hire Car Start:

### **Vehicle Details**

Vehicle

VW Manufacturer:

GOLF (5G) Model: Sub Model: BASE MODEL Model Sheet Number: 06 2B 23 Registration: SNB6640L

VIN number: WVWZZZAUZHW047828

Odometer: 70766

Model Specs

FROM 06.2016 OCCUPANT PROTECT SYS D/MIRROR W/AMBIENT CLIMATRONIC

AUTO DIPPING MIRROR LIGHT SWITCHING AUTO HEIGHT ADJ PASS SEAT DOOR TRIM IMIT LEATH

HD COOLING

WHEELS 6J X 15 1395CCM 92KW

8 SPEAKER

PARKING HELP SYSTEM

TRIM LEATHER LUMBAR SUPPORT FRONT CENTRE ARMREST REAR CENTRE ARMREST

7-SPEED DSG

SPACE SAVER SP-WHEEL TWO COAT METALLIC

**BLUE MOTION TECHNO** LIGHT-/RAIN SENSOR RADIO "COMP MEDIA" REARVIEW CAMERA STRG WHEEL LEATHER STOP-START SYSTEM SMOKER EQUIPMENT SELECT DRIVE

RR DUAL EXHAUST PIPE

CHROME PACKAGE FRT/RR ELECT WINDOWS

FOG LAMPS

HEATED FRONT SEATS MULTI FUNC INDICATOR INTER LIGHT AMBIENCE **ALTERNATOR 140A** TYRES 195/65 HR 15

5-DOOR


### **Vehicle Condition**

### **Vehicle Status**

Pre-Accident Damage: Date of Inspection:

### **Damage Areas**

All	
Underbody	

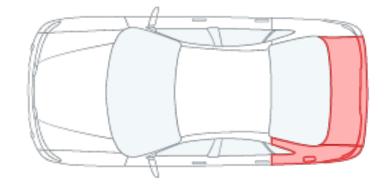

# **Tyres Condition**

Tyre Brand Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Outer),

mm mm mm mm Middle), mm

Spare Tyre Brand

Tread (Spare), mm

### Labour

	Time Base 10 WU/h	Price = 42.	00 SGD/h
Code	Description	WU	Price SGD
58 51 19 00	R + R LEFT REAR DOOR	3.0	12.60
58 51 55 53	RENEW LEFT REAR DOOR (DOOR REMOVED) INCLUDES: R + R ALL PARTS	20.0	84.00
94 31 19 10	R + R LEFT INNER TAILLAMP	2.0	8.40
63 69 55 50	RENEW REAR BUMPER COVER (BUMPER REMOVED) INCLUDES: CONVERT ATTACHED PARTS	5.0	21.00
63 69 31 60	ASSEMBLE REAR BUMPER COVER (REMOVED) ADDITIONAL POSITION FOR PARK ASSIST	1.0	4.20
63 69 41 62	REPAIR REAR BUMPER COVER (COMPOSITE WORK) (4 BRACKET STUCK)	3.0	12.60
63 69 43 50	DRILL REAR BUMPER COVER (COMPOSITE WORK) (4 HOLES DRILLED)	3.0	12.60
53 55 53 00	L/SIDE SECTION (REMOVAL OF PARTS) INCLUDES: REMOVE TAILLAMPS, BUMPER	11.0	46.20

Code	Description	wu	Price SGD
	COVER, WHEELHOUSE LINER, SIDE TRIM, SEAT CUSHION, SEAT BACKREST, INNER SILL MOULDING, LOCK PLATE, C-PILLAR TRIM, BOOT COVER, SEAT BELT, BOOT COVER GUIDES AND BOOT TRIM		
53 55 55 00	RENEW LEFT SIDE PANEL	71.0	298.20
53 55 59 00	FIT PARTS L/SIDE PANEL INCLUDES: FIT REMOVED PARTS, RENEW IF NECESSARY, ADJUST TAILGATE, CHECK LIGHTING DOES NOT INCLUDE: RENEW TAILGATE	16.0	67.20
53 56 55 50	RENEW L/LOWER SIDE PANEL (COMP WORK)	31.0	130.20
44 10 55 50)	RENEW L/R WHEEL (WHEEL REMOVED)	2.0	8.40
44 05 93 55 <sup>°</sup>	BALANCE L/R WHEEL (WHEEL REMOVED)	1.0	4.20
1861	L/R DOOR OUT HANDLE REPAIR	5.0*	21.00
	Labour Cost Panel / Mechanical Labour	Hrs WU 17.40 174.0	730.80
	Total of Labour		730.80
Paint			

Paint Work	SYSTEM AZT	Time Basis 10 WU/h	
Code	Description - TWO COAT METALLIC	WU Price SGD	
	L/R DOOR NEW PART PAINTING	13.0	
	L/SIDE PANEL NEW PART PAINTING	24.0	
	REAR COVER BUMPER NEW PART PAINT K1R	12.0	
	L/R DOOR OUT HANDLE REPAIR PAINT PLASTIC	9.0	

### **Paint Material Per Part**

Code	Description	Price SGD
1781	L/R DOOR NEW PART PAINTING	33.54
3481	L/SIDE PANEL NEW PART PAINTING	30.80
2583	REAR COVER BUMPER NEW PART PAINT K1R	56.09
1861	L/R DOOR OUT HANDLE REPAIR PAINT PLASTIC	0.81

Labour Cost - Paint		Hrs	WU	<b>Price SGD</b>
Factor	42.00 SGD/h			
Time Paint			58.0	
Preparation Main Work Metal		2.10	21.0	88.20
Preparation Comp. Work Plastic		0.80	8.0	33.60
Total	10 WU/h	8.70	87.0	365.40

Material Cost - Paint	Price SGD
New Part Painting	64.34
New Part Painting - Plastic K1R	56.09
Repair Painting Plastic	0.81
Material-constant Metal	18.10
Material-constant Plastic	12.70
Total	152.04

# **Spare Parts**

Code	Description	Part Number	Part Source	prices as at 2015-06-01 Price SGD
2799 2798 2617 2619 1781 3283 2789 3281	2-COMP ADHESIVE SENS APPLICATOR L/R BUMPER GUIDE L/R BUMPER GUIDE L/R DOOR L/R INNER LAMP L/R INN SENSOR BRKT L/R OUTER LAMP L/R OUT SENSOR BRKT	D 009 500 25 5G6 807 393 A 5G6 807 393 5G4 833 055 AD 5G0 945 093 AD 5G0 919 491 A 5G0 945 095 M 5G0 919 491	Original Original Original Original Original Original Original Original Original	0.00 0.00 30.00 30.00 1,200.00 150.00 20.00 165.00
9551 4201 3481 2797 2790 2788 2583	L/RR WHEEL  L/R WHEELHOUSE COVER L/SIDE PANEL PLASTIC PRIMER R/R INN SENSOR BRKT R/R OUT SENSOR BRKT REAR COVER BUMPER	5Q0 601 027 BN 03C 5G0 810 971 D 5G4 809 843 D 822 150 A1 5G0 919 492 A 5G0 919 491 5G6 807 417 AP GRU	Original Original Original Original Original Original Original Original	145.00 120.00 900.00 0.00 20.00 20.00 780.00
f: OEM Parts n: Non-OEM Parts u: Used parts	Savings Subtotal Total			0.00 3,600.00 3,600.00

# **Extras**

Code	Description	Price SGD
1000	BUMPER CLIPS REAR	30.00*
1001	INN SHIELD CLIPS LH REAR	30.00*
	Total Extras	60.00

# **Final Calculation**

	SGD	SGD
Parts Total Parts	3,600.00	3,600.00
Labour Time Base 10 WU/h Total 174.0 WU X 42.00 SGD/h Total of Labour	730.80	730.80
Total Of Extras		60.00
Paint Work Time Base 10 WU/h Labour Cost 87.0 WU X 42.00 SGD/h Material Cost Total Paint Including Material	365.40 152.04	517.44
Repair Cost Excludes GST		4,908.24
GST (+7.00%) Repair Cost Included GST		343.58 5,251.82
Deductions (Excludes GST) Repair Cost Discount (+20.00%) Total Of Deductions (Excludes GST)	-981.65	-981.65
Grand Total Excludes GST		3,926.59
GST (+7.00%)  Grand Total Included GST		274.86 4,201.45

### Comments

\* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS

### **Assessment Note**

No assessment notes entered.