

Auto Insure Pte. Ltd
6 Marsiling Lane
739145



Insurer Reference: SNB6640L
Repairer Reference: M4514/SNB6640L
Date calculated: 21/03/2022 10:31 AM

Full Report
Registration: SNB6640L
Printed: 21/03/2022 10:31 AM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Marvyn Chua	Currency:	SGD
Claim Reference:	SNB6640L	Date of Incident:	14/03/22
Estimated Repair Time:	5	Hire Car Start:	
Actual Repair Days:	5	Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	VW
Model:	GOLF (5G)
Sub Model:	BASE MODEL
Model Sheet Number:	06 2B 23
Registration:	SNB6640L
VIN number:	WVWZZZAUZHW047828
Odometer:	70766

Model Specs

FROM 06.2016	OCCUPANT PROTECT SYS	BLUE MOTION TECHNO	CHROME PACKAGE
CLIMATRONIC	D/MIRROR W/AMBIENT	LIGHT-/RAIN SENSOR	FRT/RR ELECT WINDOWS
AUTO DIPPING MIRROR	8 SPEAKER	RADIO "COMP MEDIA"	FOG LAMPS
LIGHT SWITCHING AUTO	PARKING HELP SYSTEM	REARVIEW CAMERA	HEATED FRONT SEATS
HEIGHT ADJ PASS SEAT	TRIM LEATHER	STRG WHEEL LEATHER	MULTI FUNC INDICATOR
DOOR TRIM IMIT LEATH	LUMBAR SUPPORT	STOP-START SYSTEM	INTER LIGHT AMBIENCE
FRONT CENTRE ARMREST	REAR CENTRE ARMREST	SMOKER EQUIPMENT	ALTERNATOR 140A
HD COOLING	7-SPEED DSG	SELECT DRIVE	TYRES 195/65 HR 15
WHEELS 6J X 15	SPACE SAVER SP-WHEEL	RR DUAL EXHAUST PIPE	5-DOOR
1395CCM 92KW	TWO COAT METALLIC		

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

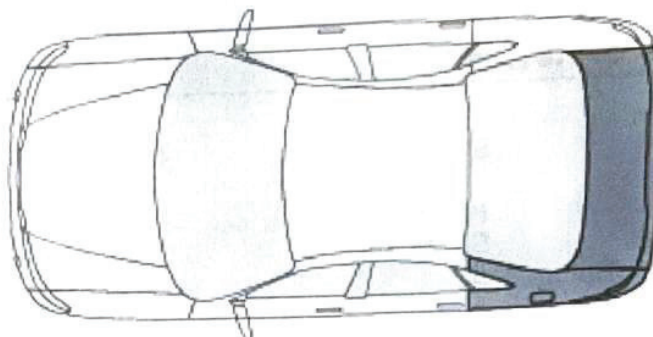

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
58 51 19 00	R + R LEFT REAR DOOR		3.0	12.60
58 51 55 53	RENEW LEFT REAR DOOR (DOOR REMOVED) INCLUDES: R + R ALL PARTS		20.0	84.00
94 31 19 10	R + R LEFT INNER TAILLAMP		2.0	8.40
63 69 55 50	RENEW REAR BUMPER COVER (BUMPER REMOVED) INCLUDES: CONVERT ATTACHED PARTS		5.0	21.00
63 69 31 60	ASSEMBLE REAR BUMPER COVER (REMOVED) ADDITIONAL POSITION FOR PARK ASSIST		1.0	4.20
63 69 41 62	REPAIR REAR BUMPER COVER (COMPOSITE WORK) (4 BRACKET STUCK)		3.0	12.60
63 69 43 50	DRILL REAR BUMPER COVER (COMPOSITE WORK) (4 HOLES DRILLED)		3.0	12.60
NO NUMBER	R + R AIR VENT GRILLE		1.0	4.20
53 55 53 00	L/SIDE SECTION (REMOVAL OF PARTS)		11.0	46.20

Code	Description		
	INCLUDES: REMOVE TAILLAMPS, BUMPER COVER, WHEELHOUSE LINER, SIDE TRIM, SEAT CUSHION, SEAT BACKREST, INNER SILL MOULDING, LOCK PLATE, C-PILLAR TRIM, BOOT COVER, SEAT BELT, BOOT COVER GUIDES AND BOOT TRIM		
53 55 55 00	RENEW LEFT SIDE PANEL	71.0	298.20
53 55 59 00	FIT PARTS L/SIDE PANEL	16.0	67.20
	INCLUDES: FIT REMOVED PARTS, RENEW IF NECESSARY, ADJUST TAILGATE, CHECK LIGHTING		
	DOES NOT INCLUDE: RENEW TAILGATE		
53 56 55 50	RENEW L/LOWER SIDE PANEL (COMP WORK)	31.0	130.20
44 10 55 50)	RENEW L/R WHEEL (WHEEL REMOVED)	2.0	8.40
44 05 93 55	BALANCE L/R WHEEL (WHEEL REMOVED)	1.0	4.20
	Labour Cost	Hrs	WU
	Panel / Mechanical Labour	17.00	170.0
	Total of Labour		714.00

Paint

Code	Description - TWO COAT METALLIC	WU	Price SGD
Paint Work		Time Basis 10 WU/h	
58 51 61 00	L/R DOOR NEW PART PAINTING S1	13.0	54.60
58 11 61 50	L/R DOOR OUT HANDLE PAINTING	1.0	4.20
63 69 61 50	REAR COVER BUMPER NEW PART PAINTING S1	9.0	37.80
53 55 61 50	L/SIDE PANEL NEW PART PAINTING S1	11.0	46.20
53 55 61 00)	ADD/TIME FOR ONE MAIN WORK L/SIDE PANEL NEW PART PAINT STAGE 1	5.0	21.00
51 01 71 13	PAINTING PREPARATION WORK NEW PART S1 METAL (PART/S FITTED)	19.0	79.80
51 01 71 93	PREPARATION FOR PAINT (PLASTIC PARTS) (WITH PART(S) REMOVED) (ASSEMBLY OPERATION)	2.0	8.40
	Total Paint	Hrs 6.00	WU 60.0
			Price SGD 252.00

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01 Price SGD
2799	X2-COMP ADHESIVE SENS	180 KU2 A1		0.00
2798	XAPPLICATOR	D 009 500 25		0.00
3783	L/R AIR GRILLE X	7N0 819 465 F	Original	50.00
2617	L/R BUMPER GUIDE	5G6 807 393 A	Original	30.00
2619	L/R BUMPER GUIDE	5G6 807 393	Original	30.00
1781	L/R DOOR	5G4 833 055 AD	Original	1,200.00
1871	L/R DOOR HANDLE TRIM	5G0 839 167 D	Original	15.00
	repair GRU			

Code	Description	Part Number	Part Source	Price SGD
1861	<i>repair</i> - L/R DOOR OUT HANDLE	5G0 837 205 N	Original	135.00
3283	<i>re</i> / L/R INNER LAMP <i>GRU</i>	5G0 945 093 AD	Original	150.00
2789	<i>re</i> / L/R INN SENSOR BRKT	5G0 919 491 A	Original	20.00
3281	<i>re</i> / L/R OUTER LAMP - <i>GRU</i>	5G0 945 095 M	Original	165.00
2787	<i>re</i> / L/R OUT SENSOR BRKT	5G0 919 491	Original	20.00
9551	L/RR WHEEL - <i>GRU</i>	5Q0 601 027 BN	Original	145.00
4201	L/R WHEELHOUSE <i>cut</i>	03C 5G0 810 971 D	Original	120.00
3481	COVER			900.00
2797	L/SIDE PANEL <i>GRU</i>	5G4 809 843	Original	0.00
2790	PLASTIC PRIMER <i>X</i>	D 822 150 A1		20.00
2788	<i>re</i> / R/R INN SENSOR BRKT	5G0 919 492 A	Original	20.00
2583	<i>re</i> / R/R OUT SENSOR BRKT	5G0 919 491	Original	780.00
2645	<i>re</i> / REAR COVER BUMPER	5G6 807 417 AP	Original	
	<i>X</i> RR BUMPER MOULDING	GRU 5G6 807 863 C	Original	50.00
f: OEM Parts				0.00
n: Non-OEM Parts				
u: Used parts				
Savings				0.00
Subtotal				3,850.00
Total				3,850.00

Extras

Code	Description	Price SGD
1000	BUMPER CLIPS REAR <i>re</i> /	30 50.00*
1001	INN SHIELD CLIPS LH REAR	30.00*
Total Extras		80.00

Final Calculation

	SGD	SGD
Parts	3,850.00	
Total Parts		3,850.00
Labour Time Base 10 WU/h		
Total 170.0 WU X 42.00 SGD/h	714.00	
Total of Labour		714.00
Total Of Extras		80.00
Paint Work Time Base 10 WU/h		
Labour Cost 60.0 WU X 42.00 SGD/h	252.00	
Total Paint Including Material		252.00
Repair Cost Excludes GST		4,896.00
GST (+7.00%)		342.72
Repair Cost Included GST		5,238.72
Deductions (Excludes GST)		
Deduction For Excess	-500.00	
Total Of Deductions (Excludes GST)		-500.00
Grand Total Excludes GST		4,396.00
GST (+7.00%)		307.72
Grand Total Included GST		4,703.72

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature:
 Date:

Paul
 HP 90010068

6 days

L/S

21/03/22 @ 1610

EXCESS: TBA

Repair

Recy after repair