



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Mail Address: My Mail Box 886259 Singapore 919191.

Mobile: 9295 2204 Fax: 6722 8508 Email: pasvcs@hotmail.com

Business Reg 201404434D

Vehicle No : SLC5508L

Report No. : PAS/TP/0281121

GENERAL REMARKS

WITHOUT PREJUDICE

THE ASSIGNMENT

The survey was conducted at M/s. Kum Chew Motor Workshop, 160, Sin Ming Drive, #05-08, Sin Ming Autocity, Singapore 575722.

(Subsequent inspections have been conducted)

POINT OF IMPACT

At the rear portion.

DAMAGES

The boot lid, rear bumper, rear end panel, rear floor panel, rear chassis members, rear fenders, taillamps, rear reflectors, etc.

Other parts were also found damaged. (See schedule for details)

ADJUSTMENT / RECOMMENDATION

We have inspected thoroughly each and every item on the repairer's estimate against the actual damaged found on the vehicle. We list the breakdown of our findings and our recommendation as per schedule attached.

Our adjusted amount for the cost of repairs is SGD \$9,264.48.

CONCLUSION

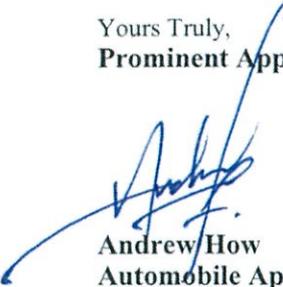
The repairer has agreed to undertake the repairs at a lump sum of SGD \$7,410.00.

This inspection was conducted entirely on a '**Without Prejudice**' basis. We have not given an authorization and/or instruction to the repairer to proceed with the repairs.

We hereby reverting the matter to you for your discretion on repairs.

Assuring you of our best services always.

Yours Truly,
Prominent Appraiser Services Pte Ltd


Andrew How
Automobile Appraiser
MSAAA
Licensed Appraiser



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Mail Address: My Mail Box 886259 Singapore 919191.

Mobile: 9295 2204 Fax: 6722 8508 Email: pasvcs@hotmail.com

Business Reg. 201404434D

Vehicle No : SLC5508L

Report No. : PAS/TP/0281121

APPRAISEMENT SCHEDULE

S/No.	Qty	Parts Descriptions	Condition		Repairer's Estimate (S\$)	Our Assessment (S\$)
1	1 pc	Boot lid ✓	Dented/Distorted		\$ 1,028.60	\$ 1,028.60 ✓
2	2 pcs	Boot hinge R/L	Bent/Repair	\$ 118.30	\$ 236.60	\$ -
3	1 pc	Boot emblem (Logo) ✓	Dented/Necessary		\$ 74.40	\$ 74.40 ✓
4	1 pc	Boot emblem (2.0) ✓	Necessary		\$ 48.60	\$ 48.60 ✓
5	1 pc	Boot emblem (Sport) ✓	Necessary		\$ 37.20	\$ 37.20 ✓
6	1-2 pcs	Boot no.plate lamp R/L ✓	Cracked/Broken	\$ 86.20 ✓	\$ 172.40	\$ 172.40
7	1 pc	Rr reverse camera ✓	Dented/Loop Cracked		\$ 428.60	\$ 428.60 ✓
8	2 pcs	Boot reflector lamp R/L ✓	Cracked	\$ 318.60	\$ 637.20	\$ 637.20 ✓
9	1 pc	Boot trim	Serviceable		\$ 97.60	\$ -
10	10 pcs	Boot trim clip ✓	Necessary	\$ 3.00	\$ 30.00	\$ 30.00 ✓
11	1 pc	Boot lock ✓	Bent/Jammed		\$ 183.60	\$ 183.60 ✓
12	1 pc	Boot lock striker X SVC	Bent		\$ 33.40	\$ 33.40
13	2 pcs	Taillamp R/L ✓	Cracked/Loop Broken	\$ 598.30	\$ 1,196.60	\$ 1,196.60 ✓
14	2 pcs	Taillamp panel R/L	Dented/Repair	\$ 377.80	\$ 755.60	\$ -
15	1 pc	Rr bumper ✓	Dented/Deformed		\$ 1,182.30	\$ 1,182.30 ✓
16	1-2 pcs	Rr bumper reverse sensor R/L ✓	Dented/Damaged	\$ 283.60 ✓	\$ 567.20	\$ 567.20
17	1 pc	Rr bumper tow cover ✓	Broken/Dislodged/Missing		\$ 38.40	\$ 38.40 ✓
18	6 pcs	Rr bumper fastener X SVC	Necessary	\$ 3.20	\$ 19.20	\$ 19.20
19	1 pc	Rr bumper reinforcement ✓	Dented		\$ 582.70	\$ 582.70 ✓
20	2 pcs	Rr bumper retainer R/L X SVC	Cracked/Necessary	\$ 43.30	\$ 86.60	\$ 86.60
21	2 pcs	Rr bumper bracket R/L X SVC	Cracked/Necessary	\$ 54.20	\$ 108.40	\$ 108.40
22	2 pcs	Rr bumper reflector R/L SVC	Refit	\$ 60.80	\$ 121.60	\$ -
23	1 pc	Rr end panel X Repair	Dented/Distorted		\$ 586.20	\$ 586.20
24	1 pc	Rr end panel garnish ✓	Cracked/Deformed		\$ 94.30	\$ 94.30 ✓
25	1 pc	Rr lock antenna X SVC	Dented/Cracked		\$ 132.20	\$ 132.20
26	1 pc	Spare tyre cover trim	Serviceable		\$ 378.10	\$ -
27	1 pc	Spare tyre tool sponge R/L SVC	Refit		\$ 148.00	\$ -
28	2 pcs	Rr fender R/L	Dented/Repair			(Refer labour no. 3, 5 & 6)
29	1 pc	Rr floor panel	Dented/Repair			(Refer labour no. 3, 5 & 6)
30	2 pcs	Rr chassis member R/L	Dented/Repair			(Refer labour no. 3, 5 & 6)
					\$ 9,005.60	\$ 7,268.10
Less Discount : 20%					\$ 1,801.12	20% \$ 1,453.62
List Parts Sub-Total :					\$ 7,204.48	\$ 5,814.48 4450
1	1 pc	Boot spoiler X SVC	Dented/Cracked	S/N	\$ 620.00	\$ 620.00
2	1 pc	Rr bumper diffuser ✓	Dented/Cracked	S/N	\$ 550.00	\$ 550.00 450
3	1 pc	Rr end panel sealant X SVC	Necessary	S/N	\$ 50.00	\$ 40.00
Special Nett Sub-Total :					\$ 1,220.00	\$ 1,210.00
Parts Total :					\$ 8,424.48	\$ 7,024.48



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Mail Address: My Mail Box 886259 Singapore 919191.

Mobile: 9295 2204 Fax: 6722 8508 Email: pasvcs@hotmail.com

Business Reg. 201404434D

Vehicle No : SLC5508L

Report No. : PAS/TP/0281121

S/No.	Labour Descriptions	Repairer's Estimate (S\$)	Our Assessment (S\$)
1	To remove and reinstall electrical wiring system for necessary repairs. To check rear electrical wiring system.	\$ 70.00	\$ 50.00 30
2	To transfer boot component parts to new boot. (Include transfer boot spoiler & supply sealant/adhesive tape)	\$ 120.00	\$ 100.00 60
3	To remove and reinstall rear interior trims, garnishes, etc. for necessary repairs.	\$ 80.00	\$ 60.00 ✓
4	To remove, replace and/or transfer rear reverse sensors to new bumper. (Include reset/reprogram control unit)	\$ 120.00	\$ 120.00 40
5	To straighten, repair, realign on affected area and replace damaged parts.	\$ 1,200.00	\$ 880.00 500
6	To spray painting, blending on affected and adjacent area.	\$ 1,200.00	\$ 1,000.00 600
7	To spray anti-rust coating on new and affected panels.	\$ 30.00	\$ 30.00 ×
Labour Total :		\$ 2,820.00	\$ 2,240.00 1290
Total (Parts & Labour) :		\$ 11,244.48	\$ 9,264.48

6190

For Lump Sum Repairs

-20%: 4950

The final adjusted Lump Sum contract amount is \$ 7,410.00

5 Days

Under normal circumstances, the repairs should be completed within a reasonable period of **8 Working Days. (Exclude waiting days of PRI, Sunday, Public Holiday and awaiting of shipment for spare parts)**

0 Photographs were taken at the time of inspection.

N.B: By accepting to carry out the repairs on a contract Lump Sum basis, the repairer shall have the prerogative and discretion to replace the damaged parts with new, used, OEM or reconditioned parts and/or to repair the vehicle on a roadworthy condition to the entire satisfaction of owner.