LKK Auto Consultants #01-25 Paya Ubi Industrial Park, 51 **Ubi Avenue 1** 408933

Insurer Reference: TP/22014 Repairer Reference: 046873

Registration: SMW5924B Date calculated: 03/06/2022 2:44 PM Printed: 03/06/2022 2:45 PM

Summary Information

Claim

Location: Singapore (SG) Work Provider: China Taiping Insurance

(Singapore) Pte Ltd

Full Report

Printed by: KK LAU Currency: SGD Claim Reference: TP/22014 Date of Incident: 23/03/22

Hire Car Start: Estimated Repair Time: 10 Actual Repair Days: Hire Car End:

Vehicle Details

Vehicle

MERCEDES-BENZ Manufacturer: Model: GLB (X247) Sub Model: GLB 200 Model Sheet Number: 03 GB 44

VIN number: W1N2476872W031215

Odometer: 28312

Model Specs

Registration:

FR PRODUCTION START MODIFICAT PACK 19/2 AIR CON THERMOTRONIC HEAT ABSORBING GLASS ERM BRAKE ASSIST H-LAMP LED HIGH PER

AMG LINE PASS AIRBAG INTERRUP ILLUM SUN VISORS INCR ANTI THEFT DEV EXHAUST WITH OPF GEN DYNAMIC SELECT WHEELS 7.5J X 19 ALU COMPRESSOR VARIABLE

SOCKET 12V

SHIFT PADDLE ON STRG REAR MULTI LINK AXLE TOUCHPAD

LIGHT-/VIEW PACKAGE

EASY-PACK

SMW5924B

S/BELT W/WARNING DEV EMERGENCY CALL SYS CYLINDER MANAGEMENT LOAD COMPART PACKAGE TYRE PRESSURE SENSOR INTERIOR PROTECTION **EURO NCAP COUNTRIES**

AMG LINE

PREPARE OFF VEHICLE

KNEE AIRBAG MODEL 2020 DAB TUNER CARBON STRUCT TRIM FOLDING REAR SEAT 3RD SEAT ROW STORAGE BOX MOBILE KOM-MOD UMTS RADIATOR SHROUD COMFORT SUSPENSION FRONT SEATS HEATED **ROOF RACK ALU**

REFRIGERANT R1234YF

MULTI FUNC ST/WHEEL ANTENN GPS PHONE ACTIVE TRACK ASSIST CONNECT 20 MID MICROFIBRE PAD DOUBLE CUP HOLDER SEAT COMFORT PACKAGE REARVIEW CAMERA UPPER RADIATOR BLIND 7 SPEED AUTOMATIC TYRES 235/50 WR 19 PEDESTRIAN PROTECT

TWO COAT METALLIC

CLEAR COAT HARD


Vehicle Condition

Vehicle Status

Pre-Accident Damage: Date of Inspection:

Damage Areas

All	
Underbody	

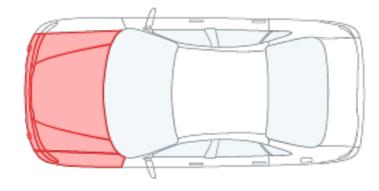

Tyres Condition

Tyre Brand Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Outer),

mm mm mm mm Middle), mm

Spare Tyre Brand Tread (Spare), mm

PIRELLI 5

Labour

	Time Base 10 WU/h	Price = 42.	00 SGD/h
Code	Description	WU	Price SGD
54-1011 01	SHORT TEST INCLUDES: CONNECT + DISCONNECT STAR DIAGNOSIS, PRINT DATA, DELETE ERROR MEMORY	3.0	12.60
88-1102 01	R + R FRONT BUMPER CPL	9.0	37.80
88-1133 01	DIS + ASS FRONT BUMPER (BUMPER REMOVED) AFTER CHECK: RENEW PARTS IF NECESSARY	11.0	46.20
88-1933 ZAX	ADDITION TO R + R FRONT BUMPER (VEHICLE WITH COLLISION WARN SYS)	1.0	4.20
88-1162 01	ADDITION TO DIS + ASS FRONT BUMPÉR (VEHICLE WITH ACTIVE BRAKE ASSIST)	1.0	4.20
82-4790 01)	RENEW LEFT HEADLAMP	2.0	8.40
82-4886 01	ADDITIONAL TO RENEW HEADLAMP (VEHICLE WITH LED HEADLAMP)	3.0	12.60

Code	Description				wu	Price SGD
82-1120 01	ADJUST LED HEADLAMP				7.0	29.40
	Labour Cost Panel / Mechanical Labo	ur		Hrs 3.70	WU 37.0	155.40
	Total of Labour					155.40
Paint						
Paint Work		SYSTEM AZT	T	Tin	ne Basis	10 WU/h
Code	Description - TWO COAT	METALLIC			WU	Price SGD
	FRONT BUMPER TRIM NEW	PART PAINT K1R			13.0	
Paint Materia	l Per Part					
Code	Description					Price SGD
0283	FRONT BUMPER TRIM NEW	PART PAINT K1R				61.50
	Labour Cost - Paint Factor		42.00 SGD/h	Hrs	wu	Price SGD
	Time Paint Preparation Comp. Work Pla	astic		1.50	13.0 15.0	63.00
	Total	Jour	10 WU/h	2.80	28.0	117.60
	Material Cost - Paint New Part Painting - Plastic I Material-constant Plastic Total	K1R				Price SGD 61.50 28.60 90.10
Spare Parts	5					
Code	Description	Part Number	Part Source	prices	s as at 2	2015-06-01 Price SGD
0283 0405 0303 0307 0561	FRONT BUMPER TRIM GRILLE L/F BUMPER GRILLE L/F BUMPER MOULDING LEFT HEADLAMP ASSY	247 880 1803 9 247 880 9904 247 885 7703 247 885 3703 247 906 3900	9999Original Original Original Original Original			840.00 550.00 70.00 85.00 1,850.00
f: OEM Parts n: Non-OEM Part u: Used parts	Savings Subtotal					0.00 3,395.00
	Total					3,395.00
Extras						
Code	Description					Price SGD
1000	CHECK WIRING CHECK WIF	RING				10.00* 10.00

Code Description Price SGD

Final Calculation

	SGD	SGD
Parts	3,395.00	
Total Parts	,	3,395.00
Labour Time Base 10 WU/h		
Total 37.0 WU X 42.00 SGD/h	155.40	
Total of Labour		155.40
Total Of Extras		10.00
Paint Work Time Base 10 WU/h		
Labour Cost 28.0 WU X 42.00 SGD/h	117.60	
Material Cost	90.10	
Total Paint Including Material		207.70
Repair Cost Excludes GST		3,768.10
GST (+7.0%)		263.77
Repair Cost Included GST		4,031.87
Deductions (Excludes GST)		
Repair Cost Discount (+20.00%)	-753.62	
Total Of Deductions (Excludes GST)		-753.62
Grand Total Excludes GST		3,014.48
GST (+7.0%)		211.01
Grand Total Included GST		3,225.49

Comments

* - USER SUPPLIED DATA NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

Author	Date	Text
l	03/06/2022 11:04 AM	Denis