

ASS. REC. BY: Fame

REF:

## ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SHF 3734at Workshop m/s STRIDES CSMRTof 60 WOODLAND Rd PK 44Insured: MC

Policy No. \_\_\_\_\_

Claims No. MT/1170797-001


Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

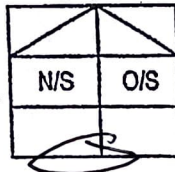

Bal. or Market Value: \_\_\_\_\_

IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: \_\_\_\_\_ days Res.: Yes or No

Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Vehicle: IN / OUT

Veh No: SHF 3734 Yr Regn: 2012 / DK

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: TOYOTA PRADO HYBRID 1.8 CVT c.c 1798Colour: MARON A/C: Insured / Std / NI / NASp. Reading: 489727 T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: JTDKB3FU303580812

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Order / Jammed / Leaked / Burnt orBrake: Order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 185/65R15R: 185/65R15

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or SAILUN

Front Rear

R/Bal. 6 mm R/Bal. 6 mmL/Bal. 6 mm L/Bal. 6 mmD.O.A. 28/03/22 D.O.I. 28/03/22Survey held at STRIDES CSMRTDes. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

| Date / Time | Action / Instruction                                        |
|-------------|-------------------------------------------------------------|
|             |                                                             |
|             | cost of repair of L/S \$2,150.00 /- with 04 days of repair. |
|             | red: 11,961.30 ;84%                                         |
|             |                                                             |
|             |                                                             |
|             |                                                             |
|             |                                                             |
|             |                                                             |
|             | 14111.30                                                    |

Date/Time, File Pass to?

☐ : Preli. Report

Days Of Repair: \_\_\_\_\_

1) \_\_\_\_\_

☐ : Final Report

Resurvey No. of Trip: \_\_\_\_\_

Date/Time, File Return to?

Survey Fee: \_\_\_\_\_

2) \_\_\_\_\_

Transportation: \_\_\_\_\_

Add Fee: ☐ : Site Insp (\$ \_\_\_\_\_)

\$ + RS. \_\_\_\_\_ SI

☐ : Interview (\$ \_\_\_\_\_)

Photos

☐ : Tech. Invs (\$ \_\_\_\_\_)

Others

☐ : Weekend (\$ \_\_\_\_\_)

Report Format: \_\_\_\_\_

Lump Sum / L.S. (\$ \_\_\_\_\_)

## Case Details

Case Reference Number :

TAX/03/22/2056

Type of Repair : Accident Repair

Vehicle Registration Number : SHF373Y

Company Type : Strides Taxi Pte Ltd

Estimation ID : EST-17819-ID

Assigned By : Taxi Claims Manager Team

Insurance Company Name : NTUC Income Insurance Co-operative Ltd

Accident Date and Time : 25/03/2022 12:29 AM

Vehicle Age(In Months) : -

## Documents / Photographs

[View Documents / Photographs](#)

Total Documents: 0

## Estimation Details

### Spare Part's Cost Detail

| SMRT Recommendation |              |         |                 |                              |     |                         |                |        |                 |                 | Surveyor Approval |                          |                |         |
|---------------------|--------------|---------|-----------------|------------------------------|-----|-------------------------|----------------|--------|-----------------|-----------------|-------------------|--------------------------|----------------|---------|
| BOM Type            | Costing Type | Portion | Material Number | Part Name                    | Qty | List Price Per Unit(\$) | List Price(\$) | Dis(%) | Final Price(\$) | Repair/ Replace | Surveyor Quantity | Surveyor Final Price(\$) | Repair/Replace | Remarks |
| Standard            | Main         |         |                 | COVER, RR BUMPER ASSY        | 1   | 423.90                  | 423.90         | 25.00  | 317.92          | Replace         | 1                 | 0                        | Repair         | R       |
| Standard            | Main         |         |                 | REAR BUMPER REINFORCEMENT    | 1   | 318.80                  | 318.80         | 25.00  | 239.10          | Replace         | 0                 | 0                        | Not Give       | Xan     |
| Standard            | Main         |         |                 | PAD, RR BUMPER, RH & LH , 1  | 2   | 3.80                    | 7.60           | 25.00  | 5.70            | Replace         | 0                 | 0                        | Not Give       | Xan     |
| Standard            | Main         |         |                 | PAD, RR BUMPER, RH & LH , 2  | 2   | 3.80                    | 7.60           | 25.00  | 5.70            | Replace         | 0                 | 0                        | Not Give       | Xan     |
| Standard            | Main         |         |                 | PAD, RR BUMPER, RH & LH , 3  | 2   | 3.80                    | 7.60           | 25.00  | 5.70            | Replace         | 0                 | 0                        | Not Give       | Xan     |
| Standard            | Main         |         |                 | PAD, RR BUMPER, CTR          | 3   | 2.20                    | 6.60           | 25.00  | 4.95            | Replace         | 0                 | 0                        | Not Give       | Xan     |
| Standard            | Main         |         |                 | SEAL, RR BUMPER ARM, RH & LH | 2   | 11.00                   | 22.00          | 25.00  | 16.50           | Replace         | 0                 | 0                        | Not Give       | Xan     |
| Standard            | Main         |         |                 | STOPPER, RR BUMPER, RH & LH  | 2   | 4.30                    | 8.60           | 25.00  | 6.45            | Replace         | 0                 | 0                        | Not Give       | Xan     |
| Standard            | Main         |         |                 | RETAINER, RR BUMPER, RH      | 1   | 112.70                  | 112.70         | 25.00  | 84.53           | Replace         | 0                 | 0                        | Not Give       | Xan     |
| Standard            | Main         |         |                 | RETAINER, RR BUMPER, LH      | 1   | 111.50                  | 111.50         | 25.00  | 83.63           | Replace         | 0                 | 0                        | Not Give       | Xan     |
| Standard            | Main         |         |                 | SEAL, RR BUMPER , RH         | 1   | 85.20                   | 85.20          | 25.00  | 63.90           | Replace         | 0                 | 0                        | Not Give       | Xan     |
| Standard            | Main         |         |                 | SEAL, RR BUMPER , LH         | 1   | 85.20                   | 85.20          | 25.00  | 63.90           | Replace         | 0                 | 0                        | Not Give       | Xan     |
| Standard            | Main         |         |                 | CLIPS PIECE, FRT & RR BUMPER | 10  | 1.50                    | 15.00          | 25.00  | 11.25           | Replace         | 0                 | 0                        | Not Give       | Xan     |
| Standard            | Main         |         |                 | GUARD, RR BUMPER, LOWER      | 1   | 558.30                  | 558.30         | 25.00  | 418.72          | Replace         | 1                 | 418.72                   | Replace        | du-     |

Total Spare Part Cost 6,913.56

Surveyor Total 565.78

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20

Final Spare Part Cost 5,530.85

Final Sur Total 452.62



| SMRT Recommendation |              |         |                 |                                                |     |                         |                |        |                 |                 | Surveyor Approval |                          |                |         |
|---------------------|--------------|---------|-----------------|------------------------------------------------|-----|-------------------------|----------------|--------|-----------------|-----------------|-------------------|--------------------------|----------------|---------|
| Item Type           | Costing Type | Portion | Material Number | Part Name                                      | Qty | List Price Per Unit(\$) | List Price(\$) | Dis(%) | Final Price(\$) | Repair/ Replace | Surveyor Quantity | Surveyor Final Price(\$) | Repair/Replace | Remarks |
| Standard            | Main         |         |                 | FILLER, RR BUMPER , RH                         | 1   | 119.90                  | 119.90         | 25.00  | 89.93           | Replace         | 0                 | 0                        | Not Give       | X17     |
| Standard            | Main         |         |                 | FILLER, RR BUMPER , LH                         | 1   | 119.90                  | 119.90         | 25.00  | 89.93           | Replace         | 0                 | 0                        | Not Give       | X17     |
| Standard            | Main         |         |                 | SENSOR REVERSE                                 | 1   | 180.00                  | 180.00         | 0.00   | 180.00          | Replace         | 0                 | 0                        | Not Give       | X17     |
| Standard            | Main         |         |                 | ANTENNA, ELECTRICAL KEY                        | 1   | 60.30                   | 60.30          | 10.00  | 54.27           | Replace         | 0                 | 0                        | Not Give       | X17     |
| Standard            | Main         |         |                 | REAR BUMPER GROMMET SCREW                      | 2   | 2.20                    | 4.40           | 25.00  | 3.30            | Replace         | 0                 | 0                        | Not Give       | X17     |
| Standard            | Main         |         |                 | LENS & BODY, REAR COMBINATION LAMP , RH        | 1   | 438.10                  | 438.10         | 10.00  | 394.29          | Replace         | 0                 | 0                        | Not Give       | X17     |
| Standard            | Main         |         |                 | LENS & BODY, REAR COMBINATION LAMP , LH        | 1   | 438.10                  | 438.10         | 10.00  | 394.29          | Replace         | 0                 | 0                        | Not Give       | X17     |
| Standard            | Main         |         |                 | LENS & BODY ASSY , RR BUMPER , RH              | 1   | 486.80                  | 486.80         | 10.00  | 438.12          | Replace         | 0                 | 0                        | Not Give       | X17     |
| Standard            | Main         |         |                 | LENS & BODY ASSY , RR BUMPER , LH              | 1   | 486.80                  | 486.80         | 10.00  | 438.12          | Replace         | 0                 | 0                        | Not Give       | X17     |
| Standard            | Main         |         |                 | COVER, REAR FLOOR UNDER , LH                   | 1   | 234.30                  | 234.30         | 25.00  | 175.73          | Replace         | 0                 | 0                        | Not Give       | X17     |
| Standard            | Main         |         |                 | COVER, REAR FLOOR UNDER CENTER                 | 1   | 222.60                  | 222.60         | 25.00  | 166.95          | Replace         | 0                 | 0                        | Not Give       | X17     |
| Standard            | Main         |         |                 | TAIL GATE PANEL SUB-ASSY, BACK DOOR            | 1   | 929.60                  | 929.60         | 25.00  | 697.20          | Replace         | 0                 | 0                        | Not Give       | X17     |
| Standard            | Main         |         |                 | TAIL GATE WEATHERSTRIP, BACK DOOR              | 1   | 360.70                  | 360.70         | 25.00  | 270.53          | Replace         | 0                 | 0                        | Not Give       | X17     |
| Standard            | Main         |         |                 | TAIL GATE BACK DOOR OUTSIDE GARNISH SUB-ASSY   | 1   | 891.20                  | 891.20         | 25.00  | 668.40          | Replace         | 1                 | 0                        | Repair         | R       |
| Standard            | Main         |         |                 | NAME PLATE (HYBRID) , LUGGAGE COMPARTMENT DOOR | 1   | 52.30                   | 52.30          | 25.00  | 39.22           | Replace         | 1                 | 39.22                    | Replace        | new     |
| Standard            | Main         |         |                 | NAME PLATE (PRIUS) , LUGGAGE COMPARTMENT DOOR  | 1   | 52.30                   | 52.30          | 25.00  | 39.22           | Replace         | 1                 | 39.22                    | Replace        | new     |
| Standard            | Main         |         |                 | NAME PLATE (PRIUS) , LUGGAGE COMPARTMENT DOOR  | 1   | 52.30                   | 52.30          | 25.00  | 39.22           | Replace         | 1                 | 39.22                    | Replace        | new     |
| Standard            | Main         |         |                 | TAIL GATE LOCK ASSY, BACK DOOR                 | 1   | 452.10                  | 452.10         | 10.00  | 406.89          | Replace         | 0                 | 0                        | Not Give       | new     |

Total Spare Part Cost 6,913.56

Surveyor Total 565.78

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20

Final Spare Part Cost 5,530.85

Final Sur Total 452.62

| SMRT Recommendation   |              |         |                 |                                     |     |                         |                |        |                 |                        | Surveyor Approval |                          |                |         |
|-----------------------|--------------|---------|-----------------|-------------------------------------|-----|-------------------------|----------------|--------|-----------------|------------------------|-------------------|--------------------------|----------------|---------|
| DOM Type              | Costing Type | Portion | Material Number | Part Name                           | Qty | List Price Per Unit(\$) | List Price(\$) | Dis(%) | Final Price(\$) | Repair/ Replace        | Surveyor Quantity | Surveyor Final Price(\$) | Repair/Replace | Remarks |
| Standard              | Main         |         |                 | TAIL GATE LOCK COVER , BACK DOOR    | 1   | 25.30                   | 25.30          | 25.00  | 18.98           | Replace                | 0                 | 0                        | Not Give       | X11     |
| Standard              | Main         |         |                 | TAIL GATE STRIKER ASSY, BACK DOOR   | 1   | 24.90                   | 24.90          | 25.00  | 18.67           | Replace                | 0                 | 0                        | Not Give       | X11     |
| Standard              | Main         |         |                 | STRIDES LOGO                        | 1   | 7.80                    | 7.80           | 0.00   | 7.80            | Replace                | 1                 | 7.80                     | Replace        | me ✓    |
| Standard              | Main         |         |                 | STICKER DECAL 6555 8888             | 1   | 21.60                   | 21.60          | 0.00   | 21.60           | Replace                | 1                 | 21.60                    | Replace        | me ✓    |
| Standard              | Main         |         |                 | END PANEL SUB-ASSY, BODY LOWER BACK | 1   | 629.80                  | 629.80         | 25.00  | 472.35          | Replace                | 0                 | 0                        | Not Give       | X11     |
| Standard              | Main         |         |                 | SPARE TYRE PANEL , PAN, REAR FLOOR  | 1   | 564.80                  | 564.80         | 25.00  | 423.60          | Replace                | 0                 | 0                        | Not Give       | X11     |
| Standard              | Main         |         |                 | SEALANT SIKAFLEX                    | 1   | 37.00                   | 37.00          | 0.00   | 37.00           | Replace                | 0                 | 0                        | Not Give       | X11     |
| Total Spare Part Cost |              |         |                 |                                     |     |                         |                |        | 6,913.56        | Surveyor Total 565.78  |                   |                          |                |         |
| Lump Sum Discount (%) |              |         |                 |                                     |     |                         |                |        | 20.00           | Lump Sum Dis (%) 20    |                   |                          |                |         |
| Final Spare Part Cost |              |         |                 |                                     |     |                         |                |        | 5,530.85        | Final Sur Total 452.62 |                   |                          |                |         |

Labour's Cost Detail

| S.No.  | Costing Type | Job Scope              | SMRT Recommendation(\$) | Surveyor Adjustment(\$) | Remarks |
|--------|--------------|------------------------|-------------------------|-------------------------|---------|
| 1      | Main         | TO REPAIR REAR PORTION | 1,352.00                | 300                     |         |
| Total: |              |                        | 1,352.00                | 300.00                  |         |

Spray Cost Detail

| S.No.  | Costing Type | Job Scope                           | SMRT Recommendation(\$) | Surveyor Adjustment(\$) | Remarks |
|--------|--------------|-------------------------------------|-------------------------|-------------------------|---------|
| 1      | Main         | TO RESPRAY TAIL GATE                | 378.00                  | 0 X11                   |         |
| 2      | Main         | TO RESPRAY TAILGATE OUTSIDE GARNISH | 378.00                  | 100                     |         |
| 3      | Main         | TO RESPRAY REAR SPARE TYRE PANEL    | 180.00                  | 0 X11                   |         |
| 4      | Main         | TO RESPRAY REAR BUMPER              | 378.00                  | 200                     |         |
| 5      | Main         | TO RESPRAY REAR PANEL               | 180.00                  | 0 X11                   |         |
| Total: |              |                                     | 1,494.00                | 300.00                  |         |


Other Cost Detail

| S.No.  | Costing Type | Job Scope | SMRT Recommendation(\$) | Surveyor Adjustment(\$) | Remarks |
|--------|--------------|-----------|-------------------------|-------------------------|---------|
| Total: |              |           | 380.00                  | 0.00                    |         |



| Costing Type | Job Scope                               | SMRT Recommendation(\$) | Surveyor Adjustment(\$) | Remarks |
|--------------|-----------------------------------------|-------------------------|-------------------------|---------|
| 1 Main       | TO WASH AND VACUUM                      | 60.00                   | 0 XM                    |         |
| 2 Main       | TO REPLACE SUNDRY PARTS                 | 100.00                  | 0 XM                    |         |
| 3 Main       | TO APPLY RUST-PROOFING ON AFFECTED AREA | 100.00                  | 0 XM                    |         |
| 4 Main       | TO TEST AND REFIX REVERSE SENSOR SYSTEM | 120.00                  | 0 XM                    |         |
| Total:       |                                         | 380.00                  | 0.00                    |         |

## Summary
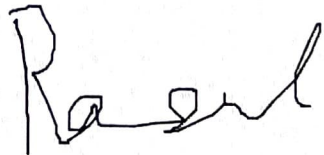
|                          | Estimator Assesment(\$)                                                             | Surveyor Assesment(\$)                                                                |
|--------------------------|-------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|
| Total Spare Part Detail  | 5,530.85                                                                            | 452.62                                                                                |
| Total Labour Cost        | 1,352.00                                                                            | 300.00                                                                                |
| Total Spray Painting     | 1,494.00                                                                            | 300.00                                                                                |
| Other                    | 380.00                                                                              | 0.00                                                                                  |
| Overall Total            | 8,756.85                                                                            | 1,052.62                                                                              |
| Lump Sum Repair Option   | <input type="checkbox"/>                                                            | <input checked="" type="checkbox"/>                                                   |
| Lump Sum Total           | 8,750.00                                                                            | 1,050.00                                                                              |
| Surveyor Approved Amount |                                                                                     | 1,050.00                                                                              |
| No of Repair Days*       | 7                                                                                   | 3                                                                                     |
| Remarks                  |                                                                                     | LUMP SUM REPAIR / RESURVEY AFTER REPAIR                                               |
| Surveyor Name            |                                                                                     | Rasul                                                                                 |
| Signature                |  |  |
| Survey Date              | 25/03/2022                                                                          | <input type="button" value="Save"/> <input type="button" value="Clear"/>              |

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

# SINGAPORE ACCIDENT STATEMENT

## IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

## ACCIDENT STATEMENT

|                                 |                                                         |
|---------------------------------|---------------------------------------------------------|
| Date of Submission              | 25/03/2022 14:37 (SGT)                                  |
| Date of Accident                | 25/03/2022 08:29 (SGT)                                  |
| Exact Location of Accident      | Bukit Batok East Ave 3, Singapore                       |
| Additional Location Information | BUKIT BATOK EAST AVE 3 TOWARDS BUKIT BATOK STREET<br>23 |
| Country/State of Loss           | Singapore                                               |

## DETAILS OF OWN VEHICLE

|                             |         |
|-----------------------------|---------|
| Vehicle Registration Number | SHF373Y |
|-----------------------------|---------|

### INSURED/POLICYHOLDER

|                          |                            |
|--------------------------|----------------------------|
| Is company?              | Yes                        |
| Name Of Registered Owner | Strides Taxi Pte Ltd       |
| Company Reg No           | 1XXXXX369K                 |
| Email Address            | AUTO-SVCS-TARC@SMRT.COM.SG |
| Mobile Phone No          | (Phone) +65-68662671       |
| Alternative Phone No     | (Office) +65-68662672      |

### VEHICLE PARTICULARS

|                                                                              |                           |
|------------------------------------------------------------------------------|---------------------------|
| Manufacturer                                                                 | Toyota                    |
| Model                                                                        | Prius                     |
| Variant                                                                      | -                         |
| Exact purpose for which vehicle was being used at time of accident           | -                         |
| Are you claiming under your own insurance policy for repair to your vehicle? | No - Claiming third party |
| Vehicle Category                                                             | Taxi                      |
| Transmission                                                                 | Auto                      |
| CC                                                                           | 1800                      |

### INSURANCE COMPANY

|                           |                                |
|---------------------------|--------------------------------|
| Name of Insurance Company | MS First Capital Insurance Ltd |
| Type of Coverage          | ThirdParty                     |
| Fleet Policy              | Yes                            |
| Policy Number             | D-21097466MFSH                 |
| Cover Note Number         | -                              |

### DRIVER

|                |                |
|----------------|----------------|
| Name of Driver | AMIR BIN OSMAN |
|----------------|----------------|



SXXXX881A  
10/07/1973  
Outdoor  
24/07/2000  
21 YEARS AND 8 MONTHS  
Male  
(Phone) +65-68662672  
-  
AUTO-SVCS-TARC@SMRT.COM.SG  
11  
-  
-  
No  
Hirer  
No  
-  
-

|                          |                          |
|--------------------------|--------------------------|
| Type of Accident .....   | Collision - Head to Rear |
| Weather Conditions ..... | Clear                    |
| Road Surface .....       | Dry                      |

|                                                                                                     |     |
|-----------------------------------------------------------------------------------------------------|-----|
| Was any foreign vehicle involved in the accident?                                                   | No  |
| Number of vehicles involved in the accident                                                         | 2   |
| Was anybody injured in the Accident?                                                                | No  |
| Was any injured conveyed to hospital by ambulance?                                                  | -   |
| Was any other vehicle or property damaged?                                                          | Yes |
| Number of Passengers (Including Driver)                                                             | 2   |
| Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance? | No  |

|        |         |
|--------|---------|
| Name   | UNKNOWN |
| Gender | Female  |

|                                           |    |
|-------------------------------------------|----|
| Was the accident reported to the police?  | No |
| Was notice of intended Prosecution given? | No |
| If yes, against whom?                     | -  |

I WAS TRAVELLING ALONG BUKIT BATOK AVE 3 TOWARDS BUKIT BATOK STREET 23 WITH ONE PASSENGER (FEMALE CHINESE) ON BOARD. FRONT VEHICLE STOPPED AND I FOLLOWED SUIT. AFTER WHICH I FELT AN IMPACT AT THE REAR OF MY TAXI. A VEHICLE YQ5504U HAD COLLIDED ONTO THE REAR OF MY TAXI.

|                                                   |              |
|---------------------------------------------------|--------------|
| Are accident photos available for attachment?     | Yes          |
| Was there any video captured by Car Camera?       | Yes          |
| Reasons for not uploading a video of the accident | FILE TOO BIG |
| Was there any audio recorded?                     | No           |

|                             |         |
|-----------------------------|---------|
| Vehicle Registration Number | YQ5504U |
| Vehicle Manufacturer        |         |

Model  
Variant  
Colour  
Category  
Name of Driver  
Contact Number  
Address  
Address complement  
Postcode  
Insurance Company Name  
Nature Of Damage  
Details of property damaged in accident  
No. Of Passenger (Including Driver)

Commercial vehicle  
KARUPPASAMY KARTHIKAIRAJA





## SKETCH PLAN

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

#### 8. Consent under the Personal Data Protection Act (PDPA)


I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' law yers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
- (collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' law yers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and

(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their law yers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

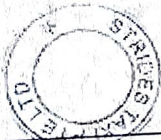

Policyholder's Signature / Date & Time

Sketch Plan

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

25/03/2022

25-3-2022



> Back to OneMotoring

### Enquire PARF/COE Rebate for Registered Vehicle

|                               |                                      |
|-------------------------------|--------------------------------------|
| Owner ID Type:                | Company                              |
| Owner ID:                     | 369K                                 |
| Vehicle No.:                  | SHF373Y                              |
| Vehicle to be Exported:       | No                                   |
| Intended Deregistration Date: | 28 Mar 2022                          |
| Vehicle Make:                 | TOYOTA                               |
| Vehicle Model:                | PRIUS HYBRID 1.8 CVT                 |
| Primary Colour:               | Maroon                               |
| Manufacturing Year:           | 2017                                 |
| Engine No.:                   | 2ZR8297615                           |
| Chassis No.:                  | JTDKB3FU303580812                    |
| Maximum Power Output:         | 90.0 kW (120 bhp)                    |
| Open Market Value:            | \$29,007.00                          |
| Original Registration Date:   | 19 Dec 2017                          |
| First Registration Date:      | 19 Dec 2017                          |
| Transfer Count:               | 0                                    |
| Actual ARF Paid:              | \$5,000.00                           |
| PARF Eligibility:             | Yes                                  |
| PARF Eligibility Expiry Date: | 18 Dec 2025                          |
| PARF Rebate Amount:           | \$3,750.00                           |
| COE Expiry Date:              | 18 Dec 2025                          |
| COE Category:                 | A - Car up to 1600cc & 97kW (130bhp) |
| COE Period(Years):            | 8                                    |
| PQP Paid:                     | \$34,159.00                          |
| COE Rebate Amount:            | \$15,886.00                          |
| Total Rebate Amount:          | \$19,636.00                          |

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 28 Mar 2022

OK