



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2203430

INV Date 06/06/2022

Reference CC4/LPC22003153/Gpa3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SLS 1855B
Insured Veh. XD 3894L
Claim No. 21/22/22/VC05/025619
Policy No. Z21VC05008429
Accident Date 30/03/2022
Inspection Date 11/04/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC22003153/Gpa3q2 Date: 06/06/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	XD 3894L	Veh. Inspected	SLS 1855B	
Policy No.	Z21VC05008429	Coverage (\$)	0.00	
Claim No.	21/22/22/VC05/025619	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	11/04/2022	
2. Vehicle Particulars & Condition				
Make & Model	HONDA ODYSSEY 2.4 EXV-S	c.c	2356	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	JHMRC1890HC203471	Colour	SILVER	
Odometer	97183 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/55 R17	YOKOHAMA	6 mm	
L/H Front Tyre	215/55 R17	YOKOHAMA	6 mm	
R/H Rear Tyre	215/55 R17	YOKOHAMA	6 mm	
L/H Rear Tyre	215/55 R17	YOKOHAMA	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	30/03/2022	Inspection Date	11/04/2022	
Survey held at	KAH MOTOR.CO.SDN.BHD 6A MANDAI ESTATE SINGAPORE 729903			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLS 1855B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	PANEL COMPL .FR.DOOR (SN)	BENT	716.02	716.02
1	TAPE SETL.FR.DOOR SASH INNER (SN)	NECESSARY	30.67	30.67
1	PANEL COMPL.SLIDE DOOR (SN)	BUCKLED	800.25	800.25
1	TAPE SETL .RR.DOOR SASH INNER (SN)	NECESSARY	45.67	45.67
1	MOLDING ASSYL .FR.DOOR (SN)	NECESSARY	59.10	59.10
1	MOLDING ASSYL .RR.DOOR (SN)	NECESSARY	55.65	55.65
1	HANDLE COMPL .FR (SN)	CUT	252.67	252.67
1	COVER COMPL.FR (SN)	CUT	32.25	32.25
1	HANDLE COMPL .RR (SN)	MISSING	57.00	57.00
1	COVER COMPL .RR (SN)	MISSING	30.37	30.37
1	BASE COMPL.RR (SN)	BROKEN	36.52	36.52
1	GARNISH ASSYL.FR.DOOR LOWER (SN)	NECESSARY	231.67	231.67
1	GARNISH ASSYL.SLIDE DOOR LWR (SN)	NECESSARY	217.57	217.57
1	SUNDRIES (SN)	NECESSARY	60.00	40.00
1	TAPE ,L.FR.DOOR SASH UPPER (SN) (ADDITIONAL)	NECESSARY	29.77	29.77
1	TAPESLIDE ,DR.REFLECTOR (SN) (ADDITIONAL)	NECESSARY	4.05	4.05
1	MOLDING ,SLIDE DOOR RETAINER (SN) (ADDITIONAL)	NECESSARY	77.25	77.25
1	SEAT AL,RR (SN) (ADDITIONAL)	NECESSARY	3.90	3.90
1	SEAT BL.RR (SN) (ADDITIONAL)	NECESSARY	3.90	3.90
			2,744.28	2,724.28
	<u>LABOUR</u>			
	REMOVE & TRANSFER ITEMS TO NEW FR L DR ADJUST.		300.00	300.00
	REMOVE & TRANSFER ITEMS TO NEW RR L SLIDING DR.		650.00	650.00
	APPLY DOOR JOINT SEALANT .		200.00	200.00
	STRAIGHTEN & KNOCKOUT CTR PILLAR OUTER PANEL.		1,500.00	1,300.00
	SPRAY PAINTING ON REPAIRED OR REPLACED AREAS .		1,800.00	1,080.00
			4,450.00	3,530.00
	GRAND TOTAL		7,194.28	6,254.28



RECOMMENDED COST OF REPAIRS			6,254.28
-----------------------------	--	--	----------

Report Ref No. CC4/LPC22003153/Gpa3q2

XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLS 1855B

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

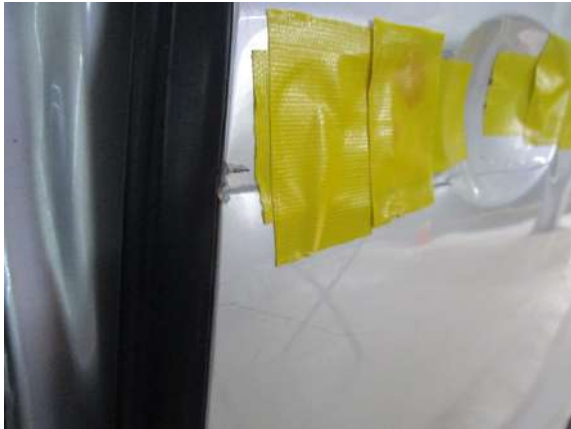



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLS 1855B

RE-INSPECTION

