



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

EQ INSURANCE COMPANY LTD

INV No. AC2203307

5 MAXWELL ROAD
#17-00 TOWER BLOCK
MND COMPLEX
SINGAPORE 069110

INV Date 31/05/2022
Reference CS/EQI22003271/Kqy3s2
Code EQI

PROFESSIONAL SERVICE FEE

Vehicle No. SMN 9377B
Insured Veh. YP 8051U
Claim No. DM22HO00539/MT
Policy No. DMCPHQ21-004340
Accident Date 04/04/2022
Inspection Date 11/04/2022

Description	Total
Survey Inspection	300.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	300.00
GST (7%)	21.00
Grand Total	321.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

NSA



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
EQ INSURANCE COMPANY LTD 5 MAXWELL ROAD #17-00 TOWER BLOCK MND COMPLEXSINGAPORE 069110		Ref: CS/EQI22003271/Kqy3s2 Date: 31/05/2022 Code: EQI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	YP 8051U	Veh. Inspected	SMN 9377B
Policy No.	DMCPHQ21-004340	Coverage (\$)	0.00
Claim No.	DM22HO00539/MT	Excess (\$)	0.00
Assign From	MELODY TEOH	Assign Date	08/04/2022
2. Vehicle Particulars & Condition			
Make & Model	RENAULT SCENIC (A)	c.c	1461
Engine No.	HIDDEN	Year of Reg.	2019
Chassis No.	VF1RFA00562894830	Colour	METALLIC RED
Odometer	156567 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	195/55 R20	TOURADOR	8 mm
L/H Front Tyre	195/55 R20	TOURADOR	8 mm
R/H Rear Tyre	195/55 R20	TOURADOR	8 mm
L/H Rear Tyre	195/55 R20	TOURADOR	8 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	04/04/2022	Inspection Date	11/04/2022
Survey held at	MUNICH AUTOCARE PTE LTD 60 JALAN LAM HUAT #07-43 CARROS CENTER SINGAPORE 737869		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMN 9377B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR WINDSCREEN GLASS	CRACKED	950.52	950.30
1	TAILGATE OUTER PANEL GS4 (GARNISH)	SERVICEABLE	844.69	-
1	TAILGATE ASSY	SERVICEABLE	3,034.42	-
2	TAILGATE HINGE LH / RH GS4 @ \$445.66	TO REPAIR SEE LABOUR	891.32	-
2	TAILGATE DAMPER L&R GS4 S4 @ \$266.49	SERVICEABLE	532.98	-
1	EMBLEM "DIAMOND"	NOT NECESSARY	218.83	-
1	LETTERING "RENAULT"	NOT NECESSARY	143.37	-
1	LETTERING "SCENIC"	NOT NECESSARY	181.84	-
1	TAILGATE LOCK CATCHER	TO REPAIR SEE LABOUR	157.57	-
1	TAILGATE LOCK ASSY	TO REPAIR SEE LABOUR	154.30	-
1	REAR TAIL LAMP RH	SERVICEABLE	602.37	-
1	REAR TAIL LAMP LH	BROKEN	602.37	602.37
1	REAR TAIL GATE LAMP LH	CUT / CRACKED	602.37	602.37
1	REAR TAILGATE LAMP RH	SERVICEABLE	602.37	-
1	REAR TAIL GATE WEATHERSTRIP	SERVICEABLE	449.95	-
1	REVERSE CAMERA	SERVICEABLE	916.51	-
1	REAR TAIL LAMP PANEL LH	TO REPAIR SEE LABOUR	691.68	-
1	REAR FENDER LH	BENT	1,715.16	1,560.10
1	REAR FENDER OUTER PANEL	TO REPAIR SEE LABOUR	1,854.00	-
1	REAR WHEEL SHIELD INNER	DISTORTED	347.18	243.00
1	REAR BOOT COMPARTMENT BOARD	SERVICEABLE	755.46	-
1	REINFORCEMENT REAR PANEL	TO REPAIR SEE LABOUR	1,013.00	-
1	REINFORCEMENT REAR INNER PANEL	TO REPAIR SEE LABOUR	483.43	-
1	MBR PRE ASSY-SIDE, INTER CHASSIS LH	TO REPAIR SEE LABOUR	1,253.47	-
1	SPARE TYRE PANEL	TO REPAIR SEE LABOUR	1,615.68	-

Report Ref No. CS/EQI22003271/Kqy3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR SIDE AIR DUCT	DENTED	88.20	88.20
1	REAR BUMPER LOWER REFLECTOR LH	SERVICEABLE	467.10	-
1	BUMPER REAR	TORN	1,252.80	1,252.00
1	REAR BUMPER PAD LOWER (BLACK)	MTG CRACKED	749.65	698.00
1	REAR BUMPER LOWER (SILVER)	SERVICEABLE	652.32	-
1	REAR BUMPER REINFORCEMENT	TO REPAIR SEE LABOUR	862.92	-
2	REAR BUMPER LOWER PAD SUPPORT CTE @ \$109.62	SERVICEABLE	219.24	-
1	REAR BUMPER LOWER SUPPORT LH	CRACKED	143.10	143.10
1	REAR BUMPER LOWER SUPPORT RH	SERVICEABLE	143.10	-
1	REAR BUMPER SENSOR HARNESS	SERVICEABLE	260.82	-
1	BUMPER REAR BRACKET LH	CRACKED	362.74	161.00
1	BUMPER RR LH UNDER COVER	SERVICEABLE	376.78	-
1	STOP TRUNK TAIL GATE	SERVICEABLE	23.23	-
2	REAR REVERSE SENSOR @ \$328.00	SERVICEABLE	656.00	-
1	BLIND SPOT SENSOR	MISSING	515.43	472.00
1	EXHAUST PIPE REAR SILENCER	TO REPAIR SEE LABOUR	1,219.00	-
1	EXHAUST CLAMP	TO REPAIR SEE LABOUR	130.77	-
1	EXHAUST HEAT SHIELD REAR END	TO REPAIR SEE LABOUR	361.90	-
1	EXHAUST HEAT SHIELD OUTER	TO REPAIR SEE LABOUR	246.78	-
6	RIVET FIX P @ \$11.34	NOT NECESSARY	68.04	-
10	RIVET SILVER @ \$9.45	NOT NECESSARY	94.50	-
	LESS 10% DISCOUNT		-	-677.24
			29,509.26	6,095.20
	<u>SPECIAL NETT ITEMS</u>			
1	SET REAR TAILGATE WINDSCREEN SEALANT WITH PRIMER (SN)	NECESSARY	35.00	35.00
1	REAR TYRE PANEL SEALANT (SN)	NOT NECESSARY	35.00	-
1	REAR END PANEL SEALANT (SN)	NOT NECESSARY	35.00	-
6	SET REAR TAIL GATE OUTER GARNISH CLIPS @ \$7.00 (SN)	NOT NECESSARY	42.00	-

Report Ref No. CS/EQI22003271/Kqy3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR OUTER GLASS SEALANT (SN)	NECESSARY	35.00	35.00
1	REAR WINDGLASS SOLAR FILM (SN)	NECESSARY	180.00	120.00
1	PHV DECAL (SN)	NECESSARY	20.00	20.00
			382.00	210.00
	LABOUR			
	TO PANEL BEATING, REALIGN DISMANTLE REAR BUMPER, REAR BOOT LID, END PANEL OUTER, REAR FENDER LH AND ALL NECESSARY ETC. INCLUSIVE OF THE REPAIR OF TAILGATE HINGE LH / RH GS4, TAILGATE LOCK CATCHER, TAILGATE LOCK ASSY, REAR TAIL LAMP PANEL LH, REAR FENDER OUTER PANEL, REINFORCEMENT REAR PANEL, REINFORCEMENT REAR INNER PANEL, MBR PRE ASSY-SIDE, INTER CHASSIS LH, SPARE TYRE PANEL, REAR BUMPER REINFORCEMENT, EXHAUST PIPE REAR SILENCER, EXHAUST CLAMP, EXHAUST HEAT SHIELD REAR END }		1,800.00	700.00
	AND EXHAUST HEAT SHIELD OUTER. }		-	-
	TO CHECK ELECTRICAL WIRING SYSTEM OF REAR SECTION FOR PROPER FUNCTION INCLUDING ADJUSTMENT OF REAR TAIL GATE LAMP & TAIL LAMP LH/RH.		120.00	20.00
	TO DISMANTLE & RENEW REVERSE SENSOR.		120.00	60.00
	TO REMOVE AND REFIX REVERSE SENSOR WIRE HARDESS.	NOT NECESSARY	120.00	-
	TO REMOVE & INSTALL REAR BOOT COMPARTMENT INTERIOR CARPET AND LUGGAGE COMPARTMENT AND SIDE FENDER INNER TRIM TO FACILITATE REPAIR.	NOT NECESSARY	180.00	-
	TO REMOVE AND REFIT REAR WINDSCREEN.		120.00	120.00
	TO DISMANTLE & REFIX REAR OUTER GLASS LH.		80.00	60.00
	TO TEST WATER SEEPAGE REAR SCREEN & SUNROOF WATER LEAKAGE.	NOT NECESSARY	80.00	-
	TO CONDUCT RE-PROGRAMME AND RESETTING OF REVERSE SYSTEM FAULT CODE.	NOT NECESSARY	280.00	-
	TO APPLY RUST-PROOFING ON AFFECTED AREA.		120.00	30.00
	TO TRANSFER REAR TAIL GATE MECHANISM.	NOT NECESSARY	120.00	-
	TO TOW ACCIDENT VEHICLE TO WORKSHOP.		80.00	50.00
	TO REMOVE AND INSTALL NEW SUSPENSION ON REAR LH SECTION.	NOT NECESSARY	120.00	-

Report Ref No. CS/EQI22003271/Kqy3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO SUPPLY PAINT SUNDRIES INCLUDING TO VACUUM GAS CLEANER.	NOT NECESSARY	80.00	20.00
	TO TEST EXHAUST ASSY INCLUDING ALIGNMENT AND CHECK LEAKS.		80.00	-
	TO PUTTY & RESPRAY PAINTING REAR BUMPER, REAR BOOT LID, END PANEL, CHASSIS LH/RH, REAR FENDER LH AND ALL NECESSARY ETC.		1,500.00	800.00
			5,000.00	1,860.00
GRAND TOTAL			34,891.26	8,165.20
RECOMMENDED COST OF REPAIRS				8,165.20

Report Ref No. CS/EQI22003271/Kqy3s2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 08/04/2022 08:55 (SGT)
Date of Accident 04/04/2022 14:00 (SGT)
Exact Location of Accident Singapore
Additional Location Information seletar expressway
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SMN9377B

INSURED/POLICYHOLDER

Is company? Yes
Name Of Registered Owner BIS MOTORING PTE LTD
Company Reg No 201735055D
Email Address KEIFTAN@BISMOTORING.COM.SG
Mobile Phone No (Phone) +65-86881311
Alternative Phone No +65-86881311

VEHICLE PARTICULARS

Manufacturer Renault
Model Scenic
Variant -
Exact purpose for which vehicle was being used at time of accident Private hire
Are you claiming under your own insurance policy for repair to your vehicle? No - Claiming third party
Vehicle Category Private hire
Transmission Auto
CC 1496

INSURANCE COMPANY

Name of Insurance Company ECICS Limited
Type of Coverage Comprehensive
Fleet Policy Yes
Policy Number MCF22A00000100
Cover Note Number -

DRIVER

Name of Driver MUSTAFFA BIN PALIL
NRIC No S1714581I

Date Of Birth	23/08/1964
Occupation	Outdoor
Date Of Driving Pass	25/08/1987
Driving experience	34 YEARS AND 8 MONTHS
Gender	Male
Mobile Number	(Phone) +65-88981097
Alt. Phone Number	-
Email Address	MFU838@GMAIL.COM
Address	89 BEDOK NORTH STREET 4
Address complement	#04-115
Postcode	460089
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Hirer
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Head to Rear
Weather Conditions	drizzling
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	Yes
Was any injured conveyed to hospital by ambulance?	No
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	2
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

PASSENGER 1

Name	GRAB PASSENGER
Gender	Female

DETAILS OF POLICE ACTION

Was the accident reported to the police?	Yes
Police Station Name	Thomson Neighbourhood Police Post
Police Station Phone No	(Phone) +65-18004529999
Alt. Police Station Phone No	(Fax) +65-65535740
Police Station Address	Blk 25 Sin Ming Road #01-180 Singapore 570025
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER TO POLICE REPORT NO: T/20220404/2110

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes
Was there any audio recorded?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	YP8051U
Vehicle Manufacturer	-

Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Commercial vehicle
Name of Driver	RADHAKRISHNAN MALARVANNAN
Passport No/FIN	G3126920U
Contact Number	(Phone) +65-89107484
Address	-
Address complement	-
Postcode	-
Insurance Company Name	EQ Insurance Company Ltd
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

INJURED PERSONS DETAILS

INJURED 1

Name of injured person	MUSTAFFA BIN PALIL
Gender	Male
Phone No	(Phone) +65-88981097
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	-
Injuries Sustained	5 DAYS MEDICAL LEAVE
Injured person in which vehicle?	SMN9377B
Were seat belts worn?	Yes
Was this injured conveyed to hospital by ambulance?	No

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all Insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature
Date & Time:

Driver's Signature
(if driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

SKETCH PLAN

Sketch Plan

A SMN 9373B

B YP8051M

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

RECALL POINT REQUEST NO. T/20220406/2110

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(if driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

GLARMC SketchPlanForm_V3





**SINGAPORE
POLICE FORCE**



T/20220404/2110

Police Station Of Origin:
Thomson NPP
25 Sin Ming Road #01-180 SINGAPORE
570025
Tel No: 1800-4529999

1 of 3

Report No. T/20220404/2110

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 04/04/2022 19:06		Vide Report No.:		Station Diary No.: 47	
Informant's Particulars					
Name of Informant: MUSTAFA BIN PALIL			Address: APT BLK 89 BEDOK NORTH STREET 4 #04-115 SINGAPORE 460089		
ID Type / ID No.: NRIC NO / S17145811			Contact No.: Home/Office: Mobile: 88981097		
Nationality: SINGAPORE CITIZEN			Email:		
Sex: Male	Age: 57	Date of Birth: 23/08/1964	Type of Informant: Driver		
Race: Malay			Language:		Institution / School Name:
Occupation: GRAB DRIVER			Driving Licence Information: Class: 2B,2A,3 Date of Expiry:		

General Information of the Accident				
Type of Accident:	Injury Others	Drink Drive: No	Date/Time of Accident: 04/04/2022 14:00	Type of Location: Straight Road
Location: SELETAR EXPRESSWAY				
Weather: Drizzling		Road Surface: Dry		Road Speed Limit:
Traffic Flow: One Way		Traffic Control: Not Controlled		Traffic Volume: Heavy
Type of Collision: Between Moving Vehicles - Head To Rear				Anyone conveyed by ambulance: No

Details of Vehicle Involved						
Vehicle No.	Type	Make	Model	Color	Condition	No. of Passenger
SMN9377B	Car				Seriously Damaged	1
YP8051U	Lorry				Slightly Damaged	1

Details of Person Involved	
Any Pedestrian Involved: No	
No. of Pedestrians Injured: NIL	Use of Pedestrian Crossing: NA



**SINGAPORE
POLICE FORCE**



T/20220404/2110

Police Station Of Origin:
Thomson NPP
25 Sin Ming Road #01-180 SINGAPORE
570025
Tel No: 1800-4529999

2 of 3

Report No. T/20220404/2110

CONTINUATION OF REPORT

Driver			
Name	MUSTAFA BIN PALIL	ID No.	S1714581I
Related Vehicle	SMN9377B (Car)	Contact No.	88981097
Hospital/Clinic	MOUNT ALVERNIA HOSPITAL	Class of Driving Licence & Expiry Date	Class: 2B,2A,3 Date of Expiry: NIL
Date Treatment	04/04/2022	Date Discharge	NIL
No. of Days granted Medical Leave	05	Degree of Injury	Slight
Driver			
Name	RADHAKRISHNAN MALARVANNAN	ID No.	G3126920U
Related Vehicle	YP8051U (Lorry)	Contact No.	89107484
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: 2B,3 Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL

Brief Details.

On 04/04/2022 at about 1400hrs, I was travelling (SMN9377B) along SLE towards Woodlands Ave 12. As it was congested at the exit, I was at a complete stop waiting for the vehicles in front of me to move. Suddenly a lorry (YP8051U) came from the back and hit onto the rear of my vehicle. We then alighted to exchanged particulars and subsequently I felt pain on my shoulder and neck, as such I went to see a doctor. I was given a 5-day MC. No government property damaged.

I am lodging this police report for investigations and insurance claims purposes.



**SINGAPORE
POLICE FORCE**



T/20220404/2110

Police Station Of Origin:
Thomson NPP
25 Sin Ming Road #01-180 SINGAPORE
570025
Tel No: 1800-4529999

3 of 3



Report No. T/20220404/2110

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature of Officer Recording The Report: E / SGT 2 ONG WEI SHENG BRIAN 	Signature Of Informant: 
Signature Of Interpreter: Not applicable	Date/Time: 04/04/2022 19:06
Officer In Charge Of Case: TP / AEIT / SI ANG YI TING, STEPHANIE Contact No.: 65476414	Classification Of Case:

NP168



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMN 9377B

INSPECTION

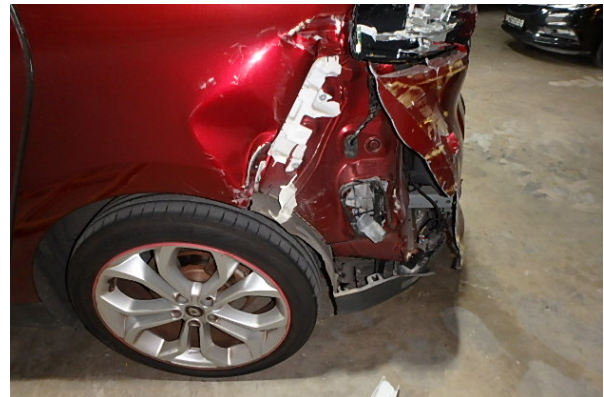




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

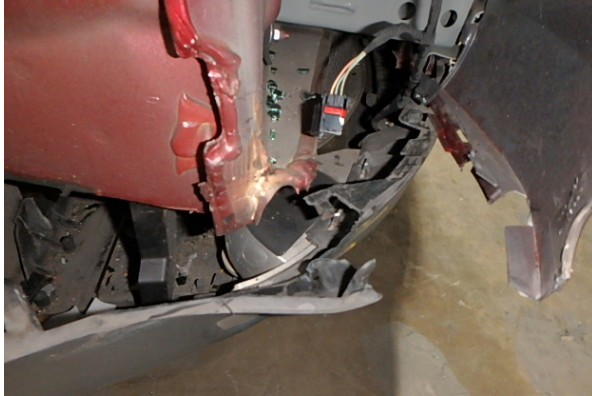



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMN 9377B

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

