

ASS. REC. BY: ASU

REF:

CS/AH 22003430/Rty3

2076

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

☒ OD / ☐ TP / ☐ WS / ☐ TP RES / ☐ OD RES / ☐ EVA / ☐ INV / ☐ MVTo Inspect Vehicle No: FBN8422Rat Workshop m/s BIKE PRODUCTIONof 610, SPANGLON RDInsured: AH

Policy No. _____

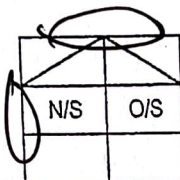
Claims No. _____

Sum Insured: _____ Excess: TBA

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 9K

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / ☒ REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: FBN8422R Yr Regn: 2018 / 082Type: M.Car / ☒ M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Honda FS150F c.c. 149Colour: MULT A/C: Insured / Std / NI / NA

Sp. Reading: _____ T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: PMKKC 2760 KB 208779Gen. Cond: Good / ☒ Fair / Poor / BurntSteering: ☒ In order / Jammed / Leaked / Burnt orBrake: ☒ In order / Jammed / Leaked / Burnt orModi: Nil / ☒ S/Rim / STD A/Rim orTyre Size: F: 90/80-17R: 110/70-17☒ BS / ☐ DUN / ☐ EXNOVA / ☐ GY / ☐ FS / ☐ LIZA / ☐ MIC / ☐ OHTSU / ☐ PIR / ☐ SUMI /
TOYO / YOKO or

Front

R/Bal. 3 mm

Rear

R/Bal. 4 mm

L/Bal. _____ mm

L/Bal. _____ mm

D.O.A. 28/05/21D.O.I. 14/06/22Survey held at BIKE PRODUCTION

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

REPAIR LIMIT - 6K

Date/Time, File Pass to?

☐ : Preli. Report

1)

☐ : Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee: ☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech. Invs (\$ _____)☐ : Weekend (\$ _____)

Survey Fee: _____

Transportation: _____

S + RS. \$ _____

Photos

Others

TOTAL

Report Format: _____

Lump Sum / I.B.R. (\$) _____

BIKE PRODUCTION PTE LTD

610, Serangoon Road S(218216)

Tel: 63922555, 62995177 Fax: 62975400

ROC/ GST Reg No.: 200007407G

Date: 11 Apr 2022

ASSESSMENT FOR REPAIR: HONDA FS150F - FBN8422R

Chassis No.:

Engine No.:

<u>Qty</u>	<u>Description</u>	<u>Estimate</u>
1 pc	Front mudguard <i>cm</i>	\$145.00
1 pc	Front wheel axle <i>?</i>	\$75.00
1 pc	Front right brake disk <i>?</i>	\$155.00
1 pc	Front left fork assy <i>bt</i>	\$290.00
1 pc	Front right fork assy <i>bt</i>	\$290.00
2 pcs	Steering stem bearing <i>ae</i>	\$90.00
1 pc	Front fork steering stem <i>?</i>	\$275.00
1 pc	Front left signal assy <i>mic</i>	\$55.00
1 pc	Front right signal assy <i>cm</i>	\$55.00
1 pc	Front cowling inner left <i>mis</i>	\$105.00
1 pc	Front cowling inner right <i>de</i>	\$105.00
1 pc	Front cowling assy <i>cm</i>	\$135.00
1 pc	Front cowling decals <i>ae</i>	\$45.00
1 pc	Front downlight assy <i>mis</i>	\$220.00
1 pc	Headlamp assy <i>mis</i>	\$295.00
1 pc	Headlamp bracket <i>?</i>	\$185.00
1 pc	Left side fairing assy <i>mis</i>	\$155.00
1 pc	Left side fairing decals <i>ae</i>	\$45.00
1 pc	Left side black fairing <i>cm</i>	\$105.00
1 pc	Right side fairing assy <i>cm</i>	\$155.00
1 pc	Right side fairing decals <i>ae</i>	\$45.00
1 pc	Right side black fairing <i>cm</i>	\$105.00
1 pc	Brake lever <i>repair</i>	\$55.00
1 pc	Clutch lever <i>see</i>	\$55.00
1 pc	IU bracket <i>bt</i>	\$45.00
1 pc	Steering handle <i>?</i>	\$145.00
1 pc	Left handle balancer <i>see</i>	\$45.00
1 pc	Left view mirror <i>br</i>	\$65.00
1 pc	Right view mirror <i>X</i>	\$65.00
1 pc	Headlamp inner black cover <i>cm</i>	\$95.00
1 pc	Front inner black cover <i>cm</i>	\$145.00
1 pc	Left front footrest <i>bt</i>	\$55.00
1 pc	Left front footrest holder <i>bt</i>	\$125.00
1 pc	Left rear footrest <i>see</i>	\$45.00
1 pc	Left rear footrest holder <i>see</i>	\$125.00
1 pc	Subframe assy <i>?</i>	\$480.00
1 pc	Left rear cover <i>see</i>	\$135.00
1 pc	Left rear cover emblem <i>ae</i>	\$55.00
1 pc	Left rear cover labels <i>ae</i>	\$45.00
1 pc	Radiator assy <i>st</i>	\$330.00
1 pc	Radiator spare tank <i>X</i>	\$145.00
1 pc	Center basket <i>cm</i>	\$35.00
1 pc	Left rear body cover black <i>see</i>	\$90.00
1 pc	Box bracket <i>bt</i>	\$175.00

1 pc	wiring harness ?	\$145.00
1 pc	Head assy <i>cm</i>	\$495.00
1 pc	Radiator inner cover <i>ad</i>	\$105.00
1 pc	Gear pedal assy <i>st</i>	\$135.00
1 pc	Block and piston assy ?	\$550.00
1 pc	Exhaust heat shield <i>3x</i>	\$95.00
1 pc	Swing arm assy ?	\$395.00
1 pc	Left rear signal <i>cm</i>	\$55.00
1 pc	Left right signal <i>cm</i>	\$55.00
1 pc	Exhaust assy <i>repair</i>	\$580.00

\$8,295.00
\$829.50
\$7,465.50

Less discount 10%

Special nett items

1 pc	Coolant <i>cm</i>	\$50.00 <i>30</i>
1 pc	Front sport rim <i>cm</i>	\$395.00 <i>250</i>
1 pc	Rear sport rim <i>repair</i>	\$395.00 <i>250</i>
1 set	Chain and sprockets <i>st</i>	\$185.00 <i>150</i>
1 pc	Top case <i>cm</i>	\$280.00 <i>100</i>
1 pc	Front number plate <i>ms</i>	\$20.00 <i>10</i>
1 pc	Rear number plate <i>st</i>	\$30.00 <i>20</i>

- | | | |
|----|---|--------------------------------|
| 1) | Towing charges | \$120.00 <i>40</i> |
| 2) | Replace, realign and adjust above damaged parts, check wiring and lighting system | \$800.00 <i>400</i> |
| 3) | To replace and balance front and rear wheel rims | \$150.00 <i>80</i> |
| 4) | To knock, straighten chassis & body balancing | \$450.00 <i>200</i> |
| 5) | To remove/refit, replace (if damage) check and straighten front fork tubes. | \$150.00 <i>80</i> |
| 6) | Spray painting | \$400.00 <i>300</i> |

Total Estimate

\$10,890.50

Note: The above estimate is subjected to the prevailing GST of 7%



For Bike Production Pte Ltd

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Farul
Hg 90010068
7 days
4/5
14/04/22 P1145
EXCESS: TBA
Rover
Resurvey after repair

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Owner ID Type:	Singapore NRIC
Owner ID:	707G
Vehicle No.:	FBN8422R
Vehicle to be Exported:	No
Intended Deregistration Date:	16 Apr 2022
Vehicle Make:	HONDA
Vehicle Model:	FS150F
Primary Colour:	Red
Manufacturing Year:	2018
Engine No.:	KC27E2214732
Chassis No.:	PMKKC2760KB208779
Maximum Power Output:	-
Open Market Value:	\$2,499.00
Original Registration Date:	21 Dec 2018
First Registration Date:	21 Dec 2018
Transfer Count:	3
Actual ARF Paid:	\$375.00
PARF Eligibility:	No
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
COE Expiry Date:	20 Dec 2028
COE Category:	D - Motorcycle
COE Period(Years):	10
QP Paid:	\$3,789.00
COE Rebate Amount:	\$2,530.00
Total Rebate Amount:	\$2,530.00
Message	

Transfer of ownership or deregistration is not allowed for this vehicle.

The information contained herein is correct as at 16 Apr 2022

OK