

Not Notified
 11 Sep @
 Moving After Repair

Ready Auto Care Pte Ltd - We Care For All Your Car Needs
 Blk 10 # 03-06 AMK Auto Point, Ang Mo Kio Ind Park 2A, Ang Mo Kio Ave 5. Singapore 568047
 Tel : 64810304 Fax : 64815587 Reg No : 200600989K

Budgetdirect

Estimate Repair

Motorcar Claim Department
 Attn Officer In Charge

Date : 14/04/2022

Accident Involving SFV5955A & SLQ8936R On 13/4/2022 Along Changi Flyover

(1/2)

Item	Descriptions	Amount	
1	Front Bumper	\$ 1,485.00	
2	LH Headlamp	CM \$ 2,340.00	✓
3	Radiator Grill	CM \$ 792.00	✓
4	Radiator Grill Logo With Module	Addition \$ 432.00	✓
5	Lower Grill	\$ Nil 102.60	✓
6	LH Inner Parking Sensor	Short \$ 261.00	✓
7	LH Outer Parking Sensor	\$ Short 234.00	✓
8	Front Bumper Reinforcement	\$ 288.00	?
9	Front Bumper Sponge	\$ 120.00	?
10	Intercooler	\$ 774.00	?
11	Aircon Condenser	\$ 306.00	?
12	Radiator Assy	\$ Sm 441.00	X
13	Support Panel Assy	\$ 594.00	?
14	Air Guide	\$ 79.20	?
15	Tail Gate	\$ R 1,800.00	✓
16	RL Reflector Lamp	\$ CM 396.00	✓
17	RL Tail Lamp	\$ CM 414.00	✓
18	Rear Windscreen Moulding	nn \$ R 180.00	car X
19	Tail Gater Inner Trim Panel	\$ 895.00	?
20	Rear Bumper	CM \$ 1,404.00	✓
21	Rear Bumper Step Garnish	\$ Nil 248.40	✓
22	Rear Bumper Chrome RR & RL @\$153 X 2	R \$ 306.00	✓
23	Rear Left Inner Parking Sensor	MT \$ 261.00	✓
24	Rear Right Inner Parking Sensor	Short \$ 261.00	✓
25	Rear Bumper Lower Lib	\$ R 95.40	✓
26	Rear Bumper Retainer RR & RL @\$12.60 X 2	Nil Nil \$ 25.20	✓
27	Rear Bumper Reinforcement	\$ 432.00	?
28	Rear End Panel	\$ 1,260.00	?
29	RL Seat Belt	\$ R 396.00	✓
30	RR Seat Belt	\$ R 396.00	✓
31	FR Seat Belt	\$ 396.00	?
32	Airbag Control Module	\$ 810.00	?
33	RH & LH Impact Sensor @\$171 x 2	\$ 342.00	?
34	Radar Distance Senspr	\$ 1,206.00	?

Total For Parts (Less 10%) \$ 19,772.80

To Be Continued

Accident Involving SFV5955A & SLQ8936R On 13/4/2022 Along Changi Flyover (2/2)


<u>S/N Item (s)</u>				
1	Front Bumper Clips - 1 Set	\$	28.00	—
2	Rear Bumper Clips - 1 Set	\$	28.00	—
3	Front Mercedes Logo	\$	70.20	—
4	Original Coolant	\$	30.00	7
5	" B180" Emblem	\$	75.60	—
6	Mercedes Logo - Rear	\$	50.40	—
7	Rear Windscreen Sealant	\$	40.00	—
8	Reverse Camera	\$	450.00	X
9	Front Number Plate With Frame	\$	35.00	—
10	Towing Service	(B.11) \$	117.70	7
Total For S/N		\$	924.90	

<u>Labour & Misc</u>				
1	To Remove All Damaged Parts, Knock Out Dents, Jack Out Damaged Panel	\$	2,400.00	7
2	Panel, Adjust, Replace, Reshape, Cut, Weld, Refix & Realign Body Structure	\$	1,800.00	130d
3	Spray Painting For New And Repair Parts Including Supply Of Paints Materials	\$	250.00	150d
	Computerise Reprogramming SRS, Rear Distance Sensor, Parking Sensor Memory	\$	680.00	120d
	Remove & Replace RL, RR & FR Seat Belt & Airbag Control Module	\$	450.00	120d
	Remove & Replace Impact Sensor & Radan Distance Sensor	\$	580.00	7
	Online Coding Radar Distance Sensor	\$	100.00	7
	Renew Aircon Parts, Vacuum & Refill R134a Aircon Gas	\$	50.00	40d
	Check Font & Rear Wiring, Lighting System For Proper Function	\$	150.00	120d
	Remove & Refix Rear Windscreen To Facilitate Repair	\$	100.00	60d
	To Remove & Refit Rear Boot Upholstery etc To Facilitate Repair	\$	120.00	7
	Cavity Preservation On All Affected Areas	\$		
		\$	6,680.00	

Total For Parts & Labour \$ 27,377.70

Ready Auto Care Pte Ltd
Sulynn - 64810304

No Of Days For Repair 9 Days ✓

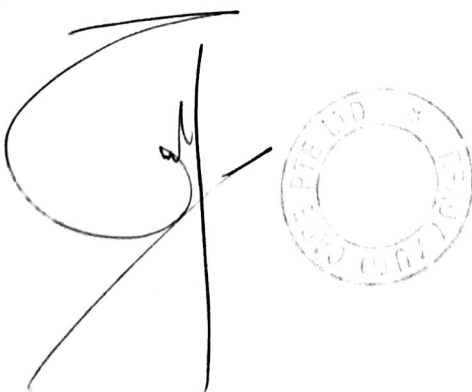

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date: