

PAR Automotive Consultancy

Regn. No: 52986974L

Thomson Rd Post Office PO Box 029 Singapore 915701. Tel : 645 31173, Fax : 645 36131.

Report No: 0437-16-TCA

27 December 2016

Bryan said report needs to send to insurance before 12pm.

FN Container Services
24 Depot Lane #01-06A
Singapore 109767

INVOICE No. 0437-16-TCA


Vehicle No. YL2902A

<u>S/NO.</u>	<u>SERVICES RENDERED</u>	<u>Amount due</u>
1	Being accident vehicle appraisal services, transport, photographs and re-inspection (work in progress and post repair inspection).	\$1,002.00
Total amount payable		<u>\$1,002.00</u>

Kindly cross your cheque in favour of "PAR Automotive Consultancy"

We thank you in anticipation for your prompt payment.

PAR Automotive Consultancy

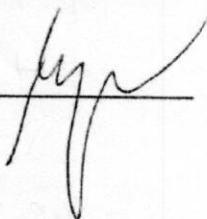

After sign Photos showed no parts not replaced with same markings. Except for Power tilgate found replaced. Hydraulic Pump also not replaced.

PAR Automotive Consultancy

Regn. No: 52986974L

Thomson Rd Post Office PO Box 029 Singapore 915701. Tel : 645 31173, Fax : 645 36131.

Report No: 0437-16-TCA

27 December 2016

ACCIDENT VEHICLE SURVEY REPORT

FN Container Services
24 Depot Lane #01-06A
Singapore 109767

VEHICLE INFORMATION:

Vehicle Reg No.:	YL2902A	Odometer:	490108km
Make & Model:	Mitsubishi FM657MSRDEC	Colour:	Brown
Chassis number:	FM657MB00427	Date of accident:	27/05/2016
Year of Regn.:	31/12/2002	Date inspected:	01/06/2016
Repairer at:	Twincar Automotive Pte Ltd 2 Kaki Bukit Ave 2 #01-17 Kaki Bukit Auto Hub Singapore 417921		

STATIC CHECKS, where applicable:

Steering :	serviceable
Footbrake :	serviceable
Handbrake :	serviceable
Paintwork :	Good
General condition :	Good

TIRE CONDITION:

	<u>LH / Make</u>	<u>RH / Make</u>	<u>Size</u>
Front:	4mm/Bridgestone	4mm/Bridgestone	10.00-20
Rear: x2	4mm/Bridgestone	4mm/Bridgestone	10.00-20

POINT OF IMPACT AND DAMAGE, where applicable:

Impact on the rear portion.
Please see details as described in the Annex for parts and labour.

REMARKS:

We have inspected the above-mentioned vehicle on a "Without Prejudice" basis.

Parts and Labour Assessment

PARTS

Description of part	Qty	Condition	Repairer's estimate	Our adjustment
REAR NUMBER PLATE LAMP	1	fractured	88.00	88.00 HH
REAR TAILLAMP BRACKET L/R	2	bent	90.00	90.00 HH
REAR TAILLAMP L/R	2	fractured	576.00	576.00 ✓
Subtotal before discount			S\$ 754.00	S\$ 754.00
Percentage discount 10% and 10%			S\$ 75.40	S\$ 75.40
Sub-total 1			S\$ 678.60	S\$ 678.60
REAR CARGO CARRIER LH WOODEN SUB CHASSIS FRAME	1	fractured	800.00	800.00 HH
REAR CARGO CARRIER LH WOODEN SUB CHASSIS FRAME 'U' BOLT - SET	4	necessary	600.00	600.00 HH
REAR CARGO CARRIER LH WOODEN SUB CHASSIS FRAME BOLT & NUT - SET	12	necessary	1,200.00	1,200.00 HH
REAR CARGO CARRIER LOWER WOODEN CROSS MEMBER	1	fractured	500.00	500.00 HH
REAR CARGO CARRIER LOWER WOODEN CROSS MEMBER BOLT & NUT - SET	5	necessary	500.00	500.00 HH
REAR CARGO CARRIER SIDE LOWER SAFETY GUARD L/R	2	reuse	1,600.00	0.00 HH
REAR HIGH TONNAGE HYDRAULIC CYLINDER LIFT, → HH				
PLATFORM TAILGATE ASSY → only platform changed.	1	distorted/jammed	15,000.00	15,000.00 3500/-
REAR NUMBER PLATE	1	bent	25.00	25.00 HH
REAR WOODEN END DOOR HINGES L/R	4	bent	400.00	400.00 HH
REAR WOODEN END DOOR L/R	2	distorted	1,600.00	1,600.00 HH
REAR WOODEN END DOOR LOCK HANDLE	1	bent/jammed	100.00	100.00 HH
REAR WOODEN END DOOR LOWER PANEL	1	fractured	1,000.00	1,000.00 HH
REAR WOODEN END DOOR PILLAR BRACKET L/R	2	reuse	1,000.00	0.00 HH
REAR WOODEN END DOOR PILLAR BRACKET LOCK HANDLE L/R	2	repair	400.00	0.00 HH
REAR WOODEN STEP PANEL	1	fractured	300.00	300.00 HH
REAR WOODEN STEP PANEL BOLT & NUT - SET	2	necessary	200.00	200.00 HH
Subtotal before discount			S\$ 25,225.00	S\$ 22,225.00
Sub-total 2			S\$ 25,225.00	S\$ 22,225.00
Parts-total			S\$ 25,903.60	S\$ 22,903.60

LABOUR

To remove, reinstall electrical wiring harness, check lighting and rewire for parking sensor.

150.00 60.00 30/-

To lift up rear cargo cabin (to FR) No photo

500.00 500.00 HH

To re-spray painting on the change bodyparts, repair portion, and where consistent to the accident. tailgate - hidden member

1,500.00 1,000.00 800/-

To provide labour, workmanship to change the above damaged bodyparts, repair, re-construct and re-align body structure, body alignments, hydraulic platform tailgate parts and damaged consistent to the accident. - for tailgate panel

2,500.00 2,250.00 800/-

To apply anti-rust chemical on repaired and replaced panel.

120.00 60.00 HH

Labour Total S\$ 4,770.00 S\$ 3,870.00

Parts & Labour Total S\$ 30,673.60 S\$ 26,773.60


7/17 5,648.40 =

8 days

Results of inspection of the accident vehicle are as shown above.

We have taken into consideration the age and condition of the vehicle in our recommendation.

**Hence, the recommended cost of repairs based on Lump Sum repairs is : SS 22,800.00
and the recommended number of working days for the repairs is within 11 day(s).**


B J Loi (I Eng. MIML AIRTE)
Automotive Appraiser

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Business

Owner ID: 9689J

Vehicle Details

Vehicle No.: YL2902A

Vehicle to be Exported: No

Intended De-registration Date: 30 May 2016

Vehicle Make: MITSUBISHI

Vehicle Model: FM657MSRDEC

Primary Colour: White

Manufacturing Year: 2002

Engine No.: 6D16957565

Chassis No.: FM657MB00427

Maximum Power Output: -

Open Market Value: \$109,193.00

Original Registration Date: 31 Dec 2002

First Registration Date: 31 Dec 2002

Transfer Count: 1

Actual ARF Paid: \$5,460.00

Intended PARF Rebate Details

PARF Eligibility: No

PARF Eligibility Expiry Date: -

PARF Rebate Amount: \$0.00

Intended COE Rebate Details

COE Expiry Date: 30 Nov 2022

COE Category: C - Goods Vehicle & Bus

COE Period(Years): 10

COE Paid: \$57,562.00

COE Rebate Amount: \$38,151.00

Total Rebate Amount: \$38,151.00

Message

Transfer of ownership or de-registration is not allowed for this vehicle. Please contact LTA at 1800-CALL LTA (1800-2255 582) for further assistance.

The information contained herein is correct as at 30 May 2016

OK

Land Transport  Authority

Please read through the Privacy Statement, Terms of Use and Disclaimer.

Please do not use the **Back** or **Forward** buttons on your browser as this may alter the results of the transactions.

Best viewed with IE 6.0 SP3 and above. 1024 X 768 resolution

Copyright © 2016 LTA | [Privacy Statement](#) | [Terms of Use](#) | [Disclaimer](#) | [Rate the Website](#) | [Rate this e-Service](#)