



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

LONPAC INSURANCE BHD  
300 BEACH ROAD  
#17-04/07 THE CONCOURSE  
SINGAPORE 199555

INV No. AC2301340  
INV Date 07/03/2023  
Reference CC4/LPC22003580/Apa3q2  
Code LPC2

#### PROFESSIONAL SERVICE FEE

Vehicle No. SMV 6753B  
Insured Veh. GBF 5447G  
Claim No. 21/22/22/VC05/025687  
Policy No. Z21VC05008460  
Accident Date 18/04/2022  
Inspection Date 04/05/2022

Description	Total
Third Party Express Settlement	400.00
<b>Subtotal</b>	<b>400.00</b>
<b>GST (8%)</b>	<b>32.00</b>
<b>Grand Total</b>	<b>432.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## Affiliated to Federation Internationale Des Experts En Automobile

LONPAC INSURANCE BHD

300 BEACH ROAD

#17-04/07 THE CONCOURSESINGAPORE 199555

Ref: CC4/LPC22003580/Apa3q2

Date: 07/03/2023

Code: LPC2

### 1. Policy Particulars :- THIRD PARTY CLAIM

<b>Insured Veh.</b>	GBF 5447G	<b>Veh. Inspected</b>	SMV 6753B
<b>Policy No.</b>	Z21VC05008460	<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	21/22/22/VC05/025687	<b>Excess (\$)</b>	0.00
<b>Assign From</b>	GERALD	<b>Assign Date</b>	19/04/2022

### 2. Vehicle Particulars & Condition

<b>Make &amp; Model</b>	TOYOTA PREVIA	<b>c.c</b>	2362
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2020
<b>Chassis No.</b>	JTEGD56M607173969	<b>Colour</b>	GREY
<b>Odometer</b>	15904 KM	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	SPORTS RIM
<b>General</b>	GOOD		

### 3. Conditions of Tyres

	Size	Make	Balance
<b>R/H Front Tyre</b>	215/55 R17	YOKOHAMA	6 mm
<b>L/H Front Tyre</b>	215/55 R17	YOKOHAMA	6 mm
<b>R/H Rear Tyre</b>	215/55 R17	YOKOHAMA	6 mm
<b>L/H Rear Tyre</b>	215/55 R17	YOKOHAMA	6 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.  
DAMAGES SEE DETAILS.

### 5. General Information

<b>Accident Date</b>	18/04/2022	<b>Inspection Date</b>	04/05/2022
<b>Survey held at</b>	BORNEO MOTORS (S) PTE LTD 2 PANDAN CRESCENT SINGAPORE 128462		

### 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.  
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	<b>6 Working Days</b>
-------------------------------------	-----------------------



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMV 6753B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b>REPLACEMENT OF PARTS</b>			
1	SUNRIES (SN)	NECESSARY	30.00	30.00
1	SENSOR ,ULTRASONIC (SN)	NOT NECESSARY	392.80	-
2	CLIP,ULTRASONIC (SN)	NOT NECESSARY	20.40	-
2	SENSOR ,ULTRASONIC (SN)	NOT NECESSARY	785.60	-
1	ANTENNA ELECTRICAL (SN)	NOT NECESSARY	203.20	-
1	LENS & BODY ,RR (SN)	NOT NECESSARY	607.00	-
1	LENS & BODY ,RR (SN)	NOT NECESSARY	607.00	-
1	LENS & BODY ,RR (SN)	CRACKED	784.90	784.90
1	LENS & BODY ,RR (SN)	CRACKED	784.90	784.90
1	GARNISH SUB-ASSY (SN)	CRACKED	357.50	357.50
2	CLIP,BACK DOOR (SN)	NOT NECESSARY	7.60	-
1	REVERSE CAMERA FOR NEW WISH (SN)	NOT NECESSARY	360.00	-
1	BACK CAMERA WIRE HARNESS (SN)	NOT NECESSARY	33.20	-
1	COVER ,RR BUMPER (SN)	DEFORMED	632.00	632.00
4	PIECE, RR BUMPER (SN)	NECESSARY	17.20	17.20
1	SUPPORT ,RR BUMPER (SN)	NOT NECESSARY	61.20	-
1	SUPPORT ,RR BUMPER (SN)	NECESSARY	61.20	61.20
1	SUPPORT ,RR BUMPER (SN)	NOT NECESSARY	42.90	-
1	SUPPORT ,RR BUMPER (SN)	NECESSARY	42.90	42.90
1	ABSORBER ,RR BUMPER (SN)	NOT NECESSARY	84.20	-
1	ABSORBER ,RR BUMPER (SN)	NOT NECESSARY	84.20	-
1	PANEL SUB-ASSY BODY (SN)	NOT NECESSARY	800.10	-
1	GARNISH ,BACK DOOR (SN)	NOT NECESSARY	205.70	-
1	PLATE ,BACK DOOR (SN)	NOT NECESSARY	297.30	-
1	GLASS SUB-ASSY ,BACK (SN)	NECESSARY	1,368.60	1,368.60
2	SIKA 182010 SIKA TACK GO (BLA) (SN)	NECESSARY	216.00	216.00
1	SIKA 207 G+P ADHESIVE PRIMER (SN)	NECESSARY	200.00	200.00
1	PANEL SUB-ASSY ,BACK (SN)	DENTED	1,858.00	1,858.00
1	WEATHERSTRIP ,BACK (SN)	NOT NECESSARY	394.20	-
1	GARNISH SUB-ASSY (SN)	NOT NECESSARY	243.30	-
1	LOCK ASSY ,BACK DOOR (SN)	NOT NECESSARY	519.80	-

Report Ref No. CC4/LPC22003580/Apa3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	COVER ,BACK DOOR (SN)	NOT NECESSARY	42.00	-
1	STRIKER ASSY ,BACK (SN)	NOT NECESSARY	43.40	-
1	PLATE ,LUGGAGE COMPT (SN)	NECESSARY	46.80	46.80
1	PLATE ,BACK DOOR (SN)	NECESSARY	60.70	60.70
1	EMBLEM ,SYMBOL (SN)	NECESSARY	72.20	72.20
1	REFLECTOR ASSY (SN)	NECESSARY	63.40	63.40
2	CUSHION (SN)	NECESSARY	16.00	16.00
			12,447.40	6,612.30
	<b>LABOUR</b>			
	SUPPLY SEALANT FOR REAR TAILGATE AND REAR END PANEL.		120.00	60.00
	TO RESET ECU AND REPROGRAMME.		180.00	180.00
	TO SUPPLY AND INSTALL REAR WINDSCREEN 3M SOLAR FILM.		400.00	400.00
	R/I REAR WINDSCREEN TO FACILITATE REPAIRS.		462.00	462.00
	TO CHECK WIRING AND LIGHTING TO WATER TEST FOR LEAK.		122.40	122.40
	R/I REAR REVERSE SENSOR TO FACILITATE REPAIRS AND TEST FUNCTION.		180.00	180.00
	TO TRANSFER REAR TAILGATE BOARD ,TOP SPOILER,REAR CAMERA,MECHANISM AND OTHER ATTACHMENT TO NEW PANEL.		360.00	360.00
	R/I REAR CARPET ,TRIMMING ,REAR SEATS AND OTHER ATTACHMENT TO FACILITATE REPAIRS.		360.00	360.00
	TO REPLACE REAR ACCIDENT DAMAGE PARTS.STRAIGHTEN /REALIGN ALL OTHER AFFECTED AREAS .		4,320.00	1,440.00
	TO SPRAY PAINT ON REAR ACCIDENT AFFECTED AREAS .		3,540.00	1,770.00
	LABOUR FOR PLATINUM SHINEPRO & SHINE PER PANEL APPLICATION .		183.18	183.18
			10,227.58	5,517.58
	<b>GRAND TOTAL</b>		<b>22,674.98</b>	<b>12,129.88</b>



<b>RECOMMENDED COST OF REPAIRS</b>			<b>12,129.88</b>
------------------------------------	--	--	------------------

Report Ref No. CC4/LPC22003580/Apa3q2

**ADRIAN LING WAI PING**

**B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI**

**Licensed Appraiser**

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.**

**No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SMV 6753B

## INSPECTION







# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

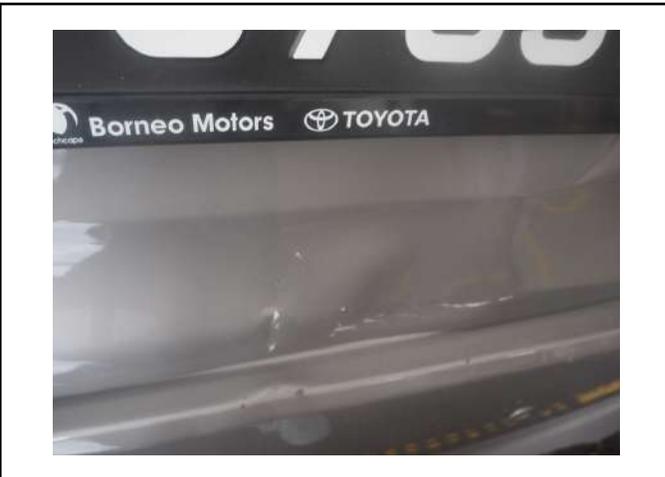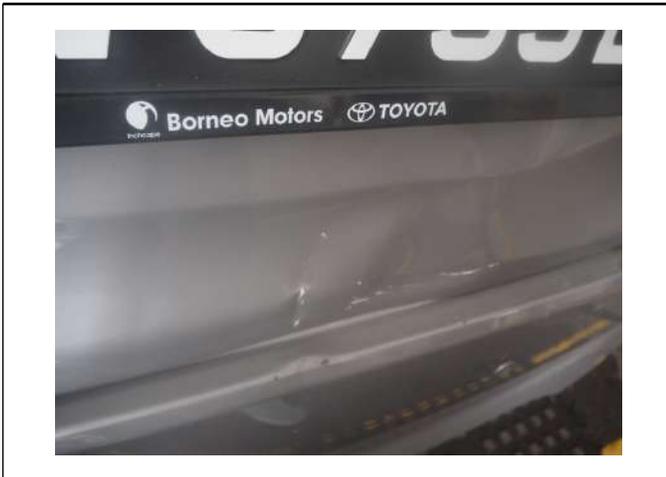




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

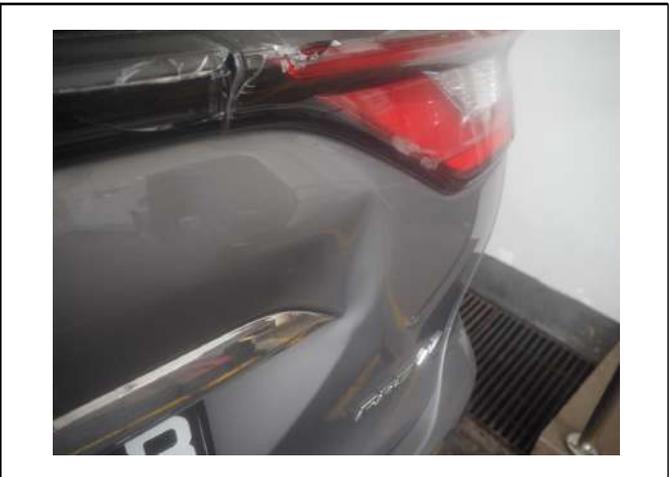





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

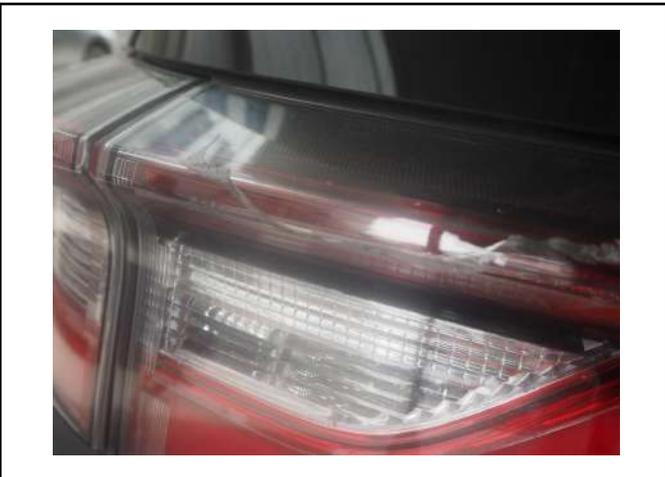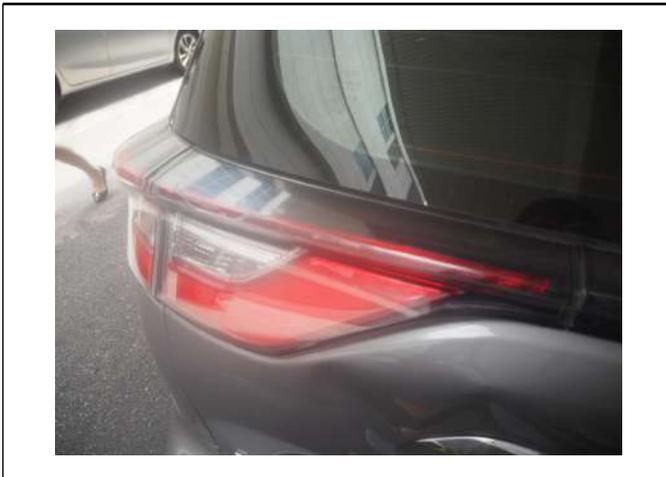



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SMV 6753B

## RE-INSPECTION





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

