



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2206152
3 ANSON ROAD #16-00	INV Date	04/10/2022
SPRINGLEAF TOWER	Reference	CC6/CTI22003692/Kea3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	SHD 82Y
Insured Veh.	SJN 9157E
Claim No.	SNM22D202679/C02
Policy No.	DMHCSNA00005162201
Accident Date	19/04/2022
Inspection Date	20/04/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC6/CTI22003692/Kea3q2 Date: 04/10/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SJN 9157E	Veh. Inspected	SHD 82Y
Policy No.	DMHCSNA00005162201	Coverage (\$)	0.00
Claim No.	SNM22D202679/C02	Excess (\$)	0.00
Assign From		Assign Date	20/04/2022
2. Vehicle Particulars & Condition			
Make & Model	RENAULT LATITUDE (A)	c.c	1995
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	VF1ABL15AUC282661	Colour	METALLIC WHITE / RED
Odometer	705110 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	215/60 R16	SAILUN	8 mm
L/H Front Tyre	215/60 R16	SAILUN	8 mm
R/H Rear Tyre	215/60 R16	SAILUN	8 mm
L/H Rear Tyre	215/60 R16	SAILUN	8 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR AND FRONT PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	19/04/2022	Inspection Date	20/04/2022
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 82Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER COVER REAR	BENT	561.70	561.70
1	BUMPER LOWER REAR	MISSING	411.90	411.90
1	BUMPER REFLECTOR RH	SERVICEABLE	16.60	-
1	BUMPER REFLECTOR LH	CRACKED	16.60	16.60
1	BUMPER BRACKET CTR REAR	CRACKED	98.10	98.10
1	BUMPER BRACKET SIDE RH REAR	SERVICEABLE	82.10	-
1	BUMPER RETAINER RH REAR	SERVICEABLE	59.80	-
1	BUMPER BRACKET SIDE LH REAR	SERVICEABLE	80.80	-
1	BUMPER RETAINER LH REAR	SERVICEABLE	54.20	-
1	FENDER PANEL REAR RH	TO REPAIR SEE LABOUR	1,933.20	-
1	WHEELARCH REAR RH	SERVICEABLE	275.40	-
1	BUMPER BEAM REAR	BENT	547.80	547.80
1	BUMPER BEAM BRACKET LH REAR	DISTORTED	114.50	114.50
1	BUMPER BEAM BRACKET RH REAR	DISTORTED	114.50	114.50
1	OUTER PANEL REAR (END PANEL)	BENT	745.80	745.80
1	OUTER PANEL REAR (END PANEL) TRIM	SERVICEABLE	404.56	-
1	BOOT REAR	BENT	1,677.20	1,677.20
1	BOOT LOCK	TO REPAIR SEE LABOUR	246.60	-
1	BOOT LOCK CATCH	TO REPAIR SEE LABOUR	41.70	-
1	BOOT FINISHER	SERVICEABLE	344.70	-
1	BOOT STRUT LH	SERVICEABLE	145.10	-
1	BOOT STRUT RH	SERVICEABLE	145.10	-
1	BOOT HINGE LH	TO REPAIR SEE LABOUR	254.20	-
1	BOOT HINGE RH	TO REPAIR SEE LABOUR	254.20	-
1	BOOT BADGE "RENAULT"	NECESSARY	82.40	82.40
1	BOOT BADGE	NECESSARY	95.80	95.80
1	BOOT REFLECTOR LAMP LH	CRACKED	277.70	277.70
1	BOOT REFLECTOR LAMP RH	CRACKED	277.70	277.70

Report Ref No. CC6/CTI22003692/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SPARE WHEEL PANEL	TO REPAIR SEE LABOUR	1,229.40	-
1	TAILLAMP LH	MTG CRACKED	401.40	401.40
1	TAILLAMP RH	MTG CRACKED	401.40	401.40
1	BUMPER COVER FRT	BENT	747.20	747.20
1	BUMPER UNDERTRAY FRT	DISTORTED	292.50	292.50
1	BUMPER SPOILER FRT	MISSING	344.70	344.70
1	BUMPER ABSORBER FRT	TO REPAIR SEE LABOUR	394.68	-
1	BUMPER BRACKET KIT FRT LH	SERVICEABLE	101.40	-
1	BUMPER RETAINER FRT LH	DISTORTED	101.40	101.40
1	BUMPER BRACKET KIT FRT RH	SERVICEABLE	101.40	-
1	BUMPER RETAINER FRT RH	DISTORTED	101.40	101.40
1	BUMPER SUPPORT FRT	SERVICEABLE	10.70	-
1	BUMPER GRILLE LOWER FRT	DISTORTED	147.00	147.00
1	BUMPER FOG LAMP GRILLE LH	SERVICEABLE	207.21	-
1	BUMPER FOG LAMP GRILLE RH	SERVICEABLE	207.21	-
1	TOW COVER FRT	SERVICEABLE	60.90	-
1	FENDER PANEL FRT LH	TO REPAIR SEE LABOUR	437.10	-
1	FENDER PANEL FRT RH	TO REPAIR SEE LABOUR	437.10	-
1	BUMPER UNDERTRAY FRT	SERVICEABLE	292.50	-
1	RADIATOR GRILLE	CRACKED	969.90	969.90
1	RADIATOR GRILLE BADGE" RENAULT"	NECESSARY	225.36	225.36
1	RADIATOR GRILLE FRAME	SERVICEABLE	686.00	-
1	FRAME FULL SUPPORT PANEL	SERVICEABLE	592.70	-
1	BONNET	BENT	1,312.70	1,312.70
1	BONNET HINGE LH	TO REPAIR SEE LABOUR	237.40	-
1	BONNET HINGE RH	TO REPAIR SEE LABOUR	237.40	-
1	BONNET LOCK	TO REPAIR SEE LABOUR	152.80	-
1	HEADLAMP LH	MTG CRACKED	743.60	743.60
1	HEADLAMP RH	MTG CRACKED	744.60	744.60

Report Ref No. CC6/CTI22003692/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 10% DISCOUNT		-2,127.90	-1,155.49
			19,151.12	10,399.37
1	BOOT WEATHERSTRIP (50%)(SN)	CUT	178.20	89.10
	LESS 10% DISCOUNT		-17.82	-
			160.38	89.10
	<u>SPECIAL NETT ITEMS</u>			
1	SET PARKING AID (SN)	SHORTED	700.00	400.00
1	SET REAR BUMPER CLIP (SN)	NECESSARY	66.00	66.00
1	SET BUMPER BRACKET SIDE CLIP RH RR (SN)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER RH CLIP RR (SN)	NOT NECESSARY	20.00	-
1	SET BUMPER BRACKET SIDE CLIP LH RR (SN)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER CLIP LH RR (SN)	NOT NECESSARY	20.00	-
1	SET BUMPER LOWER REAR CLIP (SN)	NECESSARY	66.00	66.00
1	REAR BOOT STICKER "TRANS-CAB" (SN)	NECESSARY	80.00	30.00
1	REAR BOOT STICKER "6555-3333" (SN)	NECESSARY	80.00	30.00
1	EXHAUST MOUNTING REAR (SN)	SERVICEABLE	17.82	-
1	FRONT BUMPER CLIP (SN)	NECESSARY	66.00	66.00
1	LICENSE PLATE WITH HOLDER REAR (SN)	DENTED	120.00	45.00
2	WINDSCREEN SEALANT (SN)	NOT NECESSARY	150.00	-
1	WINDSCREEN MOULDING (SN)	NOT NECESSARY	200.00	-
1	WINDSCREEN INNER SPONGE SEAL (SN)	NOT NECESSARY	130.00	-
2	LICENSE PLATE WITH HOLDER FRT (SN)	MISSING	121.00	45.00
			1,856.82	748.00
	<u>LABOUR</u>			
	TO REMOVE AND REFIT REAR BIG AND SMALL W/SCREEN GLASS TO FACILITATE BODYWORK REPAIR.	NOT NECESSARY	300.00	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		3,000.00	1,320.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	PANEL BEATING,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF FENDER PANEL REAR RH,BOOT LOCK,BOOT LOCK CATCH,BOOT HINGE LH,BOOT HINGE RH,SPARE WHEEL PANEL,BUMPER ABSORBER FRT,FENDER PANEL FRT LH,FENDER PANEL FRT RH,BONNET HINGE LH,BONNET HINGE RH AND BONNET LOCK.		3,000.00	1,000.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.		170.00	90.00
	TO REINSTALL REAR BUMPER PARKING SENSOR.		170.00	60.00
	TO TRANSFER OF BOOTLID FITTINGS,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.		170.00	60.00
	TO REPAIR AND REALIGN REAR EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO DROP REAR EXHAUST BOX,RENEW THE SAME,TO REPAIR AND REALIGN CENTRE EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR END PANEL FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.		170.00	60.00
	TO TRANSFER OF REAR WINDSCREEN FITTINGS AND CONDUCT WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	40.00
			7,880.00	2,630.00
	GRAND TOTAL		29,048.32	13,866.47
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			8,200.00

Report Ref No. CC6/CTI22003692/Kea3q2

MARKET VALUE: \$30,787.00(EST)-LTA REIMBURSEMENT VALUE: \$22,506.00=NETT VALUE: \$8,281.00

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 82Y

INSPECTION

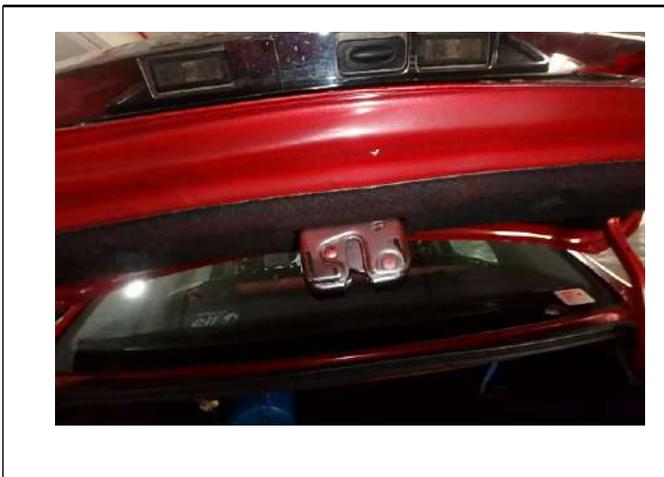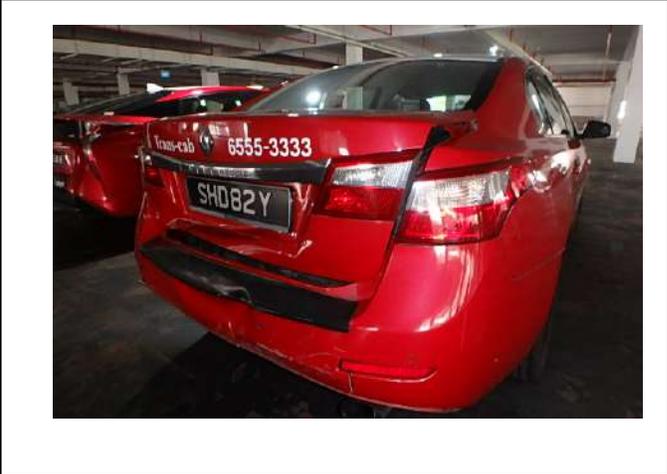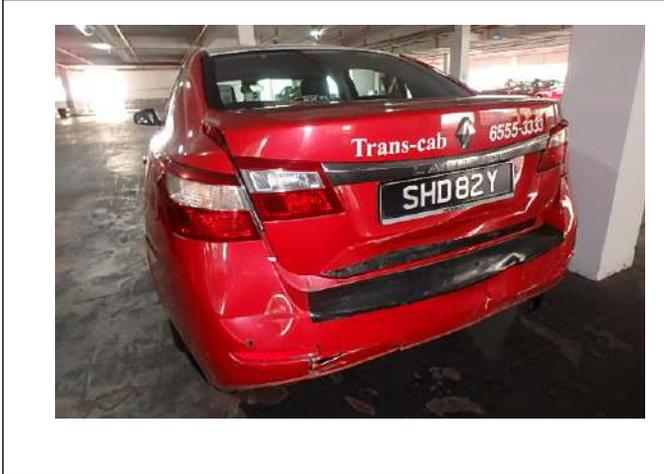





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

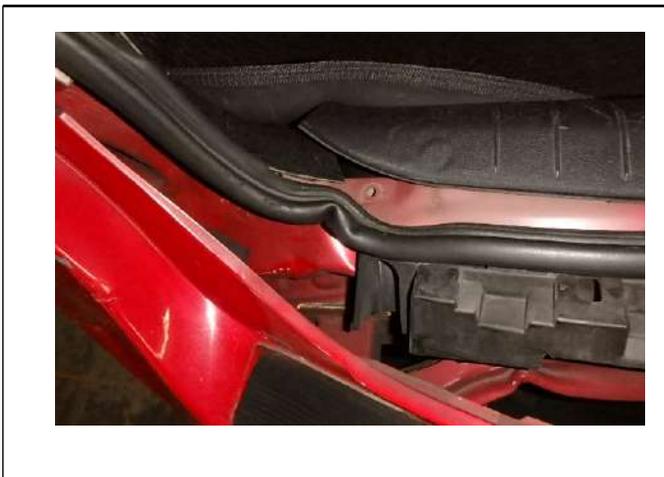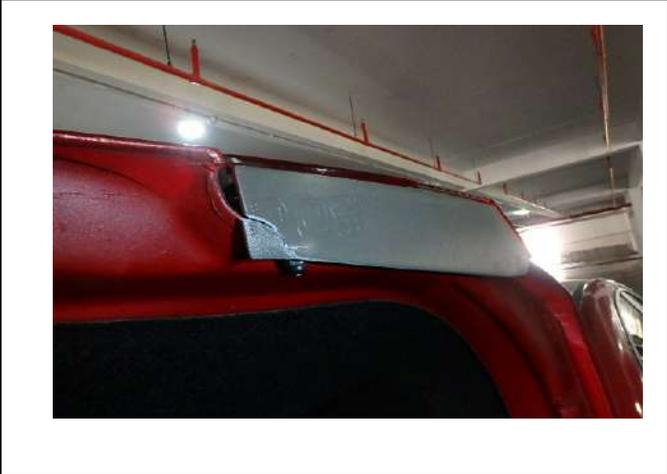




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

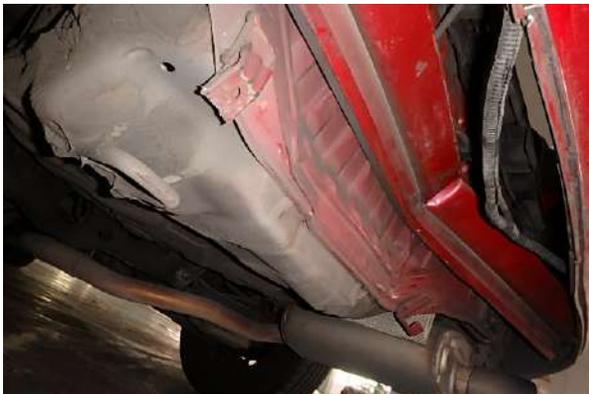



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

