



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

EQ INSURANCE COMPANY LTD

5 MAXWELL ROAD
#17-00 TOWER BLOCK
MND COMPLEX
SINGAPORE 069110

INV No. AC2202963

INV Date 20/05/2022

Reference CS/EQI22003871/Kvy3e2

Code EQI

PROFESSIONAL SERVICE FEE

Vehicle No. SKS 90J
Insured Veh. GBG 633M
Claim No. DM22HO00649/JT
Policy No.
Accident Date 22/04/2022
Inspection Date 26/04/2022

Description	Total
Survey Inspection	230.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	230.00
GST (7%)	16.10
Grand Total	246.10

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

KHM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

EQ INSURANCE COMPANY LTD
5 MAXWELL ROAD
#17-00 TOWER BLOCK
MND COMPLEX SINGAPORE 069110

Ref: CS/EQI22003871/Kvy3e2

Date: 20/05/2022

Code: EQI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	GBG 633M	Veh. Inspected	SKS 90J
Policy No.		Coverage (\$)	0.00
Claim No.	DM22HO00649/JT	Excess (\$)	0.00
Assign From	MELODY TEOH	Assign Date	26/04/2022

2. Vehicle Particulars & Condition

Make & Model	TOYOTA ESTIMA (A)	c.c	2362
Engine No.	HIDDEN	Year of Reg.	2015
Chassis No.	ACR500188453	Colour	METALLIC BLACK
Odometer	83985 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	235/50 R18	MICHELIN	8 mm
L/H Front Tyre	235/50 R18	MICHELIN	8 mm
R/H Rear Tyre	235/50 R18	MICHELIN	8 mm
L/H Rear Tyre	235/50 R18	MICHELIN	8 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	22/04/2022	Inspection Date	26/04/2022
Survey held at	OPTIMA WERKZ PTE LTD 10 Ang Mo Kio Industrial Park 2A #01-05 AMK Autopoint SINGAPORE 568047		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **8 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKS 90J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	REAR TAILGATE	BENT	1,700.00	1,380.00
1	REAR TAILGATE "ESTIMA" EMBLEM	NECESSARY	88.00	48.00
1	REAR TAILGATE "AERAS" EMBLEM	NECESSARY	88.00	56.00
1	REAR WINDSCREEN MOULDING	NECESSARY	100.00	100.00
1	REAR TAILGATE INNER TRIM BOARD	MTG CRACKED	500.00	500.00
1	REAR TAILGATE INNER LOCK	DENTED	475.00	475.00
1	REAR TAILGATE LAMP LH	SERVICEABLE	488.00	-
1	REAR TAILGATE LAMP RH	SERVICEABLE	488.00	-
1	REAR TAILGATE CHROME MOULDING	SERVICEABLE	398.00	-
1	REAR BUMPER	BENT	585.00	585.00
1	REAR BUMPER SIDE BRACKET LH	CRACKED	90.00	90.00
1	REAR BUMPER SIDE BRACKET RH	CRACKED	90.00	90.00
1	REAR BUMPER INNER BRACKET LH	CRACKED	77.00	77.00
1	REAR BUMPER INNER BRACKET RH	CRACKED	77.00	77.00
1	REAR END PANEL	BENT	660.00	660.00
1	REAR END PANEL UPPER COVER	BUCKLED	275.00	275.00
1	REAR FLOOR PANEL	BENT	757.00	757.00
1	REAR FENDER INNER TRIM BOARD LH	SERVICEABLE	838.00	-
1	REAR FENDER INNER TRIM BOARD RH	BUCKLED / MTG CRACKED	838.00	627.80
1	REAR FENDER LH (NPA)	TO REPAIR SEE LABOUR	-	-
1	REAR FENDER RH (NPA)	TO REPAIR SEE LABOUR	-	-
	LESS 25% DISCOUNT		-2,153.00	-1,449.45
			6,459.00	4,348.35
1	REAR TAILGATE WEATHERSTRIP (\$311.70)(50%) (SN)	DISTORTED / DENTED	355.00	155.85
	LESS 25% DISCOUNT		-88.75	-
			266.25	155.85



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>SPECIAL NETT ITEMS</u>				
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	80.00	40.00
1	REAR BUMPER CLIPS (SN)	NECESSARY	60.00	60.00
1	REAR BUMPER REVERSE SENSOR (SN)	SERVICEABLE	300.00	-
1	REAR END PANEL JOINT SEALANT (SN)	NECESSARY	80.00	30.00
1	REAR END PANEL UPPER COVER CLIPS (SN)	NECESSARY	50.00	50.00
1	REAR FENDER INNER TRIM BOARD CLIPS LH (SN)	NOT NECESSARY	50.00	-
1	REAR FENDER INNER TRIM BOARD CLIPS RH (SN)	NECESSARY	50.00	50.00
1	REAR NUMBER PLATE & HOLDER (SN)	SERVICEABLE	50.00	-
			720.00	230.00
<u>LABOUR</u>				
	LABOUR CHARGES TO REMOVE, REPLACE, REFIX, REPAIR & READJUST REAR ACCIDENT AREAS & ETC. INCLUSIVE OF THE REPAIR OF REAR FENDER LH AND REAR FENDER RH.		1,500.00	900.00
	LABOUR CHARGES FOR PAINTING & TO SUPPLY PAINT & FURNISHING MATERIALS AT REAR TAILGATE, REAR BUMPER, REAR END PANEL, REAR FLOOR PANEL, REAR FENDER LH, REAR FENDER RH & ETC.		1,500.00	800.00
	LABOUR CHARGES TO REMOVE & REFIX REAR WINDSCREEN GLASS, REAR WINDSCREEN SEALANT, REAR WINDSCREEN MOULDING & ETC. TO EFFECT REPLACE OF REAR TAILGATE.		150.00	120.00
	LABOUR CHARGES TO REMOVE & REINSTALLED REAR TAILGATE INNER MECHANISM & ETC. BACK TO ORIGINAL OPERATIONS.		120.00	60.00
	LABOUR CHARGES TO REMOVE & REPLACE REAR BUMPER REVERSE SENSOR & ETC.		100.00	50.00
	TO TUFF KOTE & UNDERSEAL MATERIALS.		150.00	90.00
	TO CHECK WIRING & CENTRAL LOCKING SYSTEM.		120.00	20.00
			3,640.00	2,040.00
GRAND TOTAL			11,085.25	6,774.20



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			5,400.00
---	--	--	-----------------

Report Ref No. CS/EQI22003871/Kvy3e2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 22/04/2022 16:38 (SGT)
Date of Accident 22/04/2022 10:45 (SGT)
Exact Location of Accident Paya Lebar Rd, Singapore
Additional Location Information SLIP RD OF PAYA LEBAR RD TWDS PIE (TUAS)
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SKS90J

INSURED/POLICYHOLDER

Is company? No
Name Of Registered Owner NEW PAULINE
NRIC No SXXXX259E
Email Address PAULINENEW.SIM@GMAIL.COM
Mobile Phone No (Phone) +65-98759589
Alternative Phone No +65-96779997

VEHICLE PARTICULARS

Manufacturer Toyota
Model Estima
Variant ESTIMA AERAS PREMIUM 2.4 CVT
Exact purpose for which vehicle was being used at time of accident Private use
Are you claiming under your own insurance policy for repair to your vehicle? No - Claiming third party
Vehicle Category Private car
Transmission Auto
CC 2362

INSURANCE COMPANY


Name of Insurance Company Auto & General Insurance (Singapore) Pte. Limited.
Type of Coverage Comprehensive
Fleet Policy No
Policy Number P10310910R02
Cover Note Number 28/12/2021 - 27/12/2022

DRIVER

Name of Driver JAOSN SIM CHON ANG
NRIC No SXXXX051F

Date of accident: 22/04/2022 Time: 10:45 HRC Location: SLIP ROAD OF PUNYA LEBAR ROAD TOWARDS PIE (THAS)
 My Vehicle A: SKS90J Vehicle B: 6B6622M Vehicle C: _____

SKETCH PLAN

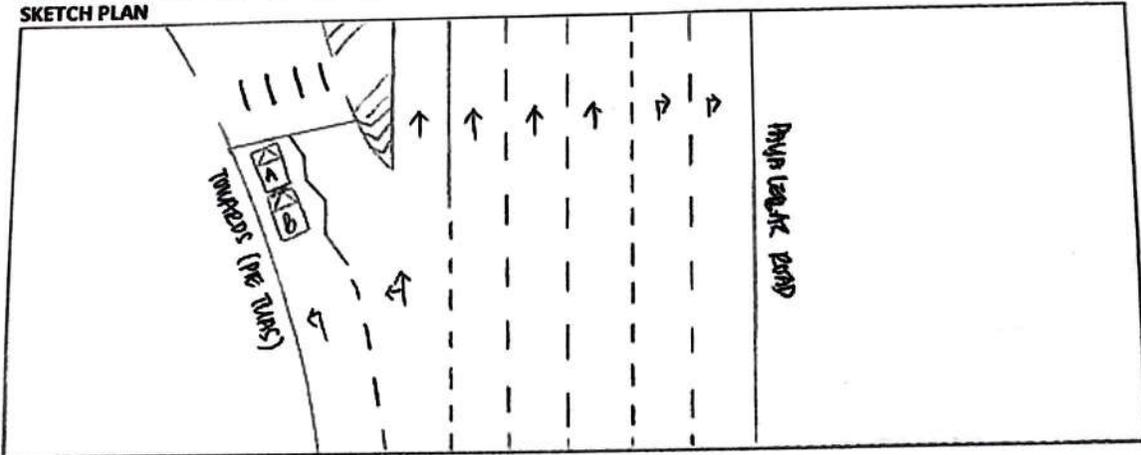

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

REFER TO POLICE REPORT : T/20220422/7012.

Claim OD/TP at Ah Lim Motor Claim OD/TP at other workshop Reporting Only

Remarks : Please forward a copy of my efile accident report to :

My workshop : OPTIMA WORKZ PTE LTD

Email address : KATHYUN-CHIO @ OW-SG & myself :

Email address : PAMLINEEN-SIM @ EMAIL-COM / IANJASON-SIM @ EMAIL-COM

Note : Please take note that your insurer have 14 days timeframe for you to submit own damage claim under you own policy. Kindly check with your own insurer for more information.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

[Signature] 22/04/2022
Driver's Signature
(if driver is not the policyholder)
Date & Time:

[Signature]
Ah Lim Motor Company
Reporting Centre Personnel's Signature
Name:
NRIC/PIN No.:

COMPLETED



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKS 90J

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKS 90J

RE-INSPECTION

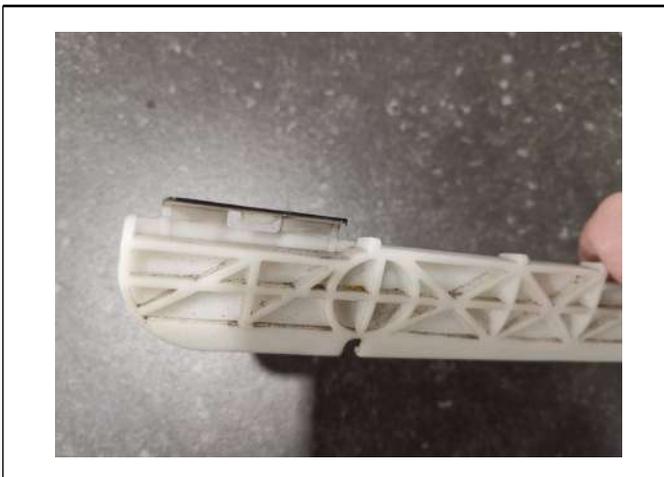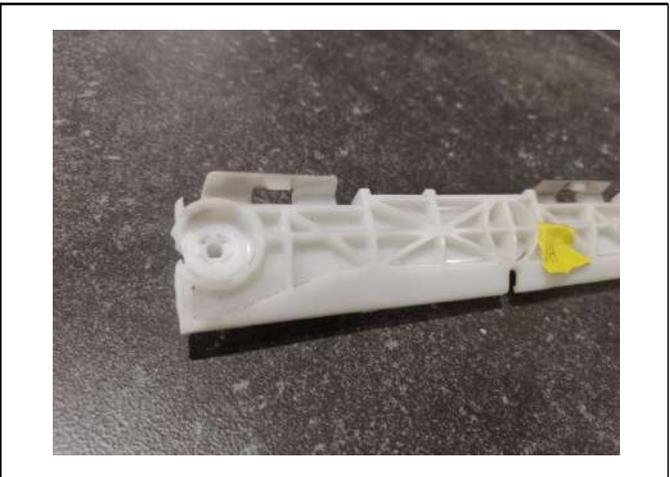



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

