

**ABSOLUTE APPRAISAL SERVICES PTE LTD**  
**LOSS ADJUSTERS & MOTOR APPRAISERS**  
160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722  
Mobile: 9688-0413 Fax: 6266-7396  
Email: absolute.app.svcs@gmail.com

### Invoice

Customer: AiW Shixuan Siyen  
C/o: Blk 8 Sin Ming Ind Est #01-60/62  
Singapore 575643

Date: 30.12.2019

Invoice No: NS-2019-588


Description		Amount
Vehicle No:	SJX9281B	
Make & Model:	Subaru Impreza (A)	
Our reference:	AAS/2019/588	
<b>Services rendered for appraiser / inspection report</b>		
Survey Fee		
Photographs		
Transport Fees		
Re-inspection Fees		
SGD Dollar : Eight hundred ninety six dollar only	Total:	SGD \$ 896.00

es:


All cheques payment should be crossed and made payment to "Absolute Appraisal Services Pte Ltd"

Please indicate our "Invoice No." on the reverse side of the cheque.

Please do not hesitate to contact us should you have any enquires.

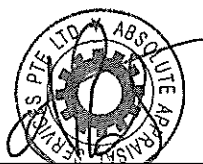

Absolute Appraisal Services Pte Ltd

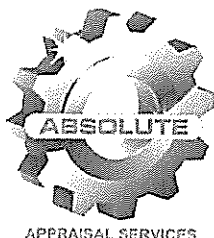

**ABSOLUTE APPRAISAL SERVICES PTE LTD**  
**LOSS ADJUSTERS & MOTOR APPRAISERS**  
160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722  
Mobile: 9688-0413 Fax: 6266-7396  
Email: absolute.app.svcs@gmail.com

### Vehicle Inspection Report

To: Aiw Shixuan Siyen  
C/o: Blk 8 Sin Ming Ind Est #01-60/62  
Singapore 575643

Date of report: 30.12.2019  
Date of request: 09.12.2019  
Date of inspection: 09.12.2019  
Date of accident: 24.11.2019  
Claim type: Third Party Claim

Report No: AAS/2019/588

#### Particulars of affected vehicle:

Registration no: SJX9281B  
Make/Model: Subaru Impreza (A)  
Year of registration: 2009/10  
Colour: Metallic Black

Odometer: 203423 km  
Engine Capacity: 1498 cc  
Engine no: EL15D674302  
Chassis no: JF1GE3KS59G004511

#### Condition of tires:

Front Left: 5mm  
Make: Continental  
Rear Left: 5mm  
Make: Continental

Front Right: 5mm  
Make: Continental  
Rear Right: 5mm  
Make: Continental

Type of road wheel: Alloy (The above represent the remaining life of the tire thread)

#### Pre-accident condition (Static tests only)

General Bodywork : Good  
Paintwork : Good  
Handbrake : In order  
Footbrake : In order  
Steering : In order  
Apparent engine modification : Nil

#### The Assignment


The inspection was conducted at M/s. City Auto Pte Ltd  
Blk 8 Sin Ming Ind Est #01-60/62  
Singapore 575643

(Subsequent inspection was conducted)

#### Assessment

Repairer's estimate: \$ 12,049.74  
Revised estimate: \$ 9,487.56  
Recommended reserve: \$ 7,600.00 (Lump sum)

Estimated normal duration of repairs : 8 Working days

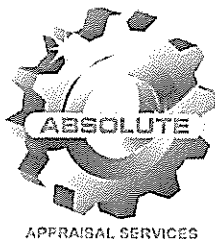

**ABSOLUTE APPRAISAL SERVICES PTE LTD**  
**LOSS ADJUSTERS & MOTOR APPRAISERS**  
160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722  
Mobile: 9688-0413 Fax: 6266-7396  
Email: absolute.app.svcs@gmail.com

Vehicle No: SJX9281B

Report No: AAS/2019/588

W/O PREJUDICE

Point of impact

At the rear portion.

General description of damages

The boot lid, tail lamps, tail lamp panels, rear bumper, rear end panel, spare tyre panel, etc.

Other parts were also found damaged. (See schedule for details)

Recommendation

The estimate cost of repair submitted by M/s City Auto Pte Ltd as per schedule attached have been revise and scrutinize. We list the breakdown of our findings and recommendation as per attached.

Our adjusted amount for the cost of repair is SGD \$9,487.56

Conclusion


The repairer has agreed to undertake the repair at a lumpsum of SGD \$7,600.00

Under normal circumstances, the repair of the damaged vehicle should be completed within a reasonable period of 8 working days.


I have **Not Authorised** and/or instruction to the repairer to proceed with the repairs. This inspection was conducted entirely on a '**Without Prejudice**' basis.

We are pleased to advise that the inspection was carried out accordingly and hereby submit our appraisal report which includes 121 photographs.

Your Faithfully  
Absolute Appraisal Services Pte Ltd

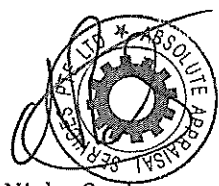

Nicky Seah  
Automobile Appraiser  
MSAAA / MSMCTA

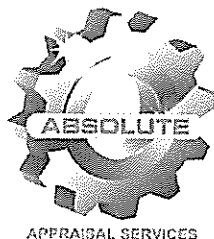

**ABSOLUTE APPRAISAL SERVICES PTE LTD**  
**LOSS ADJUSTERS & MOTOR APPRAISERS**  
 160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722  
 Mobile: 9688-0413 Fax: 6266-7396  
 Email: absolute.app.svcs@gmail.com

Vehicle No: SJX9281B

Report No: AAS/2019/588

**Appraisement Schedule**


S/N	Parts Description	Qty	Condition		Repairer's Est	Revised Est
1	Boot lid	1	Dented		\$ 1,212.90	\$ 1,212.90
2	Boot lid chrome moulding	1	Serviceable		\$ 336.00	-
3	Boot lid emblem	1	Necessary		\$ 64.60	\$ 64.60
4	Boot lid nameplate 'Subaru'	1	Necessary		\$ 46.90	\$ 46.90
5	Boot lid nameplate 'Impreza'	1	Necessary		\$ 46.90	\$ 46.90
6	Boot lid lock	1	Distorted		\$ 224.00	\$ 224.00
7	Boot lid striker	1	Serviceable		\$ 52.00	-
8	Boot lid inner trim	1	Torn		\$ 292.00	\$ 292.00
9	Boot lid hinge LH/RH	2	Bent/Repair	\$ 112.00	\$ 224.00	-
10	Boot lid weather-strip	1	Necessary		\$ 186.00	\$ 186.00
11	Tail lamp LH/RH	2	Cracked/Grazed	\$ 484.30	\$ 968.60	\$ 968.60
12	Tail lamp panel LH/RH	2	Dented/Repair	\$ 270.00	\$ 540.00	-
13	Rear bumper	1	Dented		\$ 893.40	\$ 893.40
14	Rear bumper reflector LH/RH	2	Serviceable	\$ 48.00	\$ 96.00	-
15	Rear bumper tow hook cover	1	Dented		\$ 19.00	\$ 19.00
16	Rear bumper retainer LH/RH	2	Cracked/Broken	\$ 63.70	\$ 127.40	\$ 127.40
17	Rear bumper bracket LH/RH	2	Dented	\$ 39.70	\$ 79.40	\$ 79.40
18	Rear bumper reinforcement	1	Dented		\$ 475.30	\$ 475.30
19	Rear end panel	1	Dented		\$ 579.60	\$ 579.60
20	Rear end panel top trim	1	Deformed/Cracked		\$ 392.30	\$ 392.30
21	Spare tyre board	1	Deformed		\$ 300.10	\$ 300.10
22	Spare tyre centre sponge	1	Serviceable		\$ 186.40	-
23	Spare tyre side sponge LH/RH	2	Serviceable	\$ 122.90	\$ 245.80	-
24	Spare tyre panel		Distorted/Repair		-	-

Total:	\$ 7,588.60	\$ 5,908.40
10%	\$ 758.86	\$ 590.84
Nett total:	\$ 6,829.74	\$ 5,317.56

1	Boot lid inner trim clips	1set	Necessary	\$ 50.00	\$ 50.00
2	Rear bumper clips	1set	Necessary	\$ 50.00	\$ 30.00
3	Reverse sensor	1set	Malfunctioned	\$ 300.00	\$ 250.00
4	Joint sealant	1	Necessary	\$ 60.00	\$ 40.00

Special nett total:	\$ 460.00	\$ 370.00
---------------------	-----------	-----------

Parts Total:	\$ 7,289.74	\$ 5,687.56
--------------	-------------	-------------

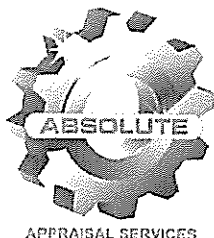

**ABSOLUTE APPRAISAL SERVICES PTE LTD**  
**LOSS ADJUSTERS & MOTOR APPRAISERS**

160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722

Mobile: 9688-0413 Fax: 6266-7396

Email: absolute.app.svcs@gmail.com

Vehicle No: SJX9281B

Report No: AAS/2019/588

S/N Labour Description

Repairer's Est

Revised Est

1 Check rear lightings & wirings.

\$ 80.00

\$ 50.00

2 Remove & transfer boot lid components.

\$ 150.00

\$ 100.00

3 Renew rear parking sensors.

\$ 80.00

\$ 50.00

4 Remove & refit rear upholsteries to enable replacement.

\$ 150.00

\$ 120.00

5 Anti rust treatment on rear affected panels.

\$ 100.00

\$ 80.00

6 To renew rear damaged parts, Panel beat, reform & realign affected area.

\$ 2,200.00

\$ 1,600.00

7 To respray rear affected panels.

\$ 2,000.00

\$ 1,800.00

Labour Total:

\$ 4,760.00

\$ 3,800.00

Grand Total:

\$ 12,049.74

\$ 9,487.56

The final adjusted lump sum amount is \$7,600.00

Under normal circumstances, the repair should be completed within a reasonable period of 8 working days.

121 Photographs were taken at the time of inspection.

Disclaimer: This report is intended for the exclusive use of the address solely in relation to the loss occurrence in which the assessed vehicle involved. No liability or responsibility whatsoever shall be held by Absolute Appraisal Service Pte Ltd for any reliance on this report by any third party.