

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

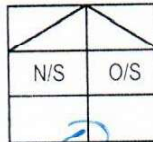

Bal. or Market Value:

IDAC Accident Rpt:

GIA / PR Seen:

Est. Repairs:

Lum Sum:

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Date / Time

Action / Instruction

Veh No:

Yr Regn:

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Colour:

Sp. Reading

Eng/No:

C/No:

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / SRim / STD A/Rim or

Tyre Size:

F:

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal.

L/Bal.

D.O.A.

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?

1)

Date/Time, File Return to?

2)

Report Format:

Lump Sum / I.B.I: (\$

☐

Preli. Report

☐

Final Report

Days Of Repair:

Resurvey No. of Trip:

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech. Invs (\$

☐

Weekend (\$

Survey Fee:

Transportation:

) S + RS. SI

) Photos

) Others

TOTAL

23/5/22 L/S \$6500 informal AH long

SJQ9872H Toyota Previa

No	Qty	Part Description	Unit	Price	Total	Notes
1	1	Rear bumper assy	D.S	751.10	\$ 1,581.60	✓
2	2	Rear bumper bracket	NS		\$ 173.20	X
3	1	Rear left bumper side end retainer	Sent		\$ 90.60	✓
4	1	Rear right bumper side end retainer	Sent		\$ 90.60	✓
5	1	Rear left bumper side retainer	Sent		\$ 88.50	✓
6	1	Rear right bumper side retainer	Sent		\$ 88.50	✓
7	2	Rear bumper reflector	11		\$ 286.70	X
8	1	Rear left bumper tow hood cover	11		\$ 44.40	X
9	1	Rear right bumper tow hood cover	11		\$ 44.40	X
10	1	Rear bumper left side sponge	11		\$ 171.10	X
11	1	Rear bumper right side sponge	11		\$ 171.10	X
12	1	Rear tailgate assy	body 10	1681.10	\$ 2,812.60	✓
13	1	Rear tailgate inner board	11		\$ 494.10	X
14	1	Rear tailgate lock mechanism	10/shut	509.10	\$ 581.40	✓
15	1	Rear tailgate lock catch	11		\$ 86.30	X
16	1	Rear tailgate lock switch	11		\$ 264.10	X
17	1	Rear tailgate centre logo	11		\$ 68.80	✓
18	1	Rear tailgate 'Toyota' emblem	11		\$ 66.60	✓
19	1	Rear tailgate 'Previa' emblem	11		\$ 65.40	✓
20	2	Rear tailgate hinges	11		\$ 392.80	X
21	2	Rear tailgate dampers	11		\$ 596.20	X
22	1	Rear tailgate weatherstrip	11		\$ 288.20	✓
23	1	Rear tailgate outer garnish	11		\$ 181.50	✓
24	2	Rear tailgate number plate lamp	11		\$ 180.60	X
25	1	Rear tailgate inner handle	11		\$ 121.30	X
26	1	Rear tailgate center lamp	11		\$ 299.40	X
27	1	Rear tailgate left taillamp	11		\$ 435.30	X
28	1	Rear tailgate right taillamp	11		\$ 435.30	X
29	1	Rear left taillamp	11		\$ 787.50	X
30	1	Rear right taillamp	11		\$ 787.50	X
31	1	Rear end lower panel	body 10	681.10	\$ 781.60	✓
32	1	Rear end lower outer panel	body 10	705.20	\$ 887.40	✓
33	1	Rear end lower panel top garnish	11		\$ 284.20	✓
34	1	Rear end lower panel inner garnish	11		\$ 191.50	✓
35	1	Rear windscreen glass moulding	11	166.10	\$ 288.80	✓
36	1	Rear floor panel	R		\$ 1,681.70	X
37	1	Rear floor panel top cover	carpet warped		\$ 426.30	✓

Asher

not Authorized
See
6 days 10/5/22
2/5 # 6500

SJQ9872H Toyota Previa

No	Qty	Part Description			
38	1	Rear left fender inner garnish	del/warped	\$ 445.10	✓
39	1	Rear right fender inner garnish	del/warped	\$ 445.10	✓
40	1	Rear left fender inner cowling	11	\$ 188.80	X
41	1	Rear right fender inner cowling	11	\$ 188.80	X
42	1	Rear exhaust muffler assy	11	\$ 1,289.10	X
43	2	Rear exhaust muffler rubber mounting	11	\$ 88.60	X
44	1	Rear wiper motor	11	\$ 287.10	X
45	1	Rear wiper blade	11	\$ 109.60	X
46	1	Rear spare tyre board	NS	\$ 258.90	X
				\$ 19,618.20	
less 25%				\$ 4,904.55	
				\$ 14,713.65	
<u>Special Nett Items</u>					
1	12	Rear bumper clips	del	\$ 60.00	50
2	10	Rear tailgate inner board clips	del	\$ 50.00	✓
3	4	Rear tailgate outer garnish clips	11	\$ 40.00	X
4	1	Rear end lower inner panel sealant	11	\$ 120.00	X
5	1	Rear end lower outer panel sealant	del	\$ 120.00	50
6	6	Rear end lower panel top garnish clips	11	\$ 40.00	X
7	6	Rear end lower panel inner garnish clips	11	\$ 40.00	X
8	1	Rear windscreen glass sealant	del	\$ 100.00	40
9	2	Rear bumper reverse sensor	shotel	\$ 300.00	200
10	1	Rear no plate with garnish	11	\$ 100.00	X
11	1	Rear view camera	11	\$ 450.00	X
12	1	Rear floor panel sealant	11	\$ 150.00	X
13	1	Rear floor panel insulator pad	11	\$ 180.00	X
14	4	Rear left fender inner cowling clips	11	\$ 30.00	X
15	4	Rear right fender inner cowling clips	11	\$ 30.00	X
16	10	Rear left fender inner garnish clips	11	\$ 40.00	X
17	10	Rear right fender inner garnish clips	11	\$ 40.00	X
				\$ 1,890.00	
Total parts				\$ 16,603.65	

SJQ9872H Toyota Previa

No

- | | | | |
|----|--|--------------|------|
| 1 | Labour for panel beating, cut, weld, straighten rear affected area and replace rear damaged parts including floor panel. | \$ 1,800.00 | 900 |
| 2 | To putty and spray painting rear portion. | \$ 1,800.00 | 1000 |
| 3 | To check rear lighting and wiring. | \$ 50.00 | 30 |
| 4 | To remove and install rear tailgate lock mechanism. | \$ 80.00 | 60 |
| 5 | To remove and install rear exhaust muffler assy. | \$ 11 120.00 | X |
| 6 | To remove and install rear inner garnish and trim to facilitate the repair. | \$ 180.00 | 80 |
| 7 | To apply anti rust proofing to rear affected area. | \$ 140.00 | 60 |
| 8 | To remove and install rear bumper reverse sensor. | \$ 80.00 | 50 |
| 9 | To remove and install rear windscreen glass to facilitate the repair. | \$ 140.00 | 120 |
| 10 | To remove and install rear view camera. | \$ 11 80.00 | X |
| 11 | To repair, straighten and align rear left fender assy. <i>refer labour 1</i> | \$ 180.00 | X |
| 12 | To repair, straighten and align rear right fender assy. | \$ 180.00 | X |
| 13 | Towing service. | \$ 11 100.00 | X |

Total labour : \$ 4,930.00

Total parts : \$ 16,603.65

Total labour : \$ 4,930.00

Total repair cost : \$ 21,533.65

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

p-7314.60
 252
 p-5485.95
 s.w-390
 L-2300
 8175.55
 202
 6540.