LKK Auto Consultants #01-25 Paya Ubi Industrial Park, 51 **Ubi Avenue 1** 408933

Insurer Reference: SMX9331E

Full Report Repairer Reference: M4864/SMX9331E Registration: SMX9331E Date calculated: 30/11/2022 1:53 PM Printed: 30/11/2022 1:53 PM

Summary Information

Claim

Location: Singapore (SG) Work Provider: China Taiping Insurance

(Singapore) Pte Ltd

Printed by: KK LAU Currency: SGD SMX9331E Claim Reference: Date of Incident: 26/04/22

Hire Car Start: Estimated Repair Time: 8 8 Hire Car End: Actual Repair Days:

Vehicle Details

Vehicle

TOYOTA Manufacturer:

Model: RUSH (F800/F850) Sub Model: BASE MODEL

Model Sheet Number: 70 RU 01 SMX9331E Registration: VIN number: A200A0030265

Odometer: 14909

Model Specs

TWO COAT METALLIC PREPARE OFF VEHICLE


Vehicle Condition

Vehicle Status

Pre-Accident Damage: Date of Inspection:

Damage Areas

All	
Underbody	

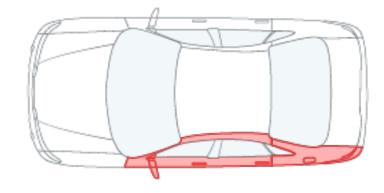

Tyres Condition

Tyre Brand Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Outer), Condition

Middle), mm mm mm mm mm

Spare Tyre Brand

Tread (Spare), mm

Labour

	Time Base 10 WU/h	Price = 42	.00 SGD/h
Code	Description	WU	Price SGD
670051	RENEW L/F DOOR INCLUDES: R + R DOOR, CONVERT ATTACHED PARTS	14.0	58.80
670061	RENEW L/R DOOR INCLUDES: R + R DOOR, CONVERT ATTACHED PARTS	13.0	54.60
751451	R + R L/SIDE PANEL PROTECTIVE MOULDING	3.0	12.60
NO NUMBER	R + R LEFT REAR WHEELHOUSE SHELL	3.0	12.60
531191)	REMOVE AND REFIT L/R S-PANEL MOULDING	3.0	12.60
2101	LEFT SILL PANEL CPL REPAIR	20.0*	84.00
2279	L/OUTER B-PILLAR REPAIR	20.0*	84.00
3481	L/RR SIDE PANEL REPAIR	20.0*	84.00
	Labour Cost Panel / Mechanical Labour	Hrs WU 9.60 96.0	403.20
	Total of Labour		403.20

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	LEFT FRONT DOOR NEW PART PAINTING	16.0
	L/R DOOR NEW PART PAINTING	15.0
	L/RR SIDE PANEL REPAIR PAINTING <50%	13.0
	LEFT SILL PANEL CPL REPAIR PAINTING >50%	12.0
	L/OUTER B-PILLAR REPAIR PAINTING >50%	12.0

Paint Material Per Part

Code	Description	Price SGD
1481	LEFT FRONT DOOR NEW PART PAINTING	44.89
1781	L/R DOOR NEW PART PAINTING	39.22
3481	L/RR SIDE PANEL REPAIR PAINTING <50%	19.38
2101	LEFT SILL PANEL CPL REPAIR PAINTING >50%	7.90
2279	L/OUTER B-PILLAR REPAIR PAINTING >50%	7.90

Labour Cost - Paint		Hrs	WU	Price SGD
Factor	42.00 SGD/h			
Time Paint			68.0	
Preparation Main Work Metal		2.50	25.0	105.00
Total	10 WU/h	9.30	93.0	390.60

Material Cost - Paint	Price SGD
New Part Painting	84.11
Repair Painting	35.18
Material-constant Metal Preparation	28.60
Total	147.89

Spare Parts

				prices as at 2015-06-01/01
Code	Description	Part Number	Part Source	Price SGD
1481	LEFT FRONT DOOR	67002 BZ640	Original	660.00
1655	L/F STRIPE	75924 BZ180C0	Original	0.00
1781	L/R DOOR	67004 BZ660	Original	520.00
1947	L/R STRIPE	75926 BZ110C0	Original	0.00
1983	L/R S-PANEL MOULDING	61682 BZ030	Original	90.00
2015	L/R DOOR STRIPE	75928 BZ040C0	Original	0.00
2227	L/R SILL BRACKET	65632 BZ020	Original	0.00
f: OEM Parts n: Non-OEM Parts u: Used parts	Savings Subtotal			0.00 1,270.00
u. Oseu parts	Total			1,270.00

Extras

Code	Description	Price SGD
1983	[E]: L/R S-PANEL MOU LDING: CHECK PR	0.00*
1983	ICE	0.00*
2227	[E]: L/R SILL BRACKE T: CHECK PRICE	0.00*

Final Calculation

	SGD	SGD
Parts	1,270.00	
Total Parts		1,270.00
Labour Time Base 10 WU/h		
Total 96.0 WU X 42.00 SGD/h	403.20	
Total of Labour		403.20
Total Of Extras		0.00
Paint Work Time Base 10 WU/h		
Labour Cost 93.0 WU X 42.00 SGD/h	390.60	
Material Cost	147.89	
Total Paint Including Material		538.49
Repair Cost Excludes GST		2,211.69
GST (+7.00%)		154.82
Repair Cost Included GST		2,366.51

Comments

* - USER SUPPLIED DATA NN - NO MANUFACTURERS CODE EXISTS) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

Author	Date	Text
_imMeiHong	26/11/2022 11:05 AM	RASUL