



**ABSOLUTE APPRAISAL SERVICES PTE LTD**  
**LOSS ADJUSTERS & MOTOR APPRAISERS**  
160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722  
Mobile: 9688-0413 Fax: 6266-7396  
Email: absolute.app.svcs@gmail.com

### Vehicle Inspection Report

To: Trillium Leasing Pte Ltd  
C/o: 160 Sin Ming Drive #08-01  
Sin Ming AutoCity (S) 575722

Date of report: 03.12.2021  
Date of request: 23.11.2021  
Date of inspection: 23.11.2021  
Date of accident: 05.11.2021  
Claim type: Third Party Claim

Report No: AAS/2021/279

### Particulars of affected vehicle:

Registration no: SMM2728Z  
Make/Model: Honda Freed Hybrid (A)  
Year of registration: 2018  
Colour: Metallic Blue

Odometer: 138460 km  
Engine Capacity: 1496 cc  
Engine no: LEB5600262  
Chassis no: GB71067079

### Condition of tires:

Front Left: 6mm  
Make: Sailun  
Rear Left: 6mm  
Make: Kapsen

Front Right: 6mm  
Make: Sailun  
Rear Right: 6mm  
Make: Kapsen

Type of road wheel: Alloy (The above represent the remaining life of the tire thread)

### Pre-accident condition (Static tests only)

General Bodywork : Good  
Paintwork : Good  
Handbrake : In order  
Footbrake : In order  
Steering : In order  
Apparent engine modification : Nil

### The Assignment

The inspection was conducted at M/s. Aero Garage Pte Ltd  
160 Sin Ming Drive #08-01  
Sin Ming AutoCity (S) 575722

(Subsequent inspection was conducted)

### Assessment

Repairer's estimate: \$ 6,028.00  
  
Revised estimate: \$ 4,034.40  
  
Recommended reserve: \$ 3,250.00 (Lump sum)

Estimated normal duration of repairs : 5 Working days



**ABSOLUTE APPRAISAL SERVICES PTE LTD**  
**LOSS ADJUSTERS & MOTOR APPRAISERS**  
160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722  
Mobile: 9688-0413 Fax: 6266-7396  
Email: absolute.app.svcs@gmail.com

Vehicle No: SMM2728Z

Report No: AAS/2021/279

W/O PREJUDICE

Point of impact

At the RHS portion.

General description of damages

The RHF door, RH sliding door, RH sill panel, etc.

Other parts were also found damaged. (See schedule for details)

Recommendation

The estimate cost of repair submitted by M/s Aero Garage Pte Ltd as per schedule attached have been revise and scrutinize. We list the breakdown of our findings and recommendation as per attached.

Our adjusted amount for the cost of repair is SGD \$4,034.40

Conclusion


The repairer has agreed to undertake the repair at a lumpsum of SGD \$3,250.00

Under normal circumstances, the repair of the damaged vehicle should be completed within a reasonable period of 5 working days.

have **Not Authorised** and/or instruction to the repairer to proceed with the repairs. This inspection was conducted entirely on a '**Without Prejudice**' basis.

We are pleased to advise that the inspection was carried out accordingly and hereby submit our appraisal report which includes 45 photographs.

Your Faithfully  
Absolute Appraisal Services Pte Ltd

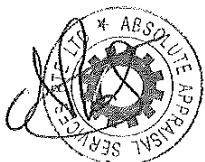

Nicky Seah  
Automobile Appraiser  
MSAAA / MSMCTA



**ABSOLUTE APPRAISAL SERVICES PTE LTD**  
**LOSS ADJUSTERS & MOTOR APPRAISERS**  
 160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722  
 Mobile: 9688-0413 Fax: 6266-7396  
 Email: absolute.app.svcs@gmail.com

Vehicle No: SMM2728Z  
 Appraisement Schedule

Report No: AAS/2021/279

S/N	Parts Description	Qty	Condition	Repairer's Est	Revised Est
1	RHF door	1	Dented	\$ 1,445.90	\$ 1,445.90
2	RHF door frame tape	1	Necessary	\$ 29.70	\$ 29.70
3	RHF door weatherstrip	1	Necessary	\$ 122.80	\$ 122.80
4	RHF door lock	1	Distorted	\$ 270.10	\$ 270.10
5	RHF door glass regulator assy	1	Refit	\$ 347.70	-
6	RH sliding door	1	Dented	\$ 1,694.70	\$ 1,694.70
7	RH sliding door frame tape	1	Necessary	\$ 29.70	\$ 29.70
8	RH sliding door lock	1	Refit	\$ 587.90	-
9	RH sliding door weatherstrip	1	Necessary	\$ 37.60	\$ 37.60
10	RH sliding door glass regulator	1	Refit	\$ 367.90	-
11	RH sliding door latch actuator	1	Refit	\$ 788.50	-
Total:				\$ 5,722.50	\$ 3,630.50
-20%				\$ 1,144.50	\$ 726.10
List total:				\$ 4,578.00	\$ 2,904.40

S/N	Labour Description	Repairer's Est	Revised Est
1	Labour to replace damaged parts. Realign affected section.	\$ 600.00	\$ 440.00
2	Respray RHF door, RH sliding door & RH sill panel.	\$ 600.00	\$ 500.00
3	Check all lightings & wirings.	\$ 50.00	\$ 30.00
4	Remove & transfer RH both door fittings.	\$ 200.00	\$ 160.00
Labour Total:		\$ 1,450.00	\$ 1,130.00
Grand Total:		\$ 6,028.00	\$ 4,034.40

The final adjusted lump sum amount is \$3,250.00

Under normal circumstances, the repair should be completed within a reasonable period of 5 working days.

45 Photographs were taken at the time of inspection.

Disclaimer: This report is intended for the exclusive use of the address solely in relation to the loss occurrence in which the assessed vehicle involved. No liability or responsibility whatsoever shall be held by Absolute Appraisal Service Pte Ltd for any reliance on this report by any third party.