

ASS. REC. BY:

REF:

AIG / 22004922/Kc

C

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

885K

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

16

days

Res.: Yes or No

Lum Sum:

20

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SML 88617

Yr Regn: 06, 19

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Honda Shuttle

c.c

1496

Colour

M.D. Blue

A/C:

Insured / Std / NI / NA

Sp. Reading

263916

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

GP7 - 2001026

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

185/60R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

9

mm

R/Bal.

9

mm

L/Bal.

9

mm

L/Bal.

9

mm

D.O.A.

21/5/22

D.O.I.

24/5/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1

Cor B2

10/6/2020, 600 Cntr 14/6/22

Date/Time, File Pass to?

☐

: Prel. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS. \$

Fees

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format :

Lump Sum / I.B.I: (\$

輝 陽 汽 車 有 限 公 司

HUI YANG MOTOR PTE. LTD.

Contact Add : SIN MING AUTOCARE Blk 176 Sin Ming Drive #04-02 Singapore 575721

Tel: 64515752 (2 Lines) . Fax: 64514658

GST & Reg No. 201629438M

21/05/2022


Owner: LIM KOK GIAP

ESTIMATE TO REPAIR HONDA SHUTTLE HYBRID - SML8661Y

1pc	front bonnet	B1	\$ 920.80	✓
2pcs	front bonnet hinge @\$75.00	B1 D1	\$ 150.00	✓
1pc	front bonnet inner cardboard 135	Net frame	\$ 195.00	✓
8pcs	front bonnet inner cardboard clip @\$5.00	M	\$ 40.00	✓
1pc	front bonnet inner rubber	W	\$ 158.90	✓
1pc	front bonnet inner lock 158	B	\$ 195.50	✓
1pc	front bonnet inner lock garnish	D1	\$ 55.90	✓
2pcs	front headlamp @\$2550.00 o/s cm	NIS NG CM	\$ 5,100.00	✓
2pcs	front headlamp chrome @\$155.50 o/s cm	NIS SR	\$ 311.00	✓
2pcs	front headlamp lower bracket @\$58.00	CM	\$ 116.00	✓
1pc	front centre grille base	CM	\$ 495.00	✓
1pc	front centre grille outer garnish	CM	\$ 325.50	✓
1pc	front centre grille "H" logo	M	\$ 58.50	✓
1pc	front centre grille top garnish	D1	\$ 195.00	✓
8pcs	front centre grille top garnish clip @\$5.00	M	\$ 40.00	✓
1pc	front centre grille lower chrome	D1	\$ 215.00	✓
1pc	front bumper 1050	B	\$ 1,150.50	✓
10 20pcs	front bumper clip @\$5.00	M	\$ 100.00	✓ 50
1pc	front bumper towing cover	D1	\$ 65.00	✓
2pcs	front bumper side retainer @\$35.00	D1	\$ 70.00	✓
1pc	front bumper reinforment	B	\$ 420.90	✓
1pc	front bumper lower grille	D1	\$ 158.60	✓
1pc	front bumper lower cover	Net frame	\$ 255.20	✓
1pc	front bumper lower cover rubber	T	\$ 185.00	✓
2pcs	front bumper fog lamp @\$385.50 o/s cm		\$ 771.00	✓
2pcs	front bumper fog lamp garnish @\$185.50 o/s D1		\$ 371.00	✓
2pcs	front bumper fog lamp garnish top cover @\$78.50	S	\$ 157.00	✓
2pcs	front fender @\$598.50 e 495.00	Bu	\$ 1,197.00	✓
2pcs	front fender inner shield @\$235.20 e 184.	o/s cm	\$ 470.40	✓
10 20pcs	front fender inner shield clip @\$5.00	M	\$ 100.00	✓
1pc	front support panel	B	\$ 760.40	✓
2pcs	front support panel side garnish @\$75.50 985	D1/W	\$ 151.00	✓
1pc	front air-con condensor	M	\$ 985.00	✓
1pc	front air-con condensor pipe 1	Rd	\$ 285.50	✓
1pc	front air-con condensor pipe 2	Rd	\$ 280.00	✓
1pc	front air-con condensor cowling 181	CM	\$ 290.50	✓
1pc	front air-con condensor cowling motor	T	\$ 325.00	✓
1pc	front air-con condensor cowling motor fan	CM	\$ 95.00	✓

balance c/f

\$ 17,216.10

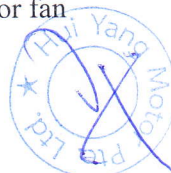

Not Authorizing
L1 Rep @ 20,600ph
Money After Part
16 day

輝 陽 汽 車 有 限 公 司

HUI YANG MOTOR PTE. LTD.

Contact Add : SIN MING AUTOCARE Blk 176 Sin Ming Drive #04-02 Singapore 575721

Tel: 64515752 (2 Lines) . Fax: 64514658

GST & Reg No. 201629438M

21/05/2022

Owner: LIM KOK GIAP

ESTIMATE TO REPAIR HONDA SHUTTLE HYBRID - SML8661Y

	balance b/f		\$ 17,216.10	
		<i>huus cm</i>		
1pc	front radiator	\$	955.20	<i>✓</i>
1pc	front radiator top hose	<i>Sm</i> \$	85.00	<i>X</i>
1pc	front radiator lower hose	<i>Sm</i> \$	95.00	<i>X</i>
1pc	front radiator cowling <i>181</i>	<i>cm</i> \$	295.00	<i>✓</i>
1pc	front radiator cowling motor	<i>Sm</i> \$	350.00	<i>✓</i>
1pc	front radiator cowling motor fan	<i>cm</i> \$	90.50	<i>✓</i>
1pc	front radiator spare tank	<i>net</i> \$	85.50	<i>✓</i>
1pc	front radiator thermal start	<i>Sm</i> \$	125.50	<i>X</i>
2pcs	front wiper @\$50.00	<i>Sm</i> \$	100.00	<i>X</i>
1pc	front wiper garnish <i>282.10</i>	<i>net</i> \$	350.20	<i>✓</i>
2pcs	front wiper garnish side cover @\$85.50	<i>net</i> \$	171.00	<i>✓</i>
2pcs	front wiper arm @\$125.00	<i>Sm</i> \$	250.00	<i>X</i>
1pc	front wiper tank	<i>net</i> \$	95.50	<i>✓</i>
1pc	front manifold	<i>cm</i> \$	950.50	<i>✓</i>
1pc	front engine mounting RH	<i>Sm</i> \$	485.50	<i>X</i>
1pc	front engine mounting LH	<i>Sm</i> \$	385.00	<i>X</i>
2pcs	front seat belt @\$950.00 <i>c 750</i>	<i>Sm</i> \$	1,900.00	<i>✓</i>
1pc	front dashboard <i>2152</i>	<i>Sm</i> \$	2,850.50	<i>✓</i>
1pc	front dashboard air bag	<i>net</i> \$	980.00	<i>✓</i>
1pc	front steering air bag	<i>Sm</i> \$	1,200.00	<i>✓</i>
1pc	air bag control unit <i>1250</i>	<i>net</i> \$	1,350.00	<i>✓</i>
2pcs	side skirt @\$685.00	<i>Sm</i> \$	1,370.00	<i>X</i>
			<u>\$ 31,736.00</u>	
	less 20%		<u>\$ 6,347.20</u>	
			<u>\$ 25,388.80</u>	
1set	front number plate & casing	<i>net</i> s.nett \$	50.00	<i>45.50</i>
	towing fee	\$	100.00	<i>50</i>
	remove & refit air-con & radiator	\$	180.00	<i>150</i>
	remove & refit dashboard	\$	280.00	<i>250</i>
	remove & refit air bag system	\$	380.00	<i>250</i>
	reprogramming ECU & air bag system	\$	380.00	<i>220</i>
	sealant	<i>net</i> \$	160.00	<i>X</i>
	wiring	\$	250.00	<i>40</i>
	tuffkote	\$	300.00	<i>120</i>
	spray painting	\$	2,500.00	<i>1600</i>
	labour charges	\$	2,500.00	<i>7200</i>
	Total		<u>\$ 32,468.80</u>	

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:



輝陽汽車有限公司
HUI YANG MOTOR PTE. LTD.

Contact Add : SIN MING AUTOCARE Blk 176 Sin Ming Drive #04-02 Singapore 575721

Tel: 64515752 (2 Lines) . Fax: 64514658

GST & Reg No. 201629438M

21/05/2022

Owner: LIM KOK GIAP

SUPPLEMENTARY TO REPAIR HONDA SHUTTLE HYBRID - SML8661Y

1pc	HYBRID water pump	623.70	CM \$	780.50	✓
1pc	HYBRID air-con compressor	1900	hws cm	\$ 2,850.00	✓
				\$ 3,630.50	
				\$ 726.10	
				\$ 2,904.40	

less 20%

