



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2206127

INV Date 03/10/2022

Reference CC4/LPC22005050/Tpa3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SHB 6217Y
Insured Veh. GBC 1043E
Claim No. 22/22/22/VC05/025854
Policy No. Z/21/VC00/11035
Accident Date 27/05/2022
Inspection Date 30/05/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC22005050/Tpa3q2 Date: 03/10/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBC 1043E	Veh. Inspected	SHB 6217Y	
Policy No.	Z/21/VC00/11035	Coverage (\$)	0.00	
Claim No.	22/22/22/VC05/025854	Excess (\$)	0.00	
Assign From	ENG HUEY NI	Assign Date	30/05/2022	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI IONIQ	c.c	1580	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	KMHC851CVLU186769	Colour	BLUE	
Odometer	266184 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	WEST LAKE	6 mm	
L/H Front Tyre	195/65 R15	WEST LAKE	6 mm	
R/H Rear Tyre	195/65 R15	WEST LAKE	6 mm	
L/H Rear Tyre	195/65 R15	WEST LAKE	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	27/05/2022	Inspection Date	30/05/2022	
Survey held at	COMFORTDELGRO ENGINEERING PTE LTD 59 LOYANG DRIVE SINGAPORE 508969			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			3 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 6217Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	BOOTLID COVER	BENT	2,549.70	2,549.70
1	REAR BUMPER ASSY	DEFORMED	459.40	459.40
1	REAR BUMPER CENTRE MOULDING	DEFORMED	451.25	451.25
1	REAR BUMPER BEAM	NOT NECESSARY	394.80	-
10	REAR BUMPER CLIPS	NECESSARY	22.00	22.00
1	FOG LAMP	NOT NECESSARY	201.50	-
1	ANTENNA ASSY -SMARTKEY	NOT NECESSARY	40.50	-
1	BOOTLID EMBLEM -IONIQ	NECESSARY	31.30	31.30
1	BOOTLID EMBLEM -HYBRID	NECESSARY	24.30	24.30
1	BOOTLID EMBLEM -H	NOT NECESSARY	28.00	-
1	REAR WINDSCREEN GLASS (SMALL)	BROKEN	584.90	584.90
1	SPOILER ASSY	TO REPAIR SEE LABOUR	665.40	-
	LESS 20% DISCOUNT		-1,090.61	-824.57
			4,362.44	3,298.28
<u>SPECIAL NETT ITEMS</u>				
1	REAR NUMBER PLATE (SN)	CRACKED	50.00	50.00
1	REVERSE SENSOR (SN)	NECESSARY	180.00	180.00
1	REAR BOOTLID COMFORT LOGO (SN)	NECESSARY	30.00	30.00
1	REAR BOOTLID TEL NOS LOGO (SN)	NECESSARY	30.00	30.00
1	REAR BOOTLID APPS LOGO (SN)	NECESSARY	40.00	40.00
1	WINDSCREEN SEALANT (SN)	NECESSARY	46.00	46.00
			376.00	376.00
<u>LABOUR</u>				
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF SPOILER ASSY .		800.00	525.00
	SPRAY PAINT.		600.00	500.00
	REMOVE/REFIX REVERSE SENSOR .		50.00	30.00
	CHECK WIRING.	NOT NECESSARY	50.00	-
	REMOVE/REFIX REAR WINDSCREEN GLASS.		120.00	120.00
	ADVERTISEMENT LOGO -BUMPER .		50.00	50.00

Report Ref No. CC4/LPC22005050/Tpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	ADVERTISEMENT LOGO -BOOTLID .		100.00	100.00
	ADVERTISEMENT LOGO -FENDER .		200.00	200.00
			1,970.00	1,525.00
GRAND TOTAL			6,708.44	5,199.28
RECOMMENDED COST OF REPAIRS				5,199.28

Report Ref No. CC4/LPC22005050/Tpa3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 6217Y

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

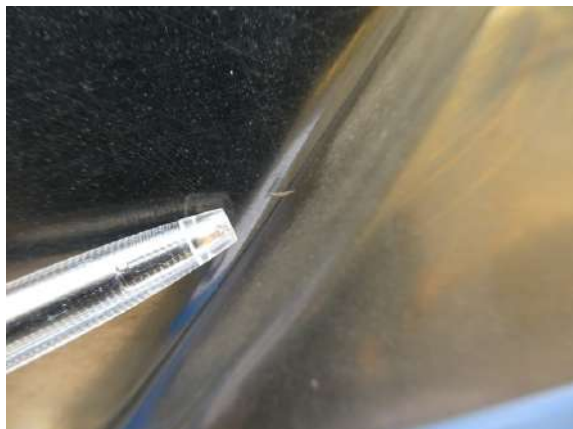



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 6217Y

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

