


ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: SLV 56227
 at Workshop m/s Zoom
 of _____
 Insured: SMC 7977R
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
 repair at the time of inspection.

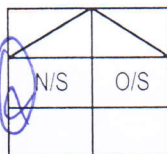

Bal. or Market Value: \$70k.
 IDAC Accident Rpt: Consistent? : Yes or No
 GIA / PR Seen: Consistent? : Yes or No
 Est. Repairs: 5 days Res.: Yes or No
 Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

8182

Vehicle: IN / OUT

Date: _____ Person Contacted: LIA 24433

Veh No: SLV 56227 Yr Regn: 25/10/10
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or G1
 Make: mer Benz E250 c.c. 1796
 Colour: Brown A/C: Insured / Std / NI / NA
 Sp. Reading: 182202 T/Radio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: WDD 2120472A 188755
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: Inorder / Jammed / Leaked / Burnt or
 Brake: Inorder / Jammed / Leaked / Burnt or
 Modi: Nil / S/Rim / STD A/Rim or
 Tyre Size: F: 245 / 40 ZR18
 R: 265 / 35 ZR18 H961 lead
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or head key
 Front R/Bal. 6 mm R/Bal. 6 mm
 L/Bal. 6 mm L/Bal. 6 mm
 D.O.A. 03/06/22 D.O.I. 6/6/22
 Survey held at _____
 Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
 The U/C / Chassis frame / Body Structure affected due to collision.
 N/S Body &

Date / Time Action / Instruction Rep 10k.

see note 30-04-2029 LIA 24433

20/6/22 informed Elc 1 4/5 \$8000

Date/Time, File Pass to?

☐

: Preli. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

) S + RS, SI

) Photos

) Others

TOTAL

Report Format :

Lump Sum / I.B.I: (\$)

Add Fee: ☐ : Site Insp (\$)☐ : Interview (\$)☐ : Tech. Invs (\$)☐ : Weekend (\$)

7 June 2022

REG NO.: SLV 5622 P
MAKE/MODEL: MERCEDES BENZ E250

Not Authorized
LH
6/6/22
a/s \$8000/
5 days

ESTIMATED REPAIR COST FOR THE VEHICLE MENTIONED ABOVE

QTY	DESCRIPTION	AMT(\$)
	LIST ITEMS	
1	Front door -LH <i>Body</i>	\$ 2,235.00 ✓
2	Front door hinges <i>11</i>	\$ 330.00 X
1	Front door inner board <i>11</i>	\$ 1,000.00 X
1	Front door lock <i>11</i>	\$ 435.00 X
1	Front door outer handle <i>11</i>	\$ 530.00 X
1	Front door chrome moulding <i>nec</i>	\$ 165.00 ✓
1	Front door regulator <i>11</i>	\$ 650.00 X
1	Front door regulator motor <i>11</i>	\$ 590.00 X
1	Front door regulator support <i>11</i>	\$ 385.00 X
1	Front door side mirror <i>11</i>	\$ 758.00 X
1	Front door inner sponge <i>11</i>	\$ 145.00 X
1	Front door handle inner pad <i>11</i>	\$ 135.00 X
1	<i>for</i> Rear door opening weatherstrip <i>11</i>	\$ 255.00 X
1	<i>for</i> Rear door weatherstrip <i>11</i>	\$ 295.00 ✓
1	<i>for</i> Rear door lower rubber seal <i>11</i>	\$ 190.00 X
1	Centre pillar -LH <i>11</i>	\$ 1,380.00 X
1	Rocker panel -LH <i>11</i>	\$ 995.00 ✓
1	Rocker panel outer garnish <i>21/10mm</i>	\$ 655.00 ✓
1	Rear door -LH <i>Body</i>	\$ 2,235.00 ✓
1	Rear door checker <i>11</i>	\$ 155.00 X
1	Rear door outer chrome moulding <i>11</i>	\$ 175.00 ✓
2	Rear door hinges <i>11</i>	\$ 330.00 X
1	Rear door inner board <i>11</i>	\$ 950.00 X
1	Rear door lock <i>11</i>	\$ 445.00 X
1	Rear door outer handle <i>11</i>	\$ 495.00 X
1	Rear door regulator <i>11</i>	\$ 358.00 X
1	Rear door regulator motor <i>11</i>	\$ 485.00 X
1	Rear door opening weatherstrip <i>11</i>	\$ 255.00 X
1	Rear door weatherstrip <i>11</i>	\$ 280.00 ✓
1	Rear door lower rubber seal <i>11</i>	\$ 185.00 X
1	Rear windscreen moulding <i>11</i>	\$ 175.00 X
1	Rear windscreen sealant <i>11</i>	\$ 293.00 X
1	Rear fender -LH <i>11</i>	\$ 2,185.00 X
1	Rear wheel bearing with hub <i>11</i>	\$ 316.00 ✓
1	Rear shock absorber <i>11</i>	\$ 520.00 X
1	Rear knuckle arm <i>11</i>	\$ 1,265.00 X
1	Rear control arm <i>11</i>	\$ 530.00 X
1	Rear lower arm <i>11</i>	\$ 520.00 X
		\$ 23,280.00

2108.00

LIST ITEMS

1	Rear stay arm	11	\$	608.00	X
1	Rear top arm	11	\$	435.00	X
1	Rear trailing arm	11	\$	440.00	X
1	Rear trailing arm lower cover	11	\$	135.00	X
1	Rear anti roll bar	11	\$	188.00	X
1	Rear anti roll bar link	11	\$	58.00	X
1	Rear drive shaft	11	\$	2,329.00	X
			\$	27,473.00	
Less 10%			\$	2,747.30	
			\$	24,725.70	

SPECIAL NETT ITEMS

1	Rear tyre	sun	\$	550.00	X
1	Rear wheel rim	wheel	\$	1,500.00	800
			\$	2,050.00	

S/NLABOUR CHARGES

1	To remove, replaced damaged lamps and check up rear wiring.		\$	80.00	20
2	To remove and refit inner garnishes.		\$	180.00	100
3	To remove and refit rear undercarriage.		\$	400.00	150
4	To conduct wheel alignment.		\$	180.00	100
5	To remove and refit rear windscreen glass.	11	\$	180.00	X
6	To remove, refit door fittings and replace damaged parts, transfer all fittings to new door.		\$	400.00	100
7	To apply undercoating.		\$	200.00	80
8	Panel beating.		\$	2,000.00	1000
9	To re-spray painting on the affected areas.		\$	1,800.00	1200
			\$	5,420.00	

GRAND TOTAL :

\$ 32,195.70

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

1-7224
10%
650/-6
800
2200
10051-6