



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

EQ INSURANCE COMPANY LTD

5 MAXWELL ROAD
#17-00 TOWER BLOCK
MND COMPLEX
SINGAPORE 069110

INV No. AC2204328

INV Date 15/07/2022

Reference CS/EQI22005345/Kny3e2

Code EQI

PROFESSIONAL SERVICE FEE

Vehicle No. SHD 9872A

Insured Veh. YN 1470A

Claim No. DM22HO00898/JS

Policy No.

Accident Date 06/06/2022

Inspection Date 07/06/2022

Description	Total
Survey Inspection	230.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	230.00
GST (7%)	16.10
Grand Total	246.10

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

KHM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
EQ INSURANCE COMPANY LTD 5 MAXWELL ROAD #17-00 TOWER BLOCK MND COMPLEXSINGAPORE 069110		Ref: CS/EQI22005345/Kny3e2 Date: 15/07/2022 Code: EQI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	YN 1470A	Veh. Inspected	SHD 9872A
Policy No.		Coverage (\$)	0.00
Claim No.	DM22HO00898/JS	Excess (\$)	0.00
Assign From	NEO JIE SI	Assign Date	06/06/2022
2. Vehicle Particulars & Condition			
Make & Model	TOYOTA PRIUS (A)	c.c	1798
Engine No.	HIDDEN	Year of Reg.	2020
Chassis No.	JTDKB3FU803092715	Colour	M.P. WHITE / RED
Odometer	113300 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	195/65 R15	FIRENZA	8 mm
L/H Front Tyre	195/65 R15	FIRENZA	8 mm
R/H Rear Tyre	195/65 R15	SAILUN	9 mm
L/H Rear Tyre	195/65 R15	SAILUN	9 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE O/S REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	06/06/2022	Inspection Date	07/06/2022
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 9872A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	COVER, REAR BUMPER	BUCKLED / DENTED	485.60	485.60
1	REINFORCEMENT SUB-ASSY, REAR BUMPER	TO REPAIR SEE LABOUR	332.70	-
1	COVER, REAR BUMPER, LOWER	SERVICEABLE	22.00	-
1	GUARD, REAR BUMPER, CENTER	SERVICEABLE	374.50	-
1	RETAINER, REAR BUMPER SIDE, LH	SERVICEABLE	132.60	-
1	RETAINER, REAR BUMPER SIDE, RH	DISTORTED	132.60	132.60
1	REFLECTOR ASSY, REFLEX, RH	SERVICEABLE	39.00	-
1	PANEL SUB-ASSY, QUARTER, RH	BENT	871.50	871.50
1	LINER, REAR WHEEL HOUSE, RH	SERVICEABLE	139.80	-
1	LENS & BODY, REAR COMBINATION LAMP, RH	CRACKED	339.60	339.60
1	LENS & BODY, REAR COMBINATION LAMP, NO.2 RH	CRACKED	261.00	261.00
1	LAMP ASSY, REAR, RH	CRACKED	293.60	293.60
1	SPOILER SUB-ASSY, REAR	SERVICEABLE	1,575.40	-
1	PANEL SUB-ASSY, BACK DOOR	TO REPAIR SEE LABOUR	1,147.80	-
1	PLATE, LUGGAGE COMPARTMENT DOOR NAME, NO.2	NOT NECESSARY	54.60	-
1	PLATE, BACK DOOR NAME, NO.1	NOT NECESSARY	54.60	-
1	ORNAMENT SUB-ASSY, BACK DOOR	NOT NECESSARY	47.90	-
1	GARNISH SUB-ASSY, BACK DOOR, OUTSIDE	SERVICEABLE	913.60	-
1	BOARD ASSY, BACK DOOR TRIM	SERVICEABLE	259.20	-
1	WEATHERSTRIP, BACK DOOR	SERVICEABLE	372.30	-
1	COVER, DECK TRIM, REAR	SERVICEABLE	126.70	-
1	PANEL SUB-ASSY, BODY LOWER BACK	TO REPAIR SEE LABOUR	651.00	-
1	STAY ASSY, BACK DOOR, LH	SERVICEABLE	242.50	-
1	STAY ASSY, BACK DOOR, RH	SERVICEABLE	242.50	-
1	HINGE ASSY, BACK DOOR, LH	TO REPAIR SEE LABOUR	61.00	-
1	HINGE ASSY, BACK DOOR, RH	TO REPAIR SEE LABOUR	61.00	-

Report Ref No. CS/EQI22005345/Kny3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 25% DISCOUNT		-2,308.65	-595.97
			6,925.95	1,787.93
	<u>SPECIAL NETT ITEMS</u>			
1	SET PARKING AID (SN)	SERVICEABLE	700.00	-
1	SET REAR BUMPER CLIP (SN)	NECESSARY	95.00	60.00
1	REAR SPOILER CLIP (SN)	NOT NECESSARY	65.00	-
1	FENDER LINER CLIP (SN)	NOT NECESSARY	65.00	-
2	WINDSCREEN SEALANT (SN)	NOT NECESSARY	150.00	-
1	WINDSCREEN MOULDING (SN)	NOT NECESSARY	200.00	-
1	WINDSCREEN INNER SPONGE SEAL (SN)	NOT NECESSARY	130.00	-
1	REAR TAILGATE STICKER "TRANS-CAB" (SN)	NOT NECESSARY	80.00	-
1	REAR TAILGATE STICKER "6555-3333" (SN)	NOT NECESSARY	80.00	-
1	REAR BUMPER PROTECTOR (SN)	NOT NECESSARY	180.00	-
1	SET REAR BUMPER RETAINER CLIP (SN)	NOT NECESSARY	85.00	-
1	END PANEL TRIM CLIP (SN)	NOT NECESSARY	65.00	-
			1,895.00	60.00
	<u>LABOUR</u>			
	TO REMOVE AND REFIT REAR BIG AND SMALL W/SCREEN GLASS TO FACILITATE BODYWORK REPAIR.	NOT NECESSARY	300.00	-
	TO REMOVE AND REFIT INTERIOR FITTINGS, TRIMINGS, GARNISH, FITTINGS AND OTHER, TO ENABLE REPAIR.		380.00	80.00
	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME. INCLUSIVE OF THE REPAIR OF REINFORCEMENT SUB-ASSY, REAR BUMPER, PANEL SUB-ASSY, BACK DOOR, PANEL SUB-ASSY, BODY LOWER BACK, HINGE ASSY, BACK DOOR, LH AND HINGE ASSY, BACK DOOR, RH.		2,200.00	600.00
	TO TRANSFER OF REAR END PANEL FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO TRANSFER OF TAILGATE FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	180.00	-
	TO REMOVE AND REFIT ELECTRICAL WIRING, BATTERY AND OTHER NECESSARY ITEMS TO FACILITATE BODYWORK REPAIR.	NOT NECESSARY	480.00	-

Report Ref No. CS/EQI22005345/Kny3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO TRANSFER OF FENDER FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	480.00	-
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH, TO FACILITATE REPAIR.	NOT NECESSARY	380.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO RUST-PROOFING AND APPLY UNDERCOAT OF THE AFFECTED AREAS.		250.00	30.00
	TOWING FEES.	NOT NECESSARY	150.00	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		2,200.00	440.00
	TO REINSTALL REAR BUMPER PARKING SENSOR.		170.00	50.00
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
	TO TRANSFER OF LUGGAGE FLOOR PANEL FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO TRANSFER OF TIRE, RIM AND ON WHEEL BALANCING.	NOT NECESSARY	220.00	-
	TO REMOVE AND REFIT RADIATOR SUPPORT CROSS-MEMBER AND OTHER NECESSARY ITEMS TO ENABLE BODYWORK REPAIR.	NOT NECESSARY	380.00	-
	TO CONDUCT AND PERFORM A COMPREHENSIVE VEHICLE DIAGNOSTIC CHECK AND RESET VEHICLE WARNING INDICATORS.	NOT NECESSARY	380.00	-
			9,300.00	1,220.00
GRAND TOTAL			18,120.95	3,067.93
RECOMMENDED COST OF REPAIRS				3,067.93

Report Ref No. CS/EQI22005345/Kny3e2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 06/06/2022 18:51 (SGT)
Date of Accident 06/06/2022 12:05 (SGT)
Exact Location of Accident 631 Bedok Reservoir Rd, Singapore 470631
Additional Location Information 631 BEDOK RESERVOIR ROAD CAR PARK
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SHD9872A
INSURED/POLICYHOLDER
Is company? Yes
Name Of Registered Owner TRANS-CAB SERVICES PTE LTD
Company Reg No 2XXXXX878K
Email Address claims@transcab.com.sg
Mobile Phone No (Phone) +65-62876666
Alternative Phone No (Office) +65-62876666

VEHICLE PARTICULARS

Manufacturer Toyota
Model Prius
Variant -
Exact purpose for which vehicle was being used at time of accident Private hire
Are you claiming under your own insurance policy for repair to your vehicle? No - Claiming third party
Vehicle Category Taxi
Transmission Auto
CC 1767

INSURANCE COMPANY

Name of Insurance Company AXA Insurance Pte Ltd
Type of Coverage ThirdParty
Fleet Policy Yes
Policy Number VFX/P2413997
Cover Note Number /

DRIVER

Name of Driver KWONG SOH HAR @ KWONG YOKE LUN
NRIC No SXXXX785C


ACCE

042021

631 Batak
Batak Road

A. SHD832A

B. YN1430A

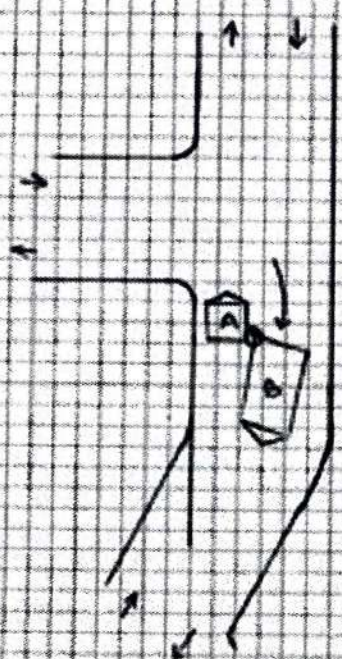

Policyholder's Signature
Date & Time:

[Signature]
Driver's Signature
(If driver is not the policyholder)
Date & Time:

VERIFIED BY AJAX MARS (ARC)
REPORTING OFFICER
WONG JUN KEAT

Reporting Centre Personnel's Signature
Name:
NIC/FIN No.:



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 9872A

INSPECTION

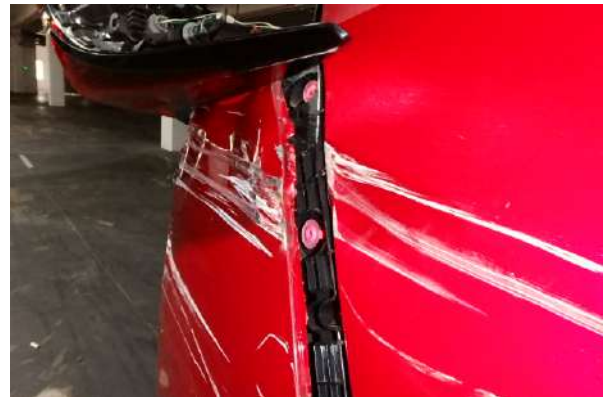




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

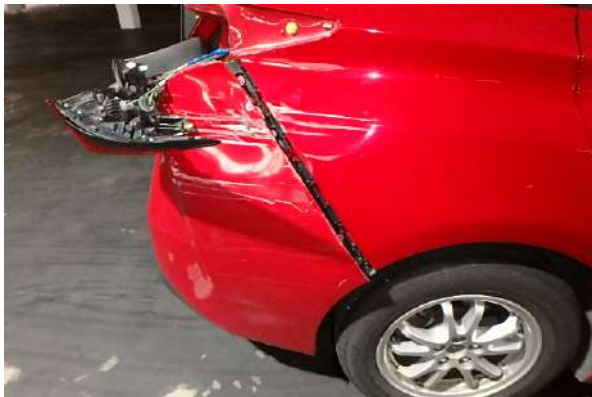



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 9872A

RE-INSPECTION

