



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2207785

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV Date 19/12/2022
Reference CC4/LPC22005679/Epa3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SMH 704G
Insured Veh. YQ 4703T
Claim No. 21/22/22/VC00/025925
Policy No. Z/21/VC00/112764
Accident Date 14/06/2022
Inspection Date 15/06/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555			Ref: CC4/LPC22005679/Epa3q2 Date: 19/12/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YQ 4703T	Veh. Inspected	SMH 704G	
Policy No.	Z/21/VC00/112764	Coverage (\$)	0.00	
Claim No.	21/22/22/VC00/025925	Excess (\$)	0.00	
Assign From	GERALD POH	Assign Date	14/06/2022	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI KONA	c.c	0	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	KMHK281GUKU020320	Colour	GREY	
Odometer	178892 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/55 R17	BRIDGESTONE	4 mm	
L/H Front Tyre	215/55 R17	BRIDGESTONE	4 mm	
R/H Rear Tyre	215/55 R17	BRIDGESTONE	4 mm	
L/H Rear Tyre	215/55 R17	BRIDGESTONE	4 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	14/06/2022	Inspection Date	15/06/2022	
Survey held at	PEGASUS ENGINEERING & TRADING PTE LTD 74 Kian Teck Road Singapore 628800			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMH 704G

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER	BROKEN	495.65	495.65
10	REAR BUMPER CLIPS @\$4.50	NECESSARY	45.00	30.00
1	REAR BUMPER TOW COVER (RHS)	BROKEN	25.20	25.20
1	REAR BUMPER UPPER CENTER MOULDING (FOLLOW CAR COLOUR)	BROKEN	296.35	296.35
1	REAR BUMPER LOWER UNDER CENTER COVER (SILVER COLOUR)	BROKEN	126.95	126.95
1	REAR BUMPER SIGNAL LAMP (RHS)	CUT	257.10	257.10
1	REAR BUMPER BLIND SPOT SENSOR (RHS)	NOT NECESSARY	980.57	-
1	REAR REINFORCEMENT	NOT NECESSARY	335.80	-
1	REAR REINFORCEMENT ARM (RHS)	NOT NECESSARY	158.00	-
2	REAR REINFORCEMENT BRACKET @\$38.00	NOT NECESSARY	76.00	-
1	REAR END PANEL	DENTED	785.60	785.60
1	REAR TAILGATE	DENTED	1,928.95	1,540.00
1	REAR TAILGATE ELECTRIC BADGE	NECESSARY	45.00	45.00
1	REAR TAILGATE 'HYUNDAI' EMBLEM	NECESSARY	55.00	55.00
1	REAR TAILGATE 'KONA' BADGE	NECESSARY	45.00	45.00
1	REAR TAILGATE OUTER MOULDING	NOT NECESSARY	245.20	-
2	REAR TAILGATE REFLECTOR @\$403.50	BROKEN / CUT	807.00	807.00
1	REAR TAILGATE INNER TRIM BOARD	BROKEN	228.80	228.80
10	REAR TAILGATE INNER TRIM BOARD CLIPS @\$5.00	NECESSARY	50.00	20.00
2	REAR TAILGATE HINGE @\$155.60	NOT NECESSARY	311.20	-
2	REAR TAILGATE ABSORBER @\$198.50	NOT NECESSARY	397.00	-
1	REAR TAILGATE 3RD BRAKE LIGHT	NOT NECESSARY	985.36	-
1	REAR TAILGATE WIPER ARM	NOT NECESSARY	218.00	-
1	REAR TAILGATE WIPER BLADE	CUT	115.00	115.00
1	REAR WINDSCREEN GLASS	BROKEN	1,380.00	1,380.00
1	REAR WINDSCREEN GLASS MOULDING	NECESSARY	198.00	198.00
2	REAR TAILLAMP @\$557.10	NOT NECESSARY	1,114.20	-
1	REAR FENDER (RHS)	TO REPAIR SEE LABOUR	1,598.00	-
1	REAR FENDER (LHS) (NPA)	NOT NECESSARY	-	-

Report Ref No. CC4/LPC22005679/Epa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR SPEAKER TOP BOARD	NOT NECESSARY	1,678.00	-
2	REAR REVERSE SENSOR @\$268.00	SHORTED	536.00	536.00
	LESS 20% DISCOUNT		-3,103.59	-1,397.33
			12,414.34	5,589.32
	<u>SPECIAL NETT ITEMS</u>			
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	80.00	40.00
1	REAR NO PLATE & CASING (SN)	NOT NECESSARY	60.00	-
1	PHV DECAL STICKER (SN)	NECESSARY	20.00	20.00
			160.00	60.00
	<u>LABOUR</u>			
	TO REMOVE & REPLACED REAR WINDSCREEN GLASS .		150.00	120.00
	TO DISCONNECT & CONNECT BACK ELECTRICAL POWER FOR FACILITATE REPAIR.		250.00	80.00
	TO REMOVE & TRANSFER REAR TAILGATE MECHANISM TO THE NEW TAILGATE .		150.00	50.00
	TO REMOVE & REPLACED REAR REVERSE SENSOR .		120.00	30.00
	TO REMOVE & RESTORE BACK INNER TRIMMINGS ,GARNISHES ,FLOOR BOARD AND SEATS FOR FACILITATE REPAIR .		120.00	50.00
	TO APPLY RUSTPROOFING /TUFFCOATING FOR REPLACED PARTS.		120.00	30.00
	TO INTERIOR CLEANING UP .		100.00	30.00
	TO SEND VEHICLE TO PASTE PHV DECAL STICKER .	NOT NECESSARY	60.00	-
	TO KNOCKING & PANEL BEATING.		2,200.00	1,200.00
	TO PUTTY & SPRAY PAINT ON THE AFFECTED AREAS .		2,000.00	800.00
			5,270.00	2,390.00
GRAND TOTAL			17,844.34	8,039.32

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			6,450.00
---	--	--	-----------------

Report Ref No. CC4/LPC22005679/Epa3q2

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMH 704G

INSPECTION

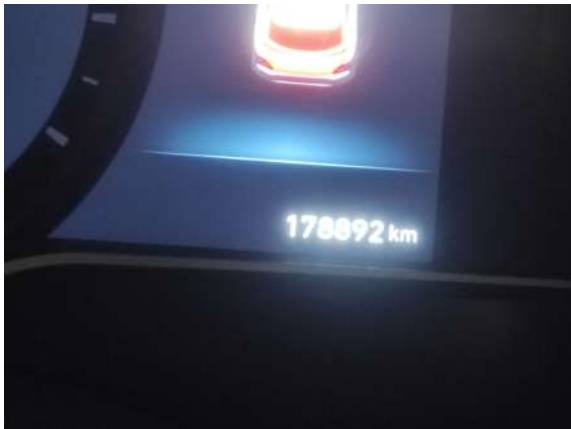



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMH 704G

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMH 704G

RE-INSPECTION

