

Case Details

Case Reference Number :

TAX/06/22/2024

Type of Repair : Accident Repair

Vehicle Registration Number :

SHB5364L

Company Type : Strides Taxi Pte Ltd

Estimation ID : EST-18494-ID

Assigned By : Taxi Claims Manager

Team

Insurance Company Name : China Taiping Insurance (Singapore) Pte Ltd

Accident Date and Time : 07/06/2022 09:05 AM

Vehicle Age(In Months) : -

Documents / Photographs

View Documents / Photographs

Total Documents: 0

Estimation Details

Spare Part's Cost Detail

BOM Type	Costing Type	Portion	Material Number	SMRT Recommendation							Surveyor Approval			
				Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Rem
Standard	Main			BUMPER REAR	1	458.60	343.95	25.00	343.95	Replace	1	343.95	Replace	ca
Standard	Main			BUMPER CLIPS	10	1.61	16.10	25.00	12.08	Replace	10	12.08	Replace	re
Standard	Main			BUMPER REINFORCEMENT REAR	1	205.70	205.70	25.00	154.27	Replace	1	154.2	Replace	bt
Standard	Main			ARM SUB-ASSY. RR BUMPER RH	1	139.60	139.60	25.00	104.70	Replace	1	104.7	Replace	bt
Standard	Main			ARM SUB-ASSY. RR BUMPER LH	1	139.60	139.60	25.00	104.70	Replace	1	104.7	Replace	bt
Standard	Main			ANTENNA,ELECTRICAL LOWER REAR	1	157.40	157.40	10.00	141.66	Replace	1	141.6	Replace	ca
Standard	Main			SENSOR REVERSE	1	180.00	180.00	0.00	180.00	Replace	1	180.0	Replace	nw
Standard	Main			BUMPER SIDE RETAINER RR/LH	1	94.80	94.80	25.00	71.10	Replace	0	0	Check	?Xn1
Standard	Main			BUMPER SIDE RETAINER RR/RH	1	94.80	94.80	25.00	71.10	Replace	0	0	Check	?Xn1
Standard	Main			BUMPER SEAL, RR LH	1	88.90	88.90	25.00	66.68	Replace	0	0	Check	?Xn1
Standard	Main			BUMPER SEAL, RR RH	1	65.70	65.70	25.00	49.28	Replace	0	0	Check	?Xn1
Standard	Main			BUMPER LIP COVER RR/LH	1	72.20	72.20	25.00	54.15	Replace	1	54.15	Replace	sea
Standard	Main			BUMPER LIP COVER RR/RH	1	118.10	118.10	25.00	88.57	Replace	1	88.57	Replace	sea
Standard	Main			BUMPER LIP REAR	1	228.90	228.90	25.00	171.68	Replace	1	171.68	Replace	sea

Total Spare Part Cost 29,225.55

Lump Sum Discount (%) 20.00

Final Spare Part Cost 22,985.59

Surveyor Total 6,028.35

Lump Sum Dis (%) 20.00

Final Sur Total 4,822.68

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Rem
Standard	Main			UNDER COVER SUB-ASSY, RR FLOOR	1	514.50	514.50	25.00	385.88	Replace	1	385.88	Replace	MS
Standard	Main			UNDER COVER SUB-ASSY, RR FLOOR	1	514.50	514.50	25.00	385.88	Replace	0	0	Check	? X11
Standard	Main			UNDER COVER RR SHIELD	1	63.90	63.90	25.00	47.93	Replace	0	0	Check	? X11
Standard	Main			END PANEL	1	602.10	602.10	25.00	451.58	Replace	1	451.58	Replace	BT
Standard	Main			END PANEL COVER, DECK TRIM HOLE	1	46.10	46.10	25.00	34.58	Replace	0	0	Check	? X11
Standard	Main			END PANEL COVER, DECK TRIM, RR	1	121.10	121.10	25.00	90.82	Replace	0	0	Check	? X11
Standard	Main			SEALANT SIKAFLEX	1	37.00	37.00	0.00	37.00	Replace	1	37.00	Replace	ne
Standard	Main			BOX, DECK FLOOR, RR	1	649.70	649.70	25.00	487.28	Replace	0	0	Check	? X11
Standard	Main			BOX, RR FLOOR, BOARD	1	679.60	679.60	25.00	509.70	Replace	1	509.70	Replace	de
Standard	Main			BOARD, RR FLOOR	1	392.30	392.30	25.00	294.23	Replace	0	0	Not Give	X11
Standard	Main			BOX, DECK FLOOR, COVER LH	1	230.10	230.10	25.00	172.58	Replace	0	0	Not Give	X11
Standard	Main			BOX, DECK FLOOR, LH	1	196.80	196.80	25.00	147.60	Replace	0	0	Not Give	X11
Standard	Main			SPACER, RR FLOOR	1	130.60	130.60	25.00	97.95	Replace	0	0	Not Give	X11
Standard	Main			BOARD ASSY, RR RH	1	379.20	379.20	25.00	284.40	Replace	0	0	Not Give	X11
Standard	Main			PANEL ASSY, DECK LH	1	307.00	307.00	25.00	230.25	Replace	0	0	Not Give	X11
Standard	Main			PANEL ASSY, DECK RH	1	307.00	307.00	25.00	230.25	Replace	0	0	Not Give	X11
Standard	Main			COVER ASSY, TONNEAU	1	602.10	602.10	25.00	451.58	Replace	0	0	Not Give	X11
Standard	Main			SPARE TYRE PANEL	1	667.70	667.70	25.00	500.78	Replace	1	0	Repair	R
Standard	Main			CUSHION, SPARE WHEEL	1	230.80	230.80	25.00	173.10	Replace	0	0	Not Give	X11
Standard	Main			CARRIER, SPARE	1	19.70	19.70	25.00	14.77	Replace	0	0	Not Give	X11
Standard	Main			PROTECTOR, SPARE	1	143.70	143.70	25.00	107.77	Replace	0	0	Not Give	X11
Standard	Main			MEMBER SUB-ASSY, RR LH	1	174.10	174.10	25.00	130.58	Replace	0	0	Not Give	X11
Standard	Main			MEMBER SUB-ASSY, RR RH	1	174.10	174.10	25.00	130.58	Replace	0	0	Not Give	X11
Standard	Main			FLOOR PANEL RR/RH	1	209.90	209.90	25.00	157.43	Replace	0	0	Not Give	X11

Total Spare Part Cost 29,225.55

Surveyor Total 6,028.35

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20.00

Final Spare Part Cost 22,985.59

Final Sur Total 4,822.68

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Rem
Standard	Main			FLOOR PANEL RR/LH	1	102.00	102.00	25.00	76.50	Replace	0	0	Not Give	X11
Standard	Main			MEMBER SUB-ASSY, REAR FLOOR CROSS NO.1	1	436.40	436.40	25.00	327.30	Replace	0	0	Not Give	X11
Standard	Main			MEMBER SUB-ASSY, REAR FLOOR CROSS NO.2	1	655.70	655.70	25.00	491.78	Replace	0	0	Not Give	X11
Standard	Main			REINFORCEMENT, RR	2	34.60	69.20	25.00	51.90	Replace	0	0	Not Give	X11
Standard	Main			PANEL SUB-ASSY, QTR	1	588.40	588.40	25.00	441.30	Replace	0	0	Not Give	X11
Standard	Main			PANEL SUB-ASSY, QTR WHEEL HOUSE	1	588.40	588.40	25.00	441.30	Replace	0	0	Not Give	X11
Standard	Main			DUCT ASSY, QUARTER	1	70.40	70.40	25.00	52.80	Replace	0	0	Not Give	X11
Standard	Main			WIRE, FLOOR	1	1,675.00	1,675.00	10.00	1,507.50	Replace	0	0	Not Give	X11
Standard	Main			WIRE, FLOOR, NO.2	1	1,305.40	1,305.40	10.00	1,174.86	Replace	0	0	Not Give	X11
Standard	Main			WIRE, ENGINE, NO.3	1	74.00	74.00	10.00	66.60	Replace	0	0	Not Give	X11
Standard	Main			BATTERY ASSY, HV	1	5,544.40	5,544.40	10.00	4,989.96	Replace	0	0	Not Give	X11
Standard	Main			BATTERY	1	278.00	278.00	10.00	250.20	Replace	0	0	Not Give	X11
Standard	Main			TERMINAL, JUNCTION	1	51.90	51.90	25.00	38.93	Replace	0	0	Not Give	X11
Standard	Main			BATTERY CLAMP	1	16.10	16.10	25.00	12.08	Replace	0	0	Not Give	X11
Standard	Main			BATTERY TRAY	1	42.80	42.80	25.00	32.10	Replace	0	0	Not Give	X11
Standard	Main			WIRE, FRAME	1	1,680.90	1,680.90	10.00	1,512.81	Replace	0	0	Not Give	X11
Standard	Main			TAILGATE ASY	1	1,007.90	1,007.90	25.00	755.93	Replace	1	755.92	Replace	✓
Standard	Main			TAILGATE DOOR GLASS MOULDING, RH	1	29.40	29.40	25.00	22.05	Replace	1	22.05	Replace	✓
Standard	Main			TAILGATE DOOR GLASS MOULDING, LH	1	29.40	22.05	25.00	22.05	Replace	1	22.05	Replace	✓
Standard	Main			TAILGATE DOOR GLASS	1	1,090.90	1,090.90	25.00	818.18	Replace	0	0	Not Give	X11
Standard	Main			MOULDING BACK WINDOW, LOWER NO.1	1	29.40	29.40	25.00	22.05	Replace	0	0	Check	? X11
Standard	Main			MOULDING, BACK WINDOW, LOWER NO.2	1	29.40	29.40	25.00	22.05	Replace	0	0	Check	? X11
Standard	Main			TAILGATE LOWER WINDOW GLASS	1	721.30	721.30	25.00	540.97	Replace	0	0	Not Give	X11

Total Spare Part Cost 29,225.55

Lump Sum Discount (%) 20.00

Final Spare Part Cost 22,985.59

Surveyor Total 6,028.35

Lump Sum Dis (%) 20.00

Final Sur Total 4,822.68

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Rem
Standard	Main			TAIL GATE DAM, BACK DOOR GLASS UPPER ADHESIVE	2	28.90	57.80	25.00	43.35	Replace	0	0	Not Give	Xm
Standard	Main			DAM, BACK DOOR GLASS ADHESIVE, NO.2	1	17.40	17.40	25.00	13.05	Replace	0	0	Not Give	Xm
Standard	Main			TROUGH, BACK DOOR	1	110.90	110.90	25.00	83.18	Replace	0	0	Not Give	Xm
Standard	Main			SEALANT W/SCREEN (3PCS)	3	37.00	111.00	0.00	111.00	Replace	3	111.00	Replace	nm
Standard	Main			ARM, RR WIPER	1	84.70	84.70	25.00	63.53	Replace	0	0	Not Give	Xm
Standard	Main			MOTOR ASSY, RR WIPER	1	734.60	734.60	10.00	661.14	Replace	0	0	Not Give	Xm
Standard	Main			BLADE ASSY, REAR WIPER	1	55.00	55.00	25.00	41.25	Replace	0	0	Not Give	Xm
Standard	Main			WIRE, BACK DOOR, NO.1	1	582.40	582.40	10.00	524.16	Replace	0	0	Not Give	Xm
Standard	Main			TAILGATE DOOR HINGE LH/RH	2	58.30	116.60	25.00	87.45	Replace	0	0	Not Give	Xm
Standard	Main			TAILGATE DOOR STAY LH	1	241.50	241.50	25.00	181.13	Replace	0	0	Not Give	Xm
Standard	Main			TAILGATE DOOR STAY RH	1	241.50	241.50	25.00	181.13	Replace	0	0	Not Give	Xm
Standard	Main			TAILGATE DOOR LOCK	1	444.10	444.10	25.00	333.08	Replace	1	333.08	Replace	bf
Standard	Main			TAILGATE LOCK, COVER	1	15.70	15.70	25.00	11.77	Replace	1	11.77	Replace	sol
Standard	Main			STRIKER, BACK DOOR	1	48.90	48.90	25.00	36.68	Replace	0	0	Not Give	Xm
Standard	Main			TAILGATE DOOR WEATHER STRIP	1	353.40	353.40	25.00	265.05	Replace	1	265.05	Replace	rec
Standard	Main			TAILGATE TRIM, LH	1	85.90	85.90	25.00	64.43	Replace	0	0	Not Give	Xm
Standard	Main			TAILGATE TRIM, RH	1	88.30	88.30	25.00	66.23	Replace	0	0	Not Give	Xm
Standard	Main			TAILGATE TRIM, LOWER	1	180.70	180.70	25.00	135.52	Replace	0	0	Not Give	Xm
Standard	Main			TAILGATE TRIM, UPPER	1	49.60	49.60	25.00	37.20	Replace	0	0	Not Give	Xm
Standard	Main			TAILGATE, BAORD ASSY	1	246.90	246.90	25.00	185.18	Replace	1	185.18	Replace	bf
Standard	Main			TAILGATE OUTSIDE GARNISH	1	504.90	504.90	25.00	378.67	Replace	0	0	Check	?Xm
Standard	Main			EMBLEM REAR	1	60.30	60.30	25.00	45.22	Replace	0	0	Not Give	Xm
Standard	Main			LICENSE PLATE LAMP	2	35.70	71.40	25.00	53.55	Replace	0	0	Not Give	Xm

Total Spare Part Cost 29,225.55

Surveyor Total 6,028.35

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20.00

Final Spare Part Cost 22,985.59

Final Sur Total 4,822.68

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Rem
Standard	Main			CAMERA ASSY, TELEVISION, RR	1	1,436.60	1,436.60	10.00	1,292.94	Replace	0	0	Not Give	Xm
Standard	Main			NAME PLATE (HYBRID)	1	51.90	51.90	25.00	38.93	Replace	1	38.92	Replace	ner
Standard	Main			NAME PLATE (PRUIS)	1	60.80	60.80	25.00	45.60	Replace	0	0	Check	?Xm
Standard	Main			NAME PLATE (TOYOTA)	1	51.90	51.90	25.00	38.93	Replace	0	0	Check	?Xm
Standard	Main			NUMBER PLATE	1	15.00	15.00	0.00	15.00	Replace	1	15.00	Replace	bf
Standard	Main			NUMBER PLATE FRAME	1	12.00	12.00	0.00	12.00	Replace	1	12.00	Replace	cut
Standard	Main			STRIDES LOGO	1	7.80	7.80	0.00	7.80	Replace	0	0	Check	?Xm
Standard	Main			STICKER DECAL 65558888	1	21.60	21.60	0.00	21.60	Replace	0	0	Check	?Xm
Standard	Main			3RD BRAKE LAMP	1	231.30	231.30	10.00	208.17	Replace	0	0	Not Give	Xm
Standard	Main			SPOILER REAR	1	953.70	953.70	25.00	715.28	Replace	0	0	Not Give	Xm
Standard	Main			FENDER RR/RH	1	766.80	766.80	25.00	575.10	Replace	0	0	Not Give	Xm
Standard	Main			STRIDES LOGO	1	7.80	7.80	0.00	7.80	Replace	0	0	Not Give	Xm
Standard	Main			STICKER DECAL 65558888	1	21.60	21.60	0.00	21.60	Replace	0	0	Not Give	Xm
Standard	Main			FENDER LINE RR/RH	1	141.30	141.30	25.00	105.98	Replace	0	0	Not Give	Xm
Standard	Main			TAIL LAMP BRACKET, RH	1	30.70	30.70	25.00	23.03	Replace	0	0	Check	?Xm
Standard	Main			TAIL LAMP RH	1	557.80	557.80	25.00	418.35	Replace	1	418.35	Replace	con
Standard	Main			FENDER RR/LH	1	766.80	766.80	25.00	575.10	Replace	1	575.10	Replace	huc
Standard	Main			STRIDES LOGO	1	7.80	7.80	0.00	7.80	Replace	1	7.80	Replace	ner
Standard	Main			STICKER DECAL 65558888	1	21.60	21.60	0.00	21.60	Replace	1	21.60	Replace	ner
Standard	Main			STICKER PETROL ONLY	1	7.80	7.80	0.00	7.80	Replace	0	0	Not Give	Xm
Standard	Main			FENDER LINER R/LH	1	141.30	141.30	25.00	105.98	Replace	0	0	Not Give	Xm
Standard	Main			TAIL LAMP BRACKET, LH	1	30.70	30.70	25.00	23.03	Replace	0	0	Check	?Xm
Standard	Main			TAIL LAMP LH	1	548.40	548.40	10.00	493.56	Replace	1	493.56	Replace	con
Total Spare Part Cost									29,225.55	Surveyor Total 6,028.35				
Lump Sum Discount (%)									20.00	Lump Sum Dis (%) 20.00				
Final Spare Part Cost									22,985.59	Final Sur Total 4,822.68				

Labour's Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO REPAIR REAR PORTION	1,690.00	1,000.00	
Total:			1,690.00	1,000.00 + 300 = 1300	

Spray Cost Detail


S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO RESPRAY REAR BUMPER	378.00	200.00	
2	Main	TO RESPRAY FLOOR CORNER PANEL LH	180.00	0.00 X11	
3	Main	TO RESPRAY FLOOR CORNER PANEL RH	180.00	0.00 X11	
4	Main	TO RESPRAY REAR FLOOR SIDE PANEL LH	180.00	0.00 X11	
5	Main	TO RESPRAY REAR FLOOR SIDE PANEL RH	180.00	0.00 X11	
6	Main	TO RESPRAY REAR SPARE TYRE PANEL	180.00	100.00	
7	Main	TO RESPRAY REAR SPOILER	180.00	0.00 X11	
8	Main	TO RESPRAY TAILGATE OUTSIDE GARNISH	180.00	0.00 X11	
9	Main	TO RESPRAY TAIL GATE	378.00	200.00	
10	Main	TO RESPRAY REAR FENDER RH	378.00	0.00 X11	
11	Main	TO RESPRAY REAR FENDER LH	378.00	200.00	
12	Main	TO RESPRAY REAR PANEL	180.00	100.00 3	
Total:			2,952.00	800.00 + 300 = 1100	

Other Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TOWING CHARGE	56.00	0.00 7, X11	provide receipt
2	Main	TO CHECK WIRING AND SYSTEM FUNCTION	120.00	40.00	
3	Main	TO APPLY RUST-PROOFING ON AFFECTED AREA	200.00	80.00	
4	Main	TO TRANSFER REAR TAILGATE MECHANISM	120.00	60.00	
Total:			1,366.00	340.00	

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
5	Main	TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	40.00	
6	Main	TO REMOVE AND REFIX REAR WINDSCREEN	240.00	120.00	
7	Main	TO REMOVE AND REFIT BATTERY ASSY HV	250.00	0.00	Xm
8	Main	TO WASH AND VACUUM	60.00	0.00	Xm
9	Main	TO REPLACE SUNDRY PARTS	200.00	0.00	Xm
Total:			1,366.00	340.00	+150 = 496

Summary

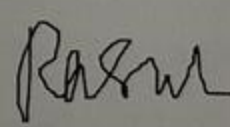	Estimator Assessment(\$)	Surveyor Assessment(\$)
Total Spare Part Detail	22,985.59	4,822.68
Total Labour Cost	1,690.00	1,000.00
Total Spray Painting	2,952.00	800.00
Other	1,366.00	340.00
Overall Total	28,993.59	6,962.68
Lump Sum Repair Option	☐	☒
Lump Sum Total	29,000.00	6,950.00
Surveyor Approved Amount		6,950.00
No of Repair Days*	10	8 + 3 = 11 days
Remarks		resurvey after repair photo , need NBV.
Surveyor Name		Rasul
Signature		
Survey Date		

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Save

Clear

Contractor:	WEGA ENGINEERING PTE LTD		
Accident Case Number	TAX / 06 / 22 / 2024	Date of Collection	14 / 6 / 22
Vehicle No	SHB 5364 L	Date of Request	20 / 6 / 22
Vehicle Model	TOYOTA PRIUS	Number of Days to Extend	3 DAYS 3days

REQUEST FOR SUPPLYMENT PARTS

S/N	Number photos	Part Description	Quantity	Unit Price
	0248, 49, 50	Bumper side Retainer RR LH	cra /	\$ 94.50
	0251, 52, 53	Bumper Side Retainer RR RH	cra /	\$ 94.50
	0258, 59, 60, 61	Box Deck Floor RR	de /	\$ 649.70
	0262, 63, 64, 65, 66	Panel Assy Deck LH	de /	\$ 307.00
	0267, 68, 69, 70, 71 0272	Spare Tyre Panel buc /		\$ 667.70
	0282, 83, 84, 85	Battery Assy HV bt /		\$ 5544.40
	0279, 80, 81	Rear Floor Side Pane LH repair		\$ 95.80

<<<Please submit photographs for damaged parts>>>

(Name) CHIA

(Position) ADVISOR

I solemnly and sincerely declare that:- Supplementary Parts are raised for replacement for the aforesaid vehicle.

CHIA

Signature of person making this declaration

(To be signed in front of an authorised witness)

I acknowledge that this declaration is true and correct, and I make it with the understanding and belief that a person who makes a false declaration is liable to the damages of perjury.

Acknowledge By	ARC Executive / Supervisor / SA	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form 22 / PO / WOC / Reservation / Number
Photo Submitted		Date of submission

For SMRT Staff

Contractor:	WEGA ENGINEERING PTE LTD		
Accident Case Number	TAX/06/22/2024	Date of Collection	14/6/22
Vehicle No	SHB 5364 L	Date of Request	20/6/22
Vehicle Model	TOYOTA PRIUS	Number of Days to Extend	

REQUEST FOR SUPPLYMENT PARTS


S/N	Number photos	Part Description	Quantity	Unit Price
	0273174,75	To Repair Rear Tail Lamp Panel LH		\$ 150.00
	0276177,78	To Repair Rear Tail Lamp Panel RH		\$ 150.00
		To Respray Rear Tail Lamp Panel LH		\$ 150.00
		To Respray Rear Tail Lamp Panel RH		\$ 150.00
		To Respray Rear Floor Side Panel LH		\$ 150.00
		To Remove & Refit Battery Assy HV		\$ 250.00
		To Remove & Replace Spare Tyre Panel		\$ 450.00

<<<Please submit photographs for damaged parts>>>

I (Name) CHIA

(Position) ADVISOR

I do solemnly and sincerely declare that: Supplementary Parts are raised for replacement for the aforesaid vehicle.



Signature of person making this declaration

(To be signed in front of an authorised witness)

I acknowledge that this declaration is true and correct, and I make it with the understanding and belief that a person who makes a false declaration is liable to the damages of perjury.

Acknowledge By	ARC Executive / Supervisor / SA	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form22 / PO / WOC / Reservation / Number
Photo Submitted		Date of submission

For SMRT Staff