



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2302307

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 14/04/2023
Reference CC6/CTI22005807/Aya3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SBY 5511D
Insured Veh. YJ 9044R
Claim No. SNM22D204196/C02
Policy No. DMCVSNW00036812203
Accident Date 07/06/2022
Inspection Date 08/06/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22005807/Aya3q2 Date: 14/04/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YJ 9044R	Veh. Inspected	SBY 5511D	
Policy No.	DMCVSNW00036812203	Coverage (\$)	0.00	
Claim No.	SNM22D204196/C02	Excess (\$)	0.00	
Assign From		Assign Date	08/06/2022	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA ESTIMA	c.c	2362	
Engine No.	HIDDEN	Year of Reg.	2007	
Chassis No.	ACR500052647	Colour	BLACK	
Odometer	219893 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/55 R17	MICHELIN	6 mm	
L/H Front Tyre	215/55 R17	MICHELIN	6 mm	
R/H Rear Tyre	215/55 R17	MICHELIN	6 mm	
L/H Rear Tyre	215/55 R17	MICHELIN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY & UNDERCARRIAGE. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	07/06/2022	Inspection Date	08/06/2022	
Survey held at	YSK AUTO WORKSHOP 1 KAKI BUKIT AVE 6 @ AUTOBAY #01-71 SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SBY 5511D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BUMPER	DEFORMED	845.10	845.10
1	FRONT BUMPER SIDE HOLDER LH	NECESSARY	68.50	68.50
1	FRONT BUMPER FOG LAMP LH	CRACKED	287.40	287.40
1	FRONT BUMPER FOG LAMP COVER LH	NOT NECESSARY	127.20	-
1	FRONT BUMPER SPONGE	NOT NECESSARY	126.80	-
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	471.90	-
1	HEADLAMP LH	CRACKED	1,912.70	1,912.70
1	FRONT LH FENDER	DENTED	685.90	685.90
1	FRONT LH FENDER PROTECTOR	NOT NECESSARY	184.50	-
1	FRONT LH FENDER INNER SHIELD	TORN	220.70	220.70
1	FRONT LH LOWER ARM	BENT	422.80	422.80
1	FRONT LH SHOCK ABSORBER	NOT NECESSARY	372.50	-
1	FRONT LH KNUCKLE ARM	DAMAGED	559.90	559.80
1	FRONT LH WHEEL HUB C/W BEARING	DAMAGED	412.90	412.90
1	FRONT LH ANTI ROLL BAR LINKAGE	NOT NECESSARY	165.70	-
1	STEERING RACK AND PINION	NOT NECESSARY	1,757.90	-
	LESS 25% DISCOUNT		-	-1,353.95
			8,622.40	4,061.85
<u>SPECIAL NETT ITEMS</u>				
1	FRONT BUMPER CLIPS (SN)	NECESSARY	30.00	30.00
1	FRONT LH FENDER INNER SHIELD CLIPS (SN)	NECESSARY	30.00	30.00
1	FRONT LH WHEEL RIM (SN)	CUT	800.00	580.00
1	FRONT LH TYRE (SN)	PUNCTURE	380.00	200.00
			1,240.00	840.00
<u>LABOUR</u>				
	PANEL BEATING .		700.00	500.00
	SPRAY PAINTING.		700.00	450.00
	WIRING.		50.00	30.00
	TO SPRAY TUFF COAT.		150.00	30.00
	TO DISMANTLE FRONT UNDERCARRIAGE.		400.00	200.00

Report Ref No. CC6/CTI22005807/Aya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO PERFORM WHEEL ALIGNMENT.		150.00	80.00
	TOWING FEES.		60.00	60.00
			2,210.00	1,350.00
GRAND TOTAL			12,072.40	6,251.85
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				5,000.00

Report Ref No. CC6/CTI22005807/Aya3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SBY 5511D

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

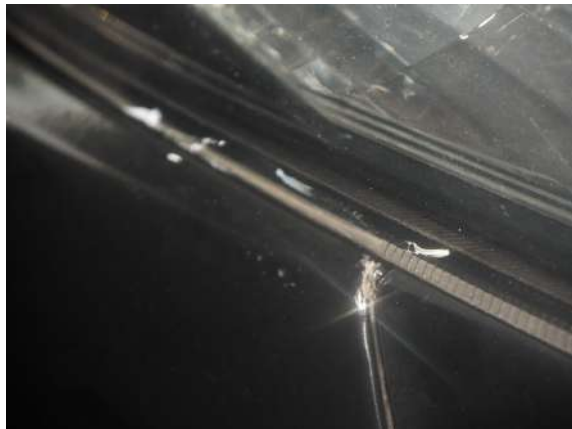



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SBY 5511D

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

