

## ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: 63J2341B

at Workshop m/s J.1 Area

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. \_\_\_\_\_

Claims No. \_\_\_\_\_

Sum Insured: \_\_\_\_\_

Excess: 2 500

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: 458k.

IDAC Accident Rpt: \_\_\_\_\_

Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_

Consistent? : Yes or No

Est. Repairs: 7

days

Res.: Yes or No

Lum Sum: \_\_\_\_\_

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

C3994D

Vehicle: IN / OUT

Date: \_\_\_\_\_

Person Contacted: LTA 16412

Veh No: 63J2341B

Yr Regn: 25/02/19

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or (M) TFR 87

Make: 15000 pick-up

c.c

1898

Colour: white

A/C:

Insured / Std / NI / NA

Sp. Reading: 41763

T/Radio:

Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: MPATFR 87 JTT001413

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 215/70 R15

R: \_\_\_\_\_

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. 6

mm

R/Bal. 6

mm

L/Bal. 6

mm

L/Bal. 6

mm

D.O.A. 11/06/22

D.O.I. 20/06/22

Survey held at \_\_\_\_\_

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

L-f O/S.

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Rep 8hrs

2/5 = cost less 20% + labour = 45.87000

23/5/22 insured Jan, 45.87000  
(Red, 1427.21, 17%)

Date/Time, File Pass to?

☐

Preli. Report

1) 14/10/22

☐

Final Report

Date/Time, File Return to?

2) \_\_\_\_\_

Days Of Repair: 7

Resurvey No. of Trip: 2

Survey Fee: \_\_\_\_\_

Transportation: \_\_\_\_\_

Add Fee: ☐

Site Insp (\$

) S + RS, SI

☐

Interview (\$

) Photos

☐

Tech. Invs (\$

) Others

☐

Weekend (\$

)

Report Format :

Lum Sum / I.B.I: (\$ 7000 )

TOTAL

6426 8788

> Back to OneMotoring

## Enquire PARF/COE Rebate for Registered Vehicle

### Vehicle Owner Particulars

Owner ID Type:	Company
Owner ID:	994D

### Vehicle Details

Vehicle No.:	GBJ2341B
Vehicle to be Exported:	No
Intended Deregistration Date:	20 Jun 2022
Vehicle Make:	ISUZU
Vehicle Model:	TFR87JSR
Primary Colour:	White
Manufacturing Year:	2018
Engine No.:	TD0896
Chassis No.:	MPATFR87JJT001413
Maximum Power Output:	-
Open Market Value:	\$27,645.00
Original Registration Date:	25 Feb 2019
First Registration Date:	25 Feb 2019
Transfer Count:	0
Actual ARF Paid:	\$1,383.00

### Intended PARF Rebate Details

PARF Eligibility:	No
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00

### Intended COE Rebate Details

COE Expiry Date:	24 Feb 2029
COE Category:	C - Goods Vehicle & Bus
COE Period(Years):	10
PQP Paid:	\$24,575.00
COE Rebate Amount:	\$16,412.00
<b>Total Rebate Amount:</b>	<b>\$16,412.00</b>

The information contained herein is correct as at 20 Jun 2022

OK

**Post an Advertisement**  
Sell it yourself! Advertise it at just  
**\$68 until it's SOLD!**

Post an Ad Advertiser Login Ways of Selling

Mercedes Cla180, Jan 2015, 1595 CC, Purplish Black.



Genuine Low Mileage, Well Maintained, Lady Owner, Low Fuel Consumption. C&C Unit  
Direct Owner StarAd

**PRIME MOTOR & LEASING**  
(CHENG YONG CREDIT ENTERPRISES PTE LTD. GROUP OF COMPANIES)  
With over 200 units of vehicles to choose from, ranging from all European to Japanese Makes.

Sort by Date Posted 20 results/page

3 vehicles



Isuzu TFR87

Any Category

Advanced Search



Search

Make	Model	Price	Depreciation	Reg Date	Eng Cap	Mileage	Veh Type	Status
Search Selection	Isuzu TFR87	Any	Any	Any	Any	Any	Any	Available



**Isuzu TFR87**

**\$71,800**

\$9,310 /yr

05-Mar-2020

1,898 cc

-

Truck

Available

**Fuel Type:** Diesel

Cheapest In The Market! Super Low Mileage, Still Under Agent Warranty, Agent Maintenance Since Day One, Flexible Loan Package Available, Door Step Viewing Available. Call Our Friendly Salesman TO Arrange Viewing Before Its Gone!

Think One Automobile & Trading

Posted: 18-Jun-2022

PREMIUM AD



**Isuzu TFR87**

**\$52,888**

\$9,070 /yr

19-Apr-2018

1,898 cc

54,710 km

Truck

Available

**Fuel Type:** Diesel

\$0 Downpayment With \$987 Monthly. Easy Approval For 100% Loan From Bank Or In House Financing Available And High Trade In Too! Contact Us For A No Obligation Viewing!

Posted: 05-Jun-2022

PREMIUM AD



**Isuzu TFR87J Double-Cab**

**\$119,800**

\$14,000 /yr

08-Jan-2021

1,898 cc

20,000 km

Truck

Available

**Fuel Type:** Diesel

Cheap HDB parking at \$90 only and can enter multistory carpark. \$30,000 cheaper than new. Almost new condition double cab. 1 owner. Lightly used with low mileage clocked. Comes with carry boy cover and interior bed lining worth \$5000. Can register under personal or C...

Posted: 19-May-2022

Save this search criteria, to get email alerts whenever a match is found.

Make	Model	Price	Depreciation	Reg Date	Eng Cap	Mileage	Veh Type	Status
------	-------	-------	--------------	----------	---------	---------	----------	--------

For old advertisements, view Expired ads

20 results/page

## Buy / Rent Cars

New Cars For Sale

Used Cars For Sale

Cars For Rent

## Sell Your Car

Post an Ad

Sell by Bidding

Sell by Consignment

## Aftermarket

Workshop Directory

Aftermarket Products

Bidded Carplates

Carpark Rates

## Articles

Car Reviews

Car Advice

Car News

Car Features

## General

About Us

Contact Us

Careers

Site Map

## Resources

COE Prices

Car Loan Calculators

Car Forum

Car Insurance

Car Valuation

COE Renewal

Used Car Warranty

Bidded Carplates

Carpark Rates

## Follow sgCarMart.com



**Jin Auto Services Pte Ltd**  
**#01-410/412, 14 Defu Lane 10**  
**539195**

**Insurer Reference: GBJ2341B (ISUZU - TFR87JSR)**  
**Repairer Reference: GBJ2341B (ISUZU - TFR87JSR)**  
**Date calculated: 17/06/2022 11:22 AM**

**Full Report**

**Registration: GBJ2341B**

**Printed: 17/06/2022 11:31 AM**

**Summary Information**

<b>Claim</b>			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	JOUIS SEOW	Currency:	SGD
Claim Reference:	GBJ2341B (ISUZU - TFR87JSR)	Date of Incident:	11/06/22
Estimated Repair Time:	10	Hire Car Start:	
Actual Repair Days:		Hire Car End:	

**Vehicle Details**

<b>Vehicle</b>			
Manufacturer:	ISUZU		
Model:	KB/D-MAX(RT)		
Sub Model:	BASE MODEL		
Model Sheet Number:	37 63 01		
Registration:	GBJ2341B		
VIN number:	MPATFR87JJT001413		
Odometer:	41763		
<b>Model Specs</b>			
FOG LAMPS	2.5 LTR 58 KW	SINGLE CAB	TWO COAT METALLIC
PREPARE OFF VEHICLE			

*Not Authorized  
new  
array  
20/06/22  
p/p \$  
7 days.  
take photo before painting  
including parts.  
Excess \$ 800*

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
Signature:  
Date:

**Material Cost - Paint**

New Part Painting
New Part Painting - Plastic K1R
Repair Painting
Surface-/Blend Paint
Material-constant Metal Preparation
Material-constant Plastic
<b>Total</b>

<b>Price SGD</b>
<b>108.88</b>
<b>50.68</b>
<b>73.60</b>
<b>12.45</b>
<b>28.60</b>
<b>9.00</b>
<b>283.21</b>

**Spare Parts**

				prices as at 2001-01-01	
Code	Description	Part Number	Part Source		Price SGD
0257	FRONT NUMBER PLATE	KNPL3	Original	But 20 S/N	35.00
0281	FRONT BUMPER	8981934472	Original	Dis	500.00
0286	R/R FOG LAMP COVER	8980998241	Original	320	80.00
0316	R/F INN BUMPER REINF	8980742585	Original	But	55.00
0320	R/F INN BUMPER BRKT	8980873920	Original	Dis	55.00
0326	R/F LWR INN BRACKET	8981396940	Original	Dis	55.00
0328	RIGHT RETAINER	8980504620	Original	CR	55.00
0340	FRT BUMPER SUPPORT	8975471070	Original	Dis	550.00
0341	FRONT BUMPER SUPPORT	8980873901	Original	Dis 220	180.00
0410	GRILLE	8981938670	Original	CR	200.00
0415	GRILLE BACKING	8981938710	Original	CR 350	185.00
0471	BONNET	8981938170	Original	But 520	490.00
0475	L/BONNET HINGE	8981041002	Original	But	40.00
0476	R/BONNET HINGE	8981040992	Original	But	40.00
0562	RIGHT HEADLAMP ASSY	8981253916	Original	320	480.00
0638	R/F FOG LAMP	8981696800	Original	NZ X	150.00
0742	R/F WING	8981032061	Original	But	400.00
0842	R/F WHEELHOUSE COVER	8980772524	Original	700 180	80.00
0920	FRONT PANEL	8981032020	Original	But 650	200.00
1326	R/COWL GRILLE BRKT	8981339816	Original	CR	60.00
8374	AIR HOSE	8980899702	Original	But	90.00
8391	AIR FILTER ASSY	93618630	Original	CR	490.00
8403	INTAKE CHANNEL	8980655501	Original	Dis	190.00
f: OEM Parts	<b>Savings</b>				0.00
n: Non-OEM Parts	<b>Subtotal</b>				4,660.00
u: Used parts	<b>Total</b>				4,660.00

## Final Calculation

	SGD	SGD
<b>Parts</b>	4,660.00	
<b>Total Parts</b>		<b>4,660.00</b>
<b>Labour Time Base 10 WU/h</b>		
Total 182.0 WU X 42.00 SGD/h	764.40	
<b>Total of Labour</b>		<b>764.40</b>
<b>Paint Work Time Base 10 WU/h</b>		
Labour Cost 143.0 WU X 42.00 SGD/h	600.60	
Material Cost	283.21	
<b>Total Paint Including Material</b>		<b>883.81</b>
<b>Repair Cost Excludes GST</b>		<b>6,308.21</b>
GST (+7.00%)		<b>441.57</b>
<b>Repair Cost Included GST</b>		<b>6,749.78</b>

### Comments

\* - USER SUPPLIED DATA  
NN - NO MANUFACTURERS CODE EXISTS  
) - WU PARTIAL INCL IN OTHER POSITIONS

### Assessment Note

No assessment notes entered.

## Vehicle Condition


### Vehicle Status

Pre-Accident Damage:

Date of Inspection:

### Damage Areas

All ☐  
Underbody ☐

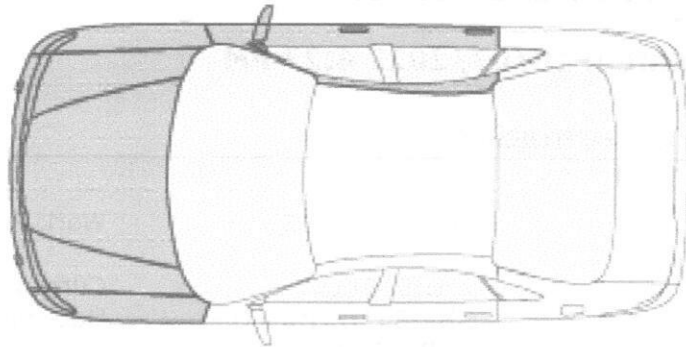

## Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	-------------------------	------------------------	------------------------	-------------------------	-------------------------	--------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

## Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	DRAIN + REFILL COOLANT		5.0	21.00
B 0218)	R + R FRONT BUMPER CARRIER		8.0	33.60
B 0048	R + R FRONT BUMPER		5.0	21.00
NO NUMBER	R + R FRONT BUMPER ATTACHED PARTS (BUMPER REMOVED)		10.0	42.00
	INCLUDES: REQUIRED ATTACHED PARTS REMOVE AND REFIT			
NO NUMBER	R + R BONNET		4.0	16.80
NO NUMBER	RENEW BONNET (BONNET REMOVED)		2.0	8.40
	INCLUDES: BONNET INSULATION, WASHER JETS AND REQUIRED ATTACHED PARTS R + R.			
NO NUMBER	R + R FRONT COWL		2.0	8.40
B 1717)	R + R BONNET HINGES		3.0	12.60
NO NUMBER	RENEW COMPLETE FRONT PANEL (BOTH WINGS AND FRONT BUMPER REMOVED)		55.0	231.00
	INCLUDES: R + R ALL NECESSARY ATTACHED			



Code	Description	WU	Price SGD
	PARTS		
J 3100	DOES NOT INCLUDE: R + R RADIATOR	10.0	42.00
NO NUMBER	R + R RADIATOR	10.0	42.00
NO NUMBER	R + R L/F WING		
	INCLUDES: R + R HEADLAMP AND WHEELARCH TRIM	10.0	42.00
NO NUMBER	R + R R/F WING		
	INCLUDES: R + R HEADLAMP AND WHEELARCH TRIM	5.0	21.00
NO NUMBER	R + R ATTACHED PARTS OF THE R/F WING	5.0	21.00
NO NUMBER	L/F FRAME RUBBER BUSH REMOVE AND REFIT	1.0	4.20
NO NUMBER	R + R AIR FILTER HOUSING	2.0	8.40
NO NUMBER	ADJUST HEADLAMPS	<del>30.0*</del>	<del>126.00</del>
0741	L/F WING REPAIR	<del>15.0*</del>	<del>63.00</del>
1482	RIGHT FRONT DOOR REPAIR	20.0*	84.00
2082	R/SIDE FRAME REPAIR		
	<b>Labour Cost</b>	Hrs	WU
	<b>Panel / Mechanical Labour</b>	20.20	202.0
			848.40
	<b>Total of Labour</b>		848.40

## Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	FRT BUMPER SUPPORT SURFACE PAINT	4.0
	BONNET NEW PART PAINTING	25.0
	R/F WING NEW PART PAINTING	12.0
	FRONT PANEL SURFACE PAINT	6.0
	FRONT BUMPER NEW PART PAINT K1R	11.0
	RIGHT FRONT DOOR REPAIR PAINTING <50%	18.0
	L/F WING REPAIR PAINTING >50%	18.0
	R/SIDE FRAME REPAIR PAINTING >50%	19.0

## Paint Material Per Part

Code	Description	Price SGD
	FRT BUMPER SUPPORT SURFACE PAINT	2.49
0340	BONNET NEW PART PAINTING	82.56
0471	R/F WING NEW PART PAINTING	26.32
0742	FRONT PANEL SURFACE PAINT	9.96
0920	FRONT BUMPER NEW PART PAINT K1R	50.68
0281	RIGHT FRONT DOOR REPAIR PAINTING <50%	31.33
1482	L/F WING REPAIR PAINTING >50%	20.15
0741	R/SIDE FRAME REPAIR PAINTING >50%	22.12
2082		



**Subtotal Discount(+20.00%)**

**-1,371.00**

**Total**

**5,484.00**

**Final Calculation**

	SGD	SGD
<b>Parts</b>	6,855.00	
Total Discount(+20.00%)	-1,371.00	
<b>Total Parts</b>		<b>5,484.00</b>
<b>Labour Time Base 10 WU/h</b>		
Total 202.0 WU X 42.00 SGD/h	848.40	
<b>Total of Labour</b>		<b>848.40</b>
<b>Paint Work Time Base 10 WU/h</b>		
Labour Cost 143.0 WU X 42.00 SGD/h	600.60	
Material Cost	283.21	
<b>Total Paint Including Material</b>		<b>883.81</b>
<b>Repair Cost Excludes GST</b>		<b>7,216.21</b>
GST (+7.00%)		<b>505.13</b>
<b>Repair Cost Included GST</b>		<b>7,721.34</b>

**Comments**

\* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS

**Assessment Note**

**No assessment notes entered.**

**Labour Cost - Paint**

	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		113.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.50	5.0	21.00
<b>Total</b>	<b>10 WU/h</b>	<b>143.0</b>	<b>600.60</b>

**Material Cost - Paint**

	Price SGD
New Part Painting	108.88
New Part Painting - Plastic K1R	50.68
Repair Painting	73.60
Surface-/Blend Paint	12.45
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
<b>Total</b>	<b>283.21</b>

**Spare Parts**

				prices as at 2001-01-01	
Code	Description	Part Number	Part Source		Price SGD
1000	8981940043	AIR COOLER	Original	ADD	CNE 980.00 ✓
8391	AIR FILTER ASSY	93618630	Original		CNE 490.00 ✓
8374	AIR HOSE	8980899702	Original		CUT 90.00
0471	BONNET	8981938170	Original		BUC 520.00
7785	EXPANSION TANK	8980957012	Original	ADD	DIS 85.00 ✓
0281	FRONT BUMPER	8981934472	Original		DIS 500.00
0341	FRONT BUMPER SUPPORT	8980873901	Original		DIS 180.00 ✓
0257	FRONT NUMBER PLATE	KNPL3	Original		Seif 20.00 ✓
0920	FRONT PANEL	8981032020	Original		Seif 650.00
0340	FRT BUMPER SUPPORT	8975471070	Original		DIS 550.00
0410	GRILLE	8981938670	Original		CNE 200.00
0415	GRILLE BACKING	8981938710	Original		CNE 350.00
1002	INN GRILLE MOULDING	8982845231	Original	ADD	CNE 180.00 ✓
8403	INTAKE CHANNEL	8980655501	Original		DIS 190.00
0475	L/BONNET HINGE	8981041002	Original		Seif 40.00
0309	L/F BUMP REINF BRKT	8980873912	Original	ADD	Seif 40.00 ✓
5981	L/F ENGINE MOUNTING	8973672850	Original	ADD	Seif 40.00 ✓
5983	L/LOWER RUBBER MOUNT	8980513260	Original	ADD	Seif 35.00 ✓
1001	LWR RADIATOR GRILLE	8982845180	Original	ADD	CNE 200.00 ✓
0476	R/BONNET HINGE	8981040992	Original		Seif 40.00
1326	R/COWL GRILLE BRKT	8981339816	Original		CNE 60.00
0320	R/F INN BUMPER BRKT	8980873920	Original		DIS 55.00
0316	R/F INN BUMPER REINF	8980742585	Original		Seif 55.00
0326	R/F LWR INN BRACKET	8981396940	Original		DIS 55.00
0842	R/F WHEELHOUSE COVER	8980772524	Original		Seif 180.00
0742	R/F WING	8981032061	Original		BUC 400.00
0286	R/R FOG LAMP COVER	8980998241	Original		BRO 80.00
0562	RIGHT HEADLAMP ASSY	8981253916	Original		BRO 480.00
0328	RIGHT RETAINER	8980504620	Original		CNE 55.00

f: OEM Parts  
n: Non-OEM Parts  
u: Used parts

**Savings**  
**Subtotal**

0.00  
6,800.00  
203  
5440

**Total**

**6,800.00**

**Final Calculation**

	SGD	SGD
<b>Parts</b>	6,800.00	
<b>Total Parts</b>		<del>6,800.00</del> 5400
<b>Labour Time Base 10 WU/h</b>		
Total 177.0 WU X 42.00 SGD/h	743.40	
<b>Total of Labour</b>		<b>743.40</b>
<b>Paint Work Time Base 10 WU/h</b>		
Labour Cost 143.0 WU X 42.00 SGD/h	600.60	
Material Cost	283.21	
<b>Total Paint Including Material</b>		<b>883.81</b>
<b>Repair Cost Excludes GST</b>		<b>8,427.21</b>
GST (+7.00%)		<b>589.90</b>
<b>Repair Cost Included GST</b>		<b>9,017.11</b>

7067.21

**Comments**

- \* - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
- ) - WU PARTIAL INCL IN OTHER POSITIONS

**Assessment Note**

No assessment notes entered.