

## OH APPRAISAL SERVICES

BLK 34,#02-309,TOA PAYOH,LORONG 5  
SINGAPORE (310034)

Mobile : 97982959 Fax : 63975857 email : oh3434@yahoo.com.sg

### VEHICLE DAMAGE INSPECTION REPORT

C/O Tclimo Private Ltd  
160 Sin Ming Drive , Sin Ming Autocity  
#05-17  
Singapore 575722

Our Ref : SLZ4666Z/TP5029  
Date : 02 June 2022

#### REFERENCES

Claim Type	: Third Party	Date of Accident	: 27 November 2021
Vehicle No.	: SLZ4666Z	Date of Assignment	: 14 December 2021
Make	: Toyota	Date of Inspection	: 14 December 2021
Model	: Prius Hybird	Date of Re-inspn.	: 17 December 2021
Reg. Date	: 04 May 2018	Chassis No	: ZVW506117985
Color	: Grey	Engine No	: Blocked
Odometer	: 111853 km		

#### TYRE CONDITION

	<u>Front near side</u>	<u>Front off side</u>	<u>Rear near side</u>	<u>Rear off side</u>
Make	Royal Road	Royal Road	Royal Road	Royal Road
Size	205/55 R16	205/55 R16	205/55 R16	205/55 R16
Thread Balance	5 mm	5 mm	6 mm	6 mm

#### GENERAL DESCRIPTION OF DAMAGE (PHOTOGRAPHS ATTACHED)

The vehicle sustained damage at Rear,Rh and undercarriage portion

#### INSPECTION AND ADJUSTMENT

Original Quotation : \$16,007.29      Revised Assessment \$9,450.00 **Lump sum**

In accordance to your instruction, we have not authorized repairs.

In normal circumstances, repairs to the vehicle would take approximately  
( 7 ) days to complete.( Survey at Hiap Lek Automobile Trading.)

This survey was conducted on a "WITHOUT PREJUDICE" basis.

<u>S/N</u>	<u>Description</u>	<u>Qty</u>	<u>Condition</u>	<u>Original Quotation</u>	<u>Revised Quotation</u>
	<u>Material</u>				
1	Front door Rh	1		1,350.90	1,350.90
2	Front door weatherstrip Rh	1	Necessary	255.90	255.90
3	Front door outer handle Rh	1	Grazed	390.65	390.65
4	Front door lock Rh	1	Bent	650.80	650.80
5	Centre door pillar Rh	1	Repair	355.95	0.00
6	Rocker panel garnish Rh	1	Bent	598.90	598.90
7	Rocker panel Rh	1	Repair	496.60	0.00
8	Rear door Rh	1	Dented/bent	1,298.90	1,298.90
9	Rear door outer handle Rh	1	Grazed	365.99	365.99
10	Rear door inner handle assy Rh	1	Bent	220.80	220.80
11	Rear door lock Rh	1	Bent	538.90	538.90
12	Rear door top hinge Rh	1	Bent	181.90	181.90
13	Rear door bottom hinge Rh	1	Bent	181.90	181.90
14	Rear door checker Rh	1	Bent	189.90	189.90
15	Rear door inner trim board Rh	1	Grazed	755.60	755.60
16	Rear door inner trim board speaker Rh	1	Bent	320.00	320.00
17	Rear door window glass regulator gear & motor Rh	1	Bent	850.90	850.90
18	Rear door weatherstrip Rh	1	Necessary	281.80	281.80
19	Rear fender Rh	1	Bent	899.60	899.60
20	Rear shock absorber Rh	1	Bent	155.90	155.90
21	Rear lower arm Rh	1	Bent	265.50	265.50
22	Rear knuckle arm Rh	1	Bent	530.00	530.00
23	Rear knuckle arm bearing Rh	1	Bent	248.00	248.00
24	Rear torsion arm Rh	1	Bent	325.00	325.00
25	Rear drag link Rh	1	Bent	175.00	175.00
				11,885.29	11,032.74
			0 % and 25% discount	0.00	2,758.19
				11,885.29	8,274.56
	<u>Special nett items</u>				
26	Rear door inner trim board clip Rh	1 set	Necessary	32.00	32.00
27	Rear sport rim Rh	1	Bent	450.00	450.00
			Parts total	12,367.29	8,756.56
	<u>Labour &amp; Misc.</u>				
1)	Labour charge to remove-refit, panel beat, straighten, re-align and repair of Front rh door, front rh door centre pillar, rocker panel, rock panel garnish, rear door rh, rear rh fender and others relevant accident damages.			1,400.00	1,200.00
2)	To remove-refit rear Rh under carriage damage parts.			300.00	250.00
3)	To conduct computerise wheel alignment test.			80.00	60.00
4)	To check wirings and lightings			50.00	30.00
5)	To supplied and applied anti rust treatment to affected panels.			180.00	150.00
7)	Towing charges			80.00	60.00
8)	To transfer Rh doors fittings and attachments.			150.00	120.00
9)	To putty and spray painting charges.			1,400.00	1,200.00
			Total	16,007.29	11,826.56
	Lump sum repair adjustment				9,450.00

OH APPRAISAL SERVICES

Vehicle No: SLZ4666Z

Our Ref: SLZ4666Z/TP5029


ADJUSTMENT ON REPAIR COST AND REPLACEMENT OF PARTS

The information contained in this document is privileged and confidential and is intended for the exclusive use of the addressee designation. If you are not the addressee; any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this document not meant for you, please contact us immediately to arrange for it to return.



  
\_\_\_\_\_  
For Oh Appraisal Services

APPRAISAL SERVICE OH

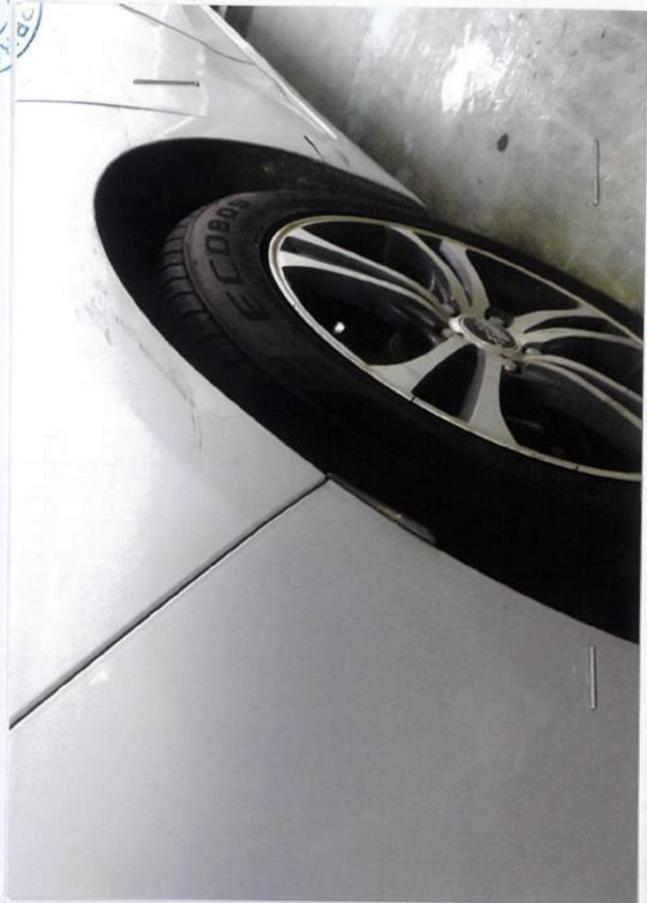

APPRAISAL SERVICE OH



APPRAISAL SERVICE OH



APPRAISAL SERVICE OH



APPRAISAL SERVICE OH

APPRAISAL SERVICE OH



APRAISAL SERVICES \* OH AGENCY

APRAISAL SERVICES \* OH AGENCY

APRAISAL SERVICES \* OH AGENCY

SERVICES \* OH



SERVICES \* OH



SERVICES \* OH



SERVICES \* OH

SERVICES \* OH



SERVICES \* OH





RAISAL SERVICES \* OH \*



RAISAL SERVICES \* OH \*



RAISAL SERVICES \* OH \*



RAISAL SERVICES \* OH \*



RAISAL SERVICES \* OH \*



RAISAL SERVICES \* OH \*



VIC'S HO HO APPRAISAL SERVICE



APPRAISAL SERVICES




APPRAISAL SERVICES



APPRAISAL SERVICES



APPRAISAL SERVICES

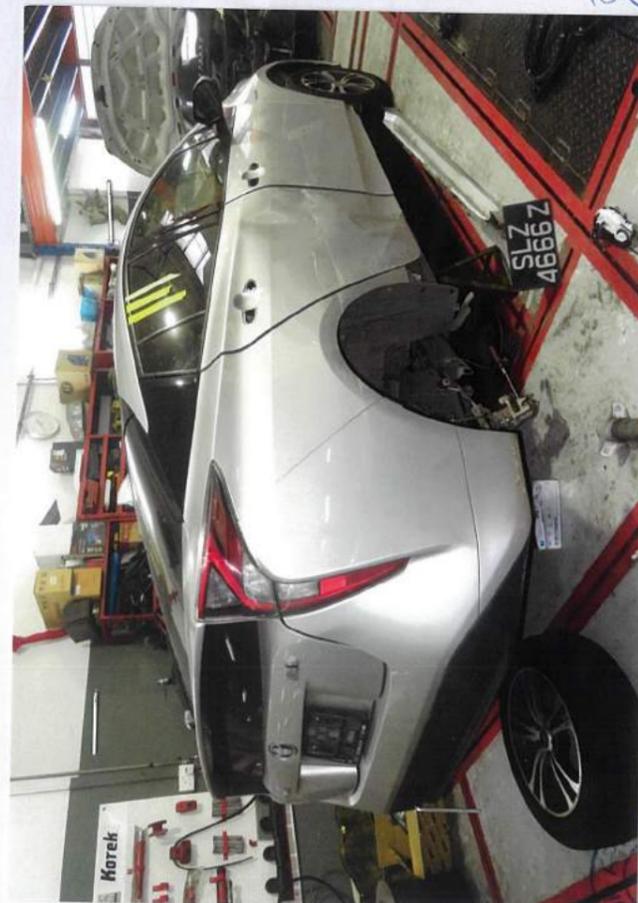

APPRAISAL SERVICES



APPRAISAL SERVICES




PRAISAL SERVICES  
HO



PRAISAL SERVICES  
HO



PRAISAL SERVICES  
HO

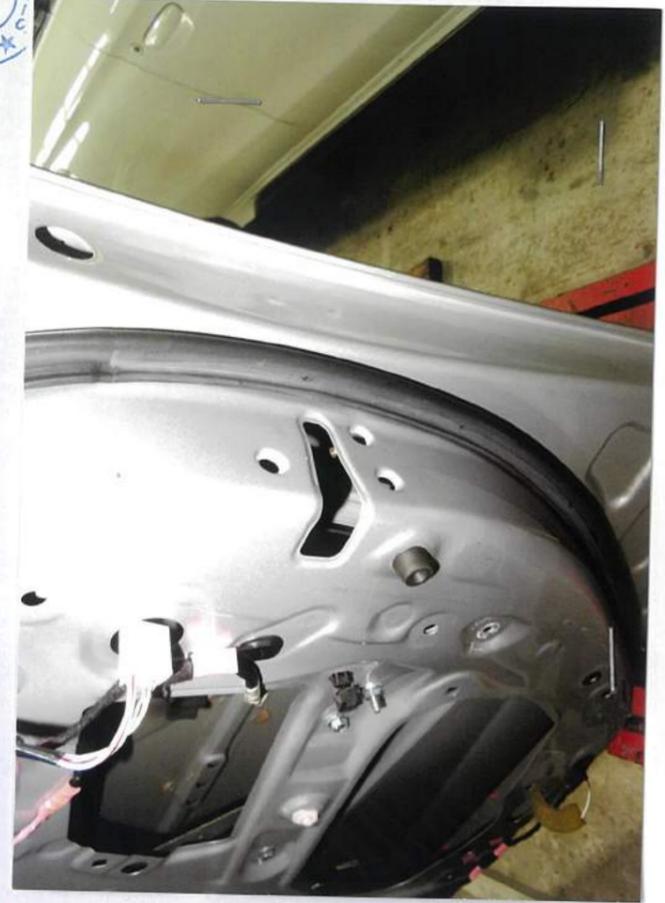


PRAISAL SERVICES  
HO




PRAISAL SERVICES  
HO



PRAISAL SERVICES  
HO

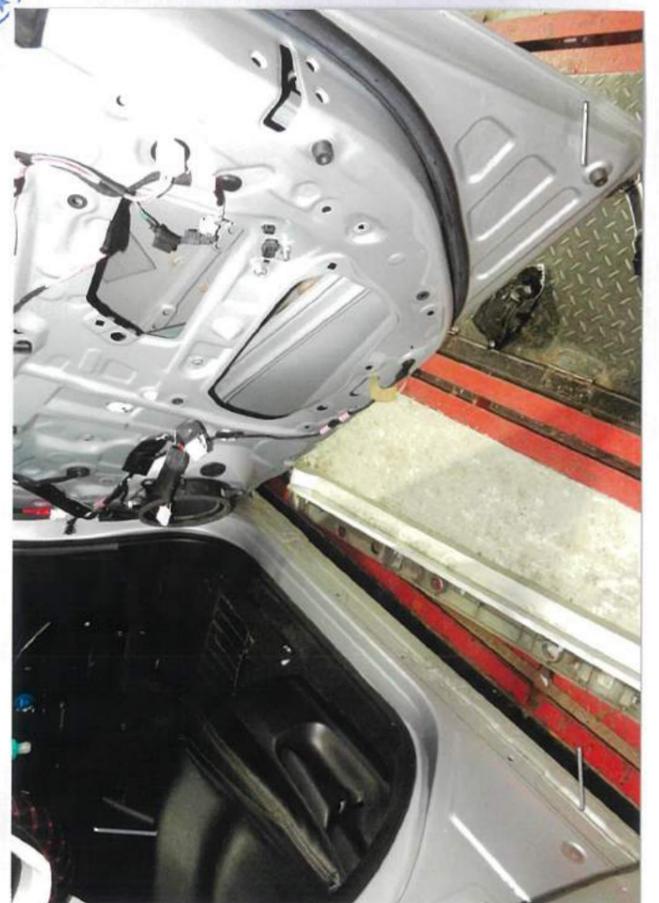

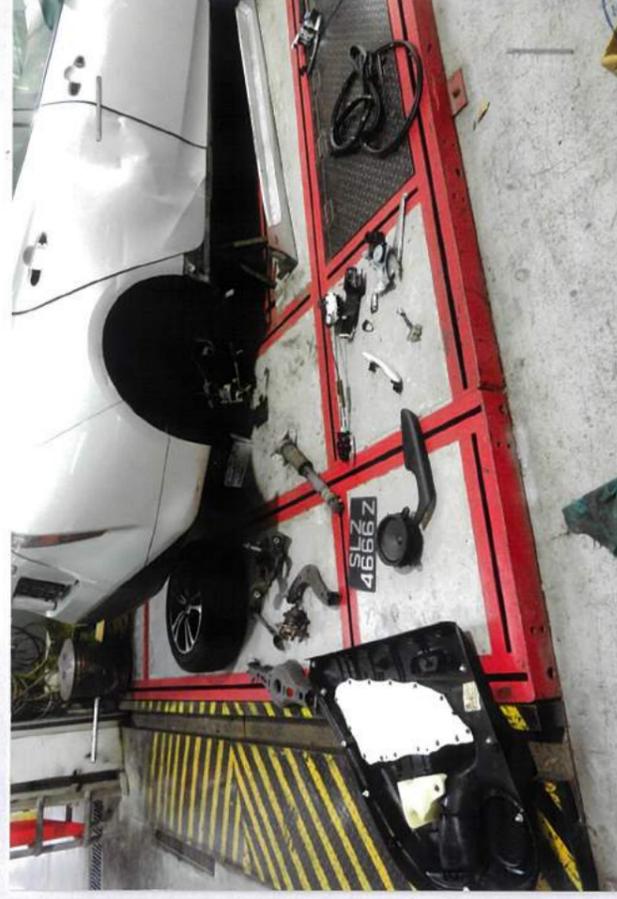


APPRAISAL SERVICES OH

APPRAISAL SERVICES OH

APPRAISAL SERVICES OH

APPRAISAL SERVICES OH


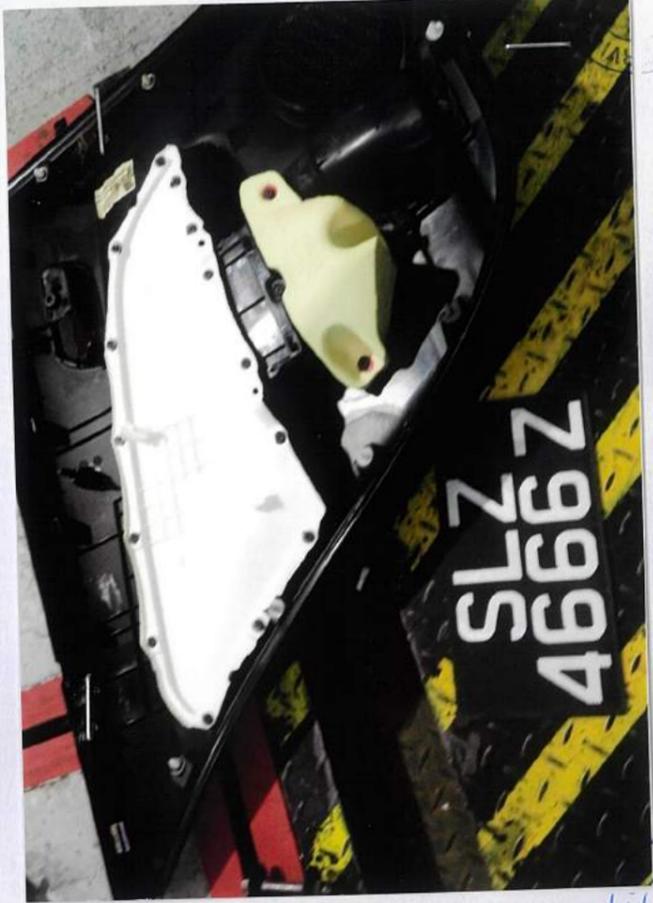


OH APPRAISAL SERVICES

OH APPRAISAL SERVICES




OH APPRAISAL SERVICES

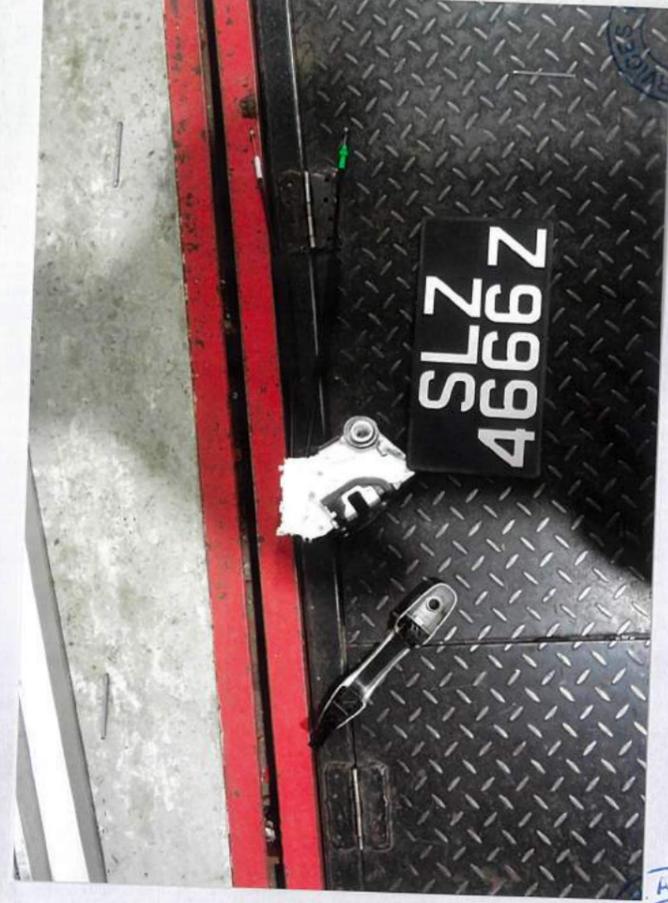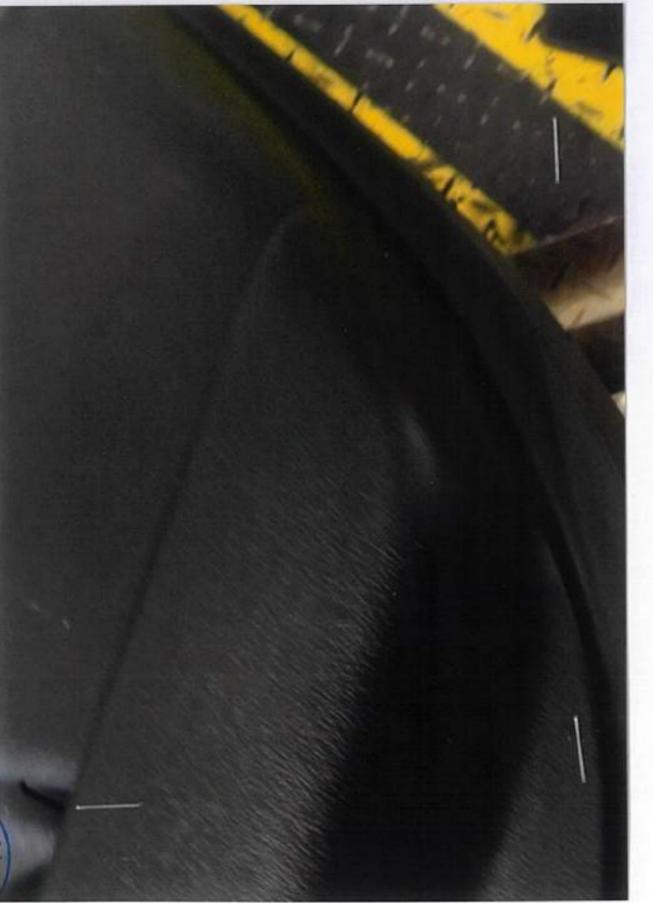

OH APPRAISAL SERVICES

OH APPRAISAL SERVICES

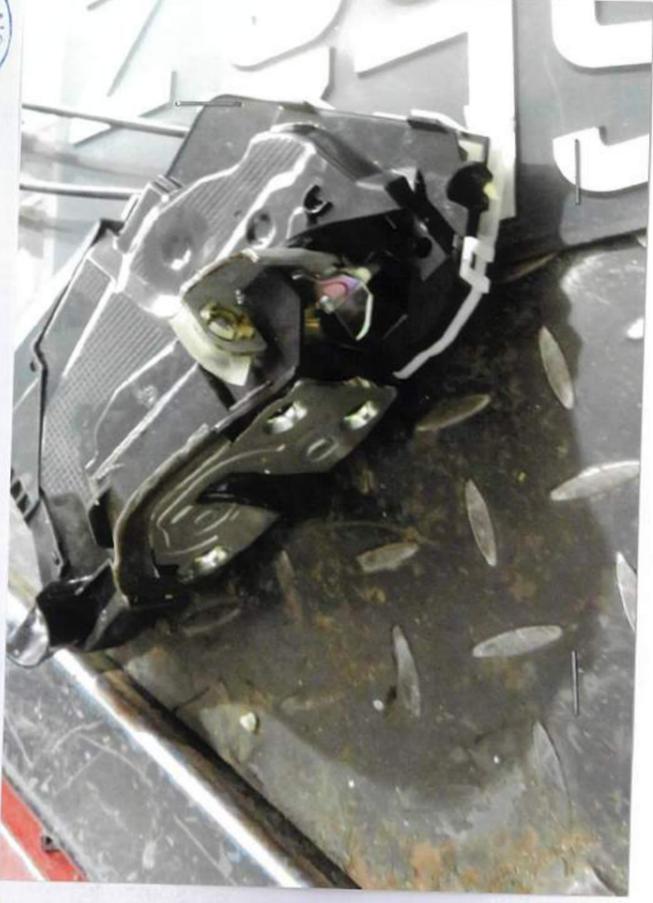


OH APPRAISAL SERVICES






APPRAISAL SERVICES HOH

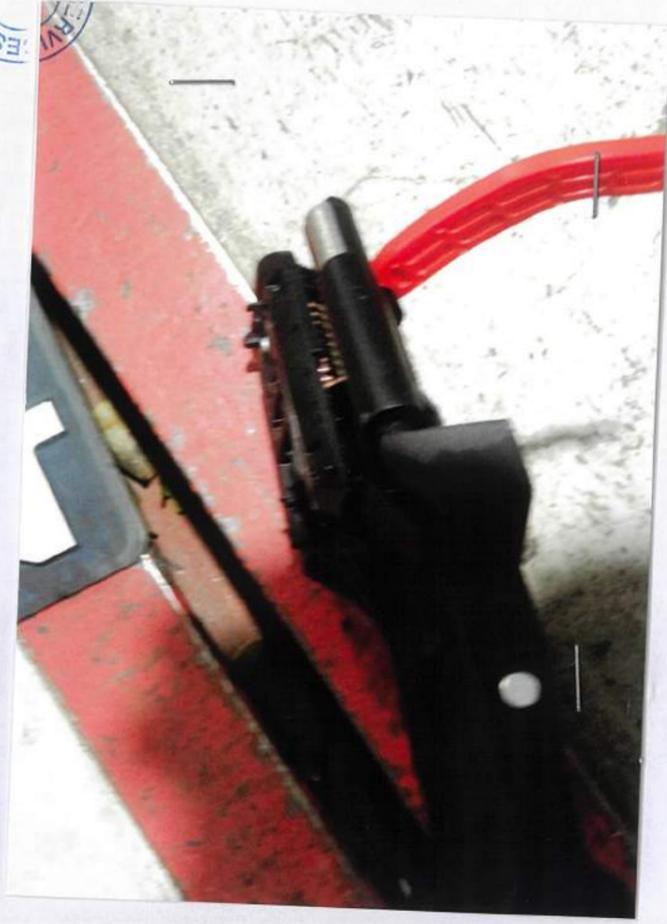

APPRAISAL SERVICES HOH

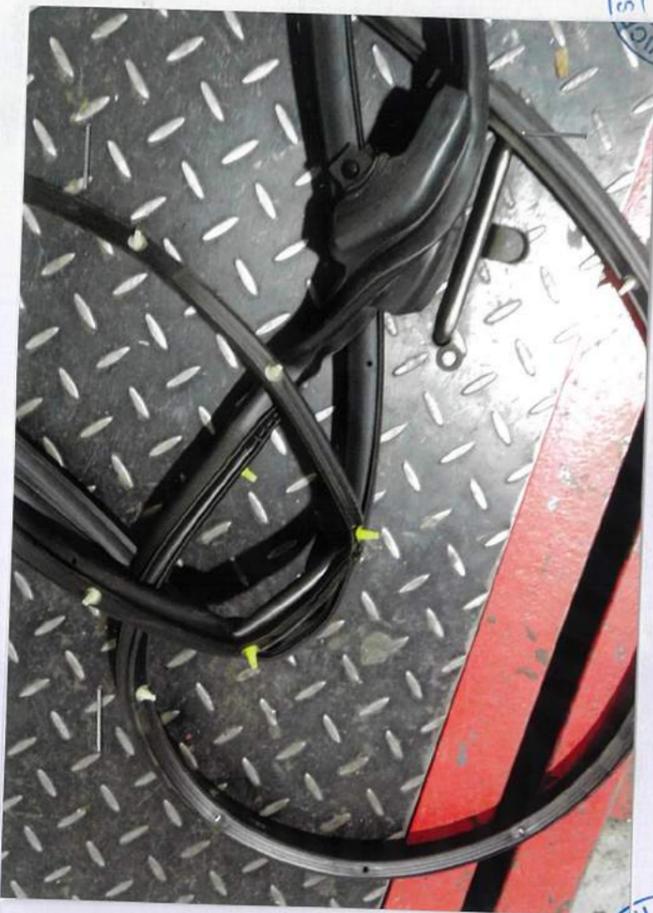



APPRAISAL SERVICES HOH



APPRAISAL SERVICES HOH



APPRAISAL SERVICES HOH

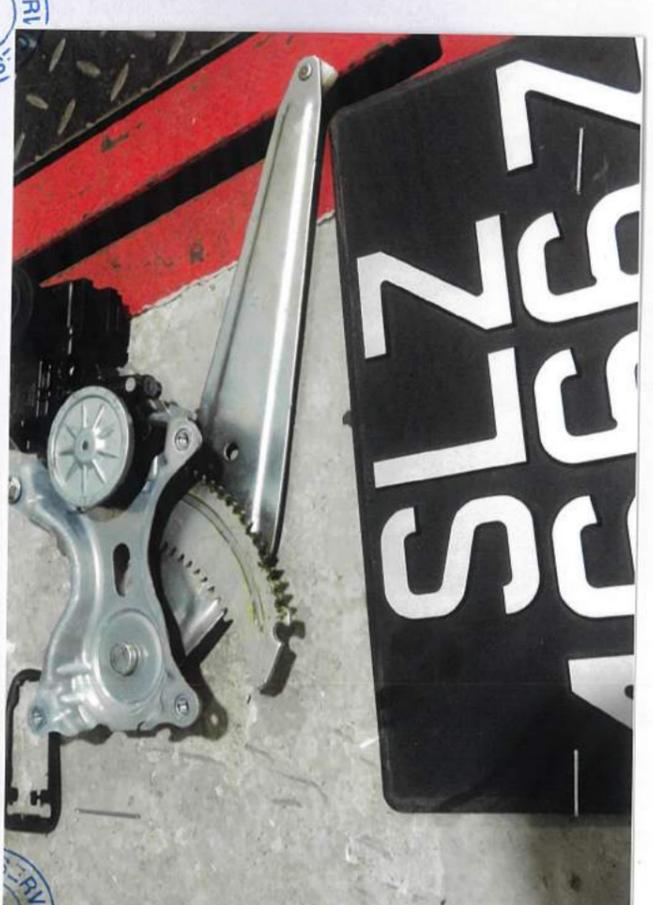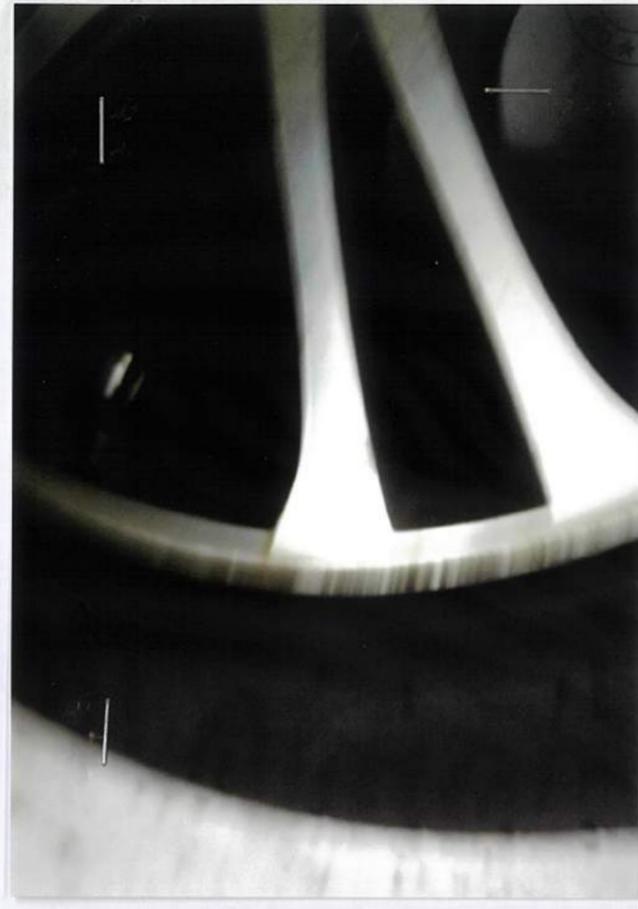

APPRAISAL SERVICES  
\* OH K A \*  
SERVICES

