

Auto Insure Pte. Ltd
6 Marsiling Lane
739145



Insurer Reference: SLU9610C
Repairer Reference: M5282/SLU9610C
Date calculated: 20/06/2022 7:22 PM

Full Report
Registration: SLU9610C
Printed: 20/06/2022 7:22 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Marvyn Chua	Currency:	SGD
Claim Reference:	SLU9610C	Date of Incident:	11/06/22
Estimated Repair Time:	6	Hire Car Start:	
Actual Repair Days:	6	Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	HONDA
Model:	STREAM
Sub Model:	LS
Model Sheet Number:	35 36 01
Registration:	SLU9610C
VIN number:	GP71121398
Odometer:	78584

Model Specs

TWO COAT METALLIC

Store CLKKJ
22/6/22, 3.09pm
Wk 12
5 Lyr
My CLKKJ

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before or after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "without prejudice" basis
- No illegal modification is allowed
- Supplementary item(s) must be approved and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

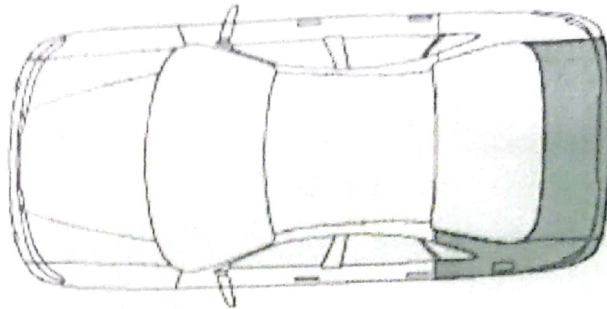

Tyres Condition

Tyre Brand	Tread (Left Middle),	Tread (Left Outer),	Tread (Left Inner),	Tread (Right Inner),	Tread (Right Outer),	Tread (Right Middle),	Condition
	mm	mm	mm	mm	mm	mm	

Spare Tyre Brand Tread (Spare), mm

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	RUST PROOFING BODY SHELL PART	2.0	8.40	
NO NUMBER	BUMPER CARRIER REAR RUST PROOFING	1.0	4.20	
NO NUMBER	R + R REAR DOOR	3.0	12.60	
68100-S7A)	RENEW TAILGATE (REMOVED)	52.0	218.40	
	INCLUDES: R + R REAR WINDOW, REAR WIPER, REAR WIPER MOTOR, LOCK, NUMBER PLATE LAMPS AND TAILGATE TRIMS			
NO NUMBER	RENEW L/INNER SIDE PANEL CONNECTION	20.0	84.00	
NO NUMBER	R + R REAR END PANEL ATTACHED PARTS	35.0	147.00	
	INCLUDES: R + R BUMPER, TAIL LAMP, BOOT TRIM, BOOT FLOOR TRIM, REAR PANEL TRIM, BOOT LOCK AND SEAL			
66100-S7A	RENEW REAR END PANEL CPL	37.0	155.40	
17500-S5A	R + R FUEL TANK	15.0	63.00	
04655-S7A	RENEW REAR FLOOR CPL	25.0	105.00	
NO NUMBER	R + R REAR SEAT	2.0	8.40	
NO NUMBER	R + R LEFT CENTRE SEAT	2.0	8.40	

Boot floor Repair 20-0 ✓

Code	Description	WU	Price SGD
NO NUMBER	R + R RIGHT CENTRE SEAT	2.0	8.40
84130-S7A	R + R L/UPPER C-PILLAR TRIM	4.0	16.80
2640	REAR BUMPER SUPPORT CAVITY PROTECTION		
Labour Cost			
	Panel / Mechanical Labour	Hrs 19.70 WU 197.0	827.40
	Total of Labour		827.40

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	REAR PANEL CPL NEW PART PAINTING	14.0
	TAILGATE NEW PART PAINTING	14.0
	L/R LAMP PANEL SURFACE PAINT	4.0
	BOOTFLOOR SURFACE PAINT	11.0

Paint Material Per Part

Code	Description	Price SGD
2711	REAR PANEL CPL NEW PART PAINTING	13.20
2931	TAILGATE NEW PART PAINTING	35.09
3571	L/R LAMP PANEL SURFACE PAINT	2.74
3900	BOOTFLOOR SURFACE PAINT	34.86

Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint		2.10	21.0	88.20
Preparation Main Work Metal		6.40	64.0	268.80
Total	10 WU/h			

Material Cost - Paint

New Part Painting	Price SGD
Surface-/Blend Paint	48.29
Material-constant Metal	37.60
Total	18.10
	103.99

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01/01	Price SGD
2977	BOOT/TAILGATE LOCK	74800S7AE01	Original	1 X nn	210.00
2944	BOOT/TAILGATE SEAL	74440S7A000	Original	X CRN X nn	130.00
3900	BOOTFLOOR	04655S7A307ZZ	Original	y R	940.00
1002	BUMPER COVER LH	REAR	Original	X nn	25.00
1003	BUMPER COVER RH	REAR	Original	X nn	25.00
1004	BUMPER REFLECTOR LH	REAR	Original	X nn	55.00
1005	BUMPER REFLECTOR RH	REAR	Original	X nn	55.00
1008	EMBLEM (HYBRID)	REAR TAILGATE	Original	7 X nn	70.00

Code	Description	Part Number	Part Source	Price SGD
1007	EMBLEM (SHUTTLE)	REAR TAILGATE	Original <i>APC X</i>	70.00
4985	END PANEL TRIM	84640S7AJ01ZA	Original <i>CPM</i>	105.00 ✓
2617	L/R INN BUMPER BRKT	71555S7A000	Original <i>X AN</i>	45.00
3571	L/R LAMP PANEL	63730S7AG00ZZ	Original <i>X AN</i>	190.00
2619	L/R OUT BUMPER BRKT	71598S7A003	Original <i>X AN</i>	25.00
1006	LOGO (HONDA)	REAR TAILGATE	Original <i>X AN</i>	25.00
4907	LOWER TAILGATE TRIM	84440S7AJ01ZA	Original <i>X AN</i>	25.00
2620	R/R OUT BUMPER BRKT	71593S7A003	Original <i>X AN</i>	25.00
2583	REAR BUMPER	71501S7A000ZE	Original <i>X DP</i>	820.00 ✓
2640	REAR BUMPER SUPPORT	71530S7AG00ZZ	Original <i>X AN</i>	0.00
2711	REAR PANEL CPL	66100S7AG01ZZ	Original <i>X DP</i>	410.00 ✓
3941	RR FLOOR RR C-MEMBER	65761S7AG00ZZ	Original <i>X AN</i>	95.00
2931	TAILGATE	68100S7AG11ZZ	Original <i>X DP</i>	600.00
				<i>790</i>
f: OEM Parts				0.00
n: Non-OEM Parts				3,945.00
u: Used parts				
Savings				
Subtotal				3,945.00
Total				3,945.00

Extras

Code	Description	Price SGD
1000	PARKING SENSORS REAR <i>he Shuts</i>	<i>200</i> 250.00*
1001	BUMPER CLIPS REAR <i>he</i>	<i>30</i> 50.00*
1009	END PANEL SEALANT REAR	<i>80</i> 35.00*
Total Extras		335.00

Final Calculation

	SGD	SGD
Parts	3,945.00	
Total Parts		3,945.00
Labour Time Base 10 WU/h		
Total 197.0 WU X 42.00 SGD/h	827.40	617.40
Total of Labour		827.40
Additional Costs		
Rustproofing		
Rate 3.0 WU X 42.00 SGD/h	12.60	
Total Of Additional Costs		12.60
Total Of Extras		335.00
Paint Work Time Base 10 WU/h		
Labour Cost 64.0 WU X 42.00 SGD/h	268.80	252
Material Cost	103.99	101.25
Total Paint Including Material		372.79
Repair Cost Excludes GST		5,492.79
GST (+7.00%)		384.50
Repair Cost Included GST		5,877.29

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.