



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## Affiliated to Federation Internationale Des Experts En Automobile

MINISTRY OF DEFENCE  
HQ TRANSPORT COMMAND  
KRANJI CAMP 3  
151 CHOA CHU KANG WAYSINGAPORE 688248

Ref: CC2/MIDA22006071/Tpq2

Date: 24/03/2023

Code: MIDA

### 1. Policy Particulars :- THIRD PARTY CLAIM

<b>Insured Veh.</b>	MID 21706	<b>Veh. Inspected</b>	SJT 7133E & GBK9453K
<b>Policy No.</b>		<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	CY 22/MID21706/240622/0023	<b>Excess (\$)</b>	0.00
<b>Assign From</b>		<b>Assign Date</b>	29/06/2022

### 2. Vehicle Particulars & Condition

<b>Make &amp; Model</b>	HYUNDAI AVANTE	<b>c.c</b>	1591
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2009
<b>Chassis No.</b>	KMH DU41BMAU894242	<b>Colour</b>	BLACK
<b>Odometer</b>	190451 KM	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	SPORTS RIM
<b>General</b>	GOOD		

### 3. Conditions of Tyres

	Size	Make	Balance
<b>R/H Front Tyre</b>	195/65 R15	BRIDGESTONE	6 mm
<b>L/H Front Tyre</b>	195/65 R15	BRIDGESTONE	6 mm
<b>R/H Rear Tyre</b>	195/65 R15	BRIDGESTONE	6 mm
<b>L/H Rear Tyre</b>	195/65 R15	BRIDGESTONE	6 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION.  
DAMAGES SEE DETAILS.

### 5. General Information

<b>Accident Date</b>	24/06/2022	<b>Inspection Date</b>	29/06/2022
<b>Survey held at</b>	J.E.W MOTORS PTE LTD 6001 BEACH ROAD #22-01 GOLDEN MILE TOWER SINGAPORE 199589		

### 5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.  
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **6 Working Days**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJT 7133E & GBK9453K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	LH REAR DOOR	BENT	1,115.00	1,115.00
1	LH REAR DOOR PROTECTOR	NOT NECESSARY	134.00	-
1	LH REAR DOOR PROTECTOR CHROME MOULDING	NOT NECESSARY	45.20	-
1	LH REAR DOOR FRAME BLACK STICKER	NECESSARY	67.44	67.44
1	LH REAR DOOR OUTER HANDLE	NOT NECESSARY	109.00	-
1	LH REAR DOOR OUTER HANDLE SIDE COVER	NOT NECESSARY	32.00	-
1	LH REAR DOOR WEATHERSTRIP	NECESSARY	178.20	178.20
1	LH REAR DOOR LOCK	NOT NECESSARY	303.00	-
1	LH REAR DOOR LOCK CATCH	NOT NECESSARY	46.30	-
1	LH REAR DOOR INNER TRIM BOARD	NOT NECESSARY	703.10	-
1	SET LH REAR DOOR INNER TRIM BOARD CLIPS	NOT NECESSARY	50.00	-
1	REAR WINDSCREEN GLASS QUARTER MOULDING	NOT NECESSARY	101.20	-
1	LH REAR FENDER	BUCKLED	1,806.90	1,100.00
1	LH REAR FENDER GLASS WITH RUBBER SEAL	NECESSARY	90.10	90.10
1	LH REAR FENDER PETROL COVER	BENT	98.30	98.30
1	LH REAR FENDER INNER TRIM BOARD	NOT NECESSARY	252.40	-
1	SET LH REAR FENDER INNER TRIM BOARD CLIPS	NOT NECESSARY	50.00	-
1	LH REAR FENDER SPLASH SHIELD	NOT NECESSARY	89.50	-
1	LH REAR FENDER SPLASH SHIELD CLIPS	NOT NECESSARY	35.00	-
1	LH REAR FENDER AIR DUCT	NOT NECESSARY	43.50	-
1	LH REAR SPORT RIM	CUT	845.30	845.30
1	LH REAR SHOCK ABSORBER	NOT NECESSARY	256.80	-
1	LH REAR WHEEL BEARING	NOT NECESSARY	372.80	-
1	LH REAR KNUCKLE ARM	NOT NECESSARY	452.40	-
1	LH REAR TRAILING ARM	NOT NECESSARY	245.60	-
1	LH TAILLAMP ASSY	CRACKED	303.20	303.20
1	LH TAILLAMP PANEL	NOT NECESSARY	177.60	-
1	LH TAILLAMP SPONGE GASKET	NOT NECESSARY	36.00	-
1	SET LH TAILLAMP LOCK CLIPS	NOT NECESSARY	30.00	-
1	REAR BUMPER	TORN	489.60	489.60
1	SET REAR BUMPER CLIPS	NECESSARY	50.00	30.00

Report Ref No. CC2/MIDA22006071/Tpq2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR BUMPER RH SIDE RETAINER	NOT NECESSARY	56.20	-
1	REAR BUMPER LH SIDE RETAINER	NOT NECESSARY	56.20	-
1	BOOTLID LH LAMP	CRACKED	231.80	231.80
1	BOOTLID 'AVANTE' EMBLEM	NOT NECESSARY	23.10	-
1	BOOTLID CENTRE EMBLEM	NOT NECESSARY	33.80	-
	LESS 20% DISCOUNT		-1,802.11	-909.79
			7,208.43	3,639.15
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	LH REAR FENDER GLASS WITH RUBBER SEAL (SN)	NOT NECESSARY	80.00	-
1	LH REAR FENDER JOINT SEAL (SN)	NECESSARY	75.00	40.00
1	LH REAR TYRE (SN)	NOT NECESSARY	550.00	-
1	BRAKE FLUID (SN)	NOT NECESSARY	70.00	-
1	REAR WINDSCREEN GLASS SEALANT (SN)	NECESSARY	70.00	60.00
1	REAR WINDSCREEN GLASS INNER SEAL (SN)	NOT NECESSARY	50.00	-
1	LH TAILLAMP PANEL (SN)	NOT NECESSARY	30.00	-
1	REAR BUMPER LOWER SPOILER (SN)	CRACKED	850.00	300.00
1	LH SIDE ROCKER PANEL SPOILER (SN)	CRACKED	750.00	300.00
1	BOOTLID RH EMBLEM (SN)	NOT NECESSARY	70.00	-
1	BOOTLID LH EMBLEM (SN)	NOT NECESSARY	70.00	-
			2,665.00	700.00
	<b><u>LABOUR</u></b>			
	LABOUR CHARGES ON AFFECTED AND CONSISTENT AREAS AND PANELS .		2,200.00	700.00
	PUTTY AND RE-SPRAY ON AFFECTED AREAS AND PANELS .		1,800.00	800.00
	CHECK WIRING AND LIGHTING SYSTEM.		80.00	30.00
	SPRAY RUST CHEMICAL ON AFFECTED AREAS .		150.00	30.00
	REMOVE AND REINSTALL REAR WINDSCREEN GLASS TO ASSIST REPAIR .		220.00	120.00
	REMOVE AND REPLACE LH REAR DOOR INNER COMPONENTS TO ASSIST REPAIR .		150.00	60.00
	REMOVE AND REINSTALL FUEL TANK ,HOSES AND SENSOR TO ASSIST REPAIR .		250.00	60.00
	REMOVE AND REPLACE REAR UNDERCARRIAGE PARTS TO ASSIST REPAIR .	NOT NECESSARY	550.00	-

Report Ref No. CC2/MIDA22006071/Tpq2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE AND REINSTALL REAR BUMPER REVERSE SENSORS TO ASSIST REPAIR .		180.00	30.00
	REMOVE AND REINSTALL LH REAR FENDER GLASS TO ASSIST REPAIR .		150.00	60.00
	CONDUCT AND ADJUST WHEEL ALIGNMENT SYSTEM.		120.00	80.00
	REMOVE AND REPLACE ROOF LINING SEATS,CARPET AND TRIMS TO ASSIST REPAIR .		450.00	60.00
			6,300.00	2,030.00
	<b>GRAND TOTAL</b>		<b>16,173.43</b>	<b>6,369.15</b>
	<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>			<b>5,100.00</b>

Report Ref No. CC2/MIDA22006071/Tpq2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SJT 7133E

## INSPECTION






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

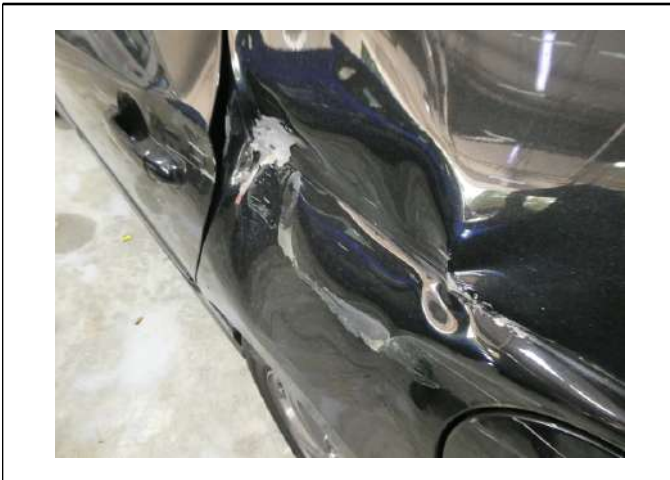



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

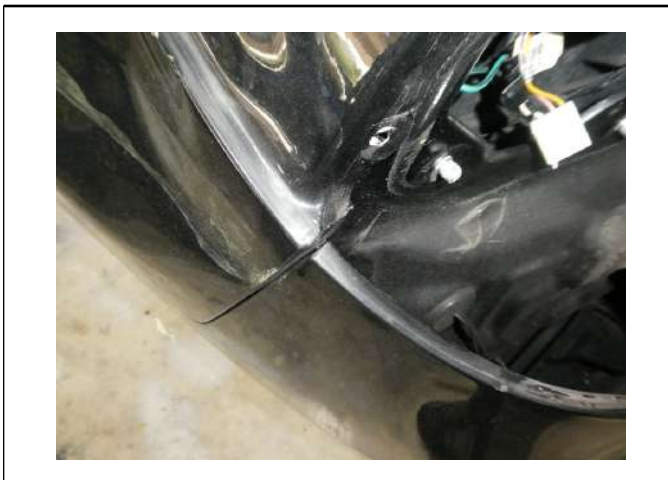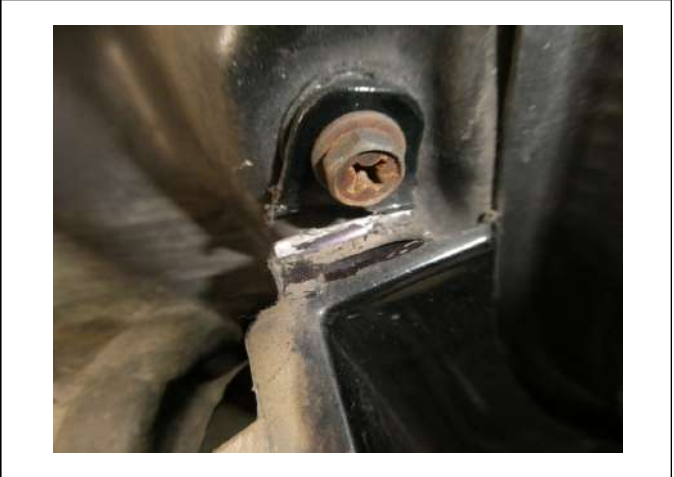



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJT 7133E

RE-INSPECTION

