

PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Fax: 6315 3298, Mobile: 9061 0543

ACCIDENT VEHICLE INSPECTION REPORT

Report no : 513M22.SGA
Vehicle no : SMZ8601Y

1 REFERENCE

Date of inspection : 10 May 2022
Requested by : SG Auto Pte Ltd
1 Tampines North Drive
#01-32
Singapore 528559
Type of survey : Independent
Repairer : SG Auto Care
25 Kaki Bukit Road 4, #05-34 Synergy@KB, Singapore 417800
Date of accident : 4 May 2022

2 VEHICLE DATA

Make/Model : **HONDA VEZEL HYBRID 1.5X AUTO**
Chassis no : RU31260493
Engine no : LEB5960510
Date of registration : 17 October 2018
Engine capacity : 1496 cc
Odometer reading : 077968 km
Colour : White

3 STATIC CONDITION CHECK

Steering : Serviceable
Foot brakes : Serviceable
Hand brakes : Serviceable
Paintwork : Good
General Condition : Good

4 TIRE CONDITION CHECK	<u>RH/MAKE</u>	<u>LH/MAKE</u>	<u>SIZE</u>
Front tread	: 5 mm/Dunlop	5 mm/Dunlop	215/60R16
Rear tread	: 5 mm/Dunlop	5 mm/Dunlop	215/60R16

5 BRIEF DESCRIPTION OF DAMAGE

Rear bumper side cover scratched, rear RH fender scraped/bent, rear RH door dented/scraped/distorted, front RH door scraped, etc. Please see para. 8 of this report for more details.

6 REMARKS

This inspection is carried out on a "WITHOUT PREJUDICE" basis and I have not authorized any repairs.

7 RECOMMENDATION

Cost of repairs : **\$2,100.00** (lump sum)
Estimated no of days : **Four (4)**

Report no: 513M22.SGA
Vehicle no: SMZ8601Y

9 CONCLUSION

The revised or adjusted cost of repairs to restore the vehicle is

\$2,600.16

(a) The final cost of repair based on lump sum repairs would be

\$2,100.00

(b) Under normal repair circumstance, the estimated number of days for the repair would
(Post Repair Inspection conducted on 14 May 2022)

Four (4)

The above recommendations in my view are fair and reasonable for the restoration of the vehicle to its pre-accident condition.

Note: Lump Sum Repair Basis

This means the repairer is allowed to replace the damaged parts with used, reconditioned or new parts, or repair it to a roadworthy condition.

Yours faithfully

Liaw Leong San
Licensed Automotive Appraiser

Dated: 22 June 2022

B **ASSESSMENT OF DAMAGE AND COSTS**

Report no: 513M22.SGA
Vehicle no: SMZ8601Y

A **SPARE PARTS**

STATEMENTS

<u>Description</u>	<u>Qty</u>	<u>Assessed Condition</u>	<u>Repairer's Amount</u>	<u>Revised Amount</u>	
Rear bumper side cover RH	1	to repair	195.00	0.00	
Rear bumper side cover retainer RH	1	not required	28.00	0.00	
Rear RH fender	1	to repair	950.20	0.00	
Rear RH fender arch protector	1	scraped	210.00	210.00	
Rear RH fender arch protector clip	10	necessary	39.00	39.00	
Rear RH door assy	1	dented/scraped/distorted	901.20	901.20	
Rear RH door glass regulator c/motor	1	serviceable	390.20	0.00	
Front RH door assy	1	to repair	950.10	0.00	
Subtotal of the above			3,663.70	1,150.20	
Discount			20% / 20%	732.74	230.04
Total cost of parts:			2,930.96	920.16	

B **LABOUR**

Labour charges to remove and replace damaged parts, to cut and weld damaged body panels, to knock and reshape affected areas, to adjust and align misaligned parts.	750.00	500.00
Spray painting charges to putty and spray paint the rear bumper, rear RH fender, rear RH door, front RH door and necessary areas.	1,250.00	1,000.00
To check wiring and repair where needed.	45.00	30.00
To apply anti-rust undercoat for the affected areas.	150.00	90.00
To remove and transfer door glass and fittings.	90.00	60.00
Total cost of labour:	2,285.00	1,680.00
Total cost of repair:	5,215.96	2,600.16

PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Tel: 6315 1239, Fax: 6315 3298, Mobile: 9061 0543

SG Auto Pte Ltd
1 Tampines North Drive
#01-32
Singapore 528559

Invoice no:	POS0513/22
Date:	22 June 2022
Report no:	513M22.SGA
Vehicle :	SMZ8601Y

INVOICE

No	Item Description	Qty	Unit Price	Total Amount(\$)
01	Being charges for the inspection of the accident vehicle, transport and photographs.			471.00
SGD(\$): Four Hundred and Seventy-one only			Payable Amount:	471.00


"Cheque should be crossed and made payable to "Pro-Option Services"

PRO-OPTION SERVICES



.....
Authorised Signature

Report no: 513M22.SGA
Vehicle no: SMZ8601Y

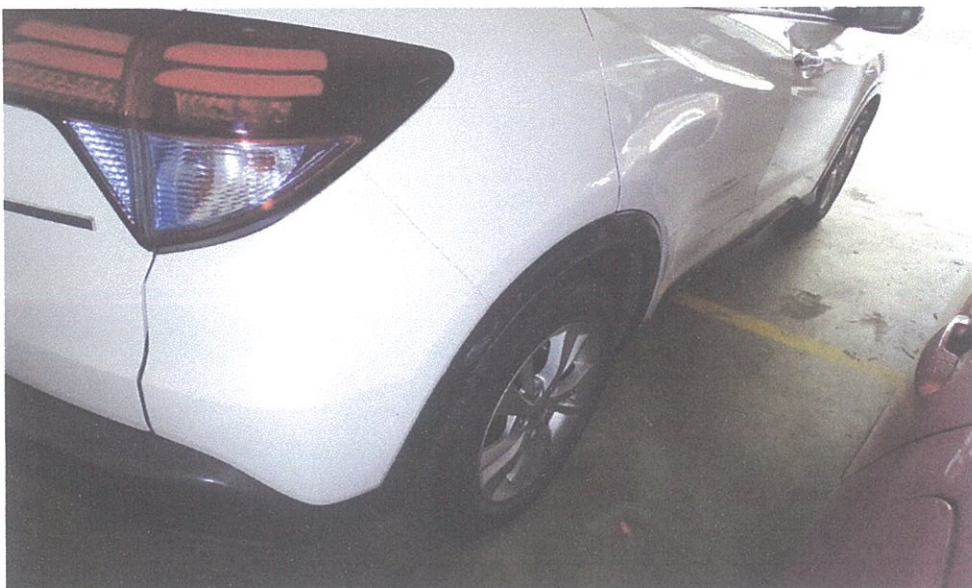













Report no: 513M22.SGA
Vehicle no: SMZ8601Y





