

ASS. REC. BY:

REF:

CS/AGI22006262/DVY³

ASSIGNMENT

COE Jan 2028

Yr Regn: Jan / 2020

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: SMK 7855S

Policy No. _____

Claims No. C10016046/JT


Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh. had commenced its repair at the time of inspection.

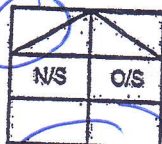

Bal. or Market Value: _____

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 14 12 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SHD 4750B

Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Hyundai Ioniq CUS 1580

Colour: Blue A/C: Insured / Std / NI / NA

Sp. Reading: 249875 T/Radio: Insured / Std / NI / NA

Eng No: G4LBK U409100K

C No: KMHC851CV LU190022

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD / R/Rim or

Tyre Size: F: 195 / 65 R 15

R: 11

BS / DUN / EXNOVA / GY / FS / LZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Westlake

Front

Rear

R/Bal: 5 mm

R/Bal: 5 mm

L/Bal: 5 mm

L/Bal: 5 mm

D.O.A: 30/06/2022

D.O.I: 30/06/2022

Survey held at

Dipst in wing

Des. of Damages: Fnt / Rear / O/S / NIS / U/C / Rooftop or

Rear / H/S Rmt

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	Budget Direct SMK 7855S
22/11/22	pinch 2/5 19,300/- with 14 days 2ry (red 32,478.26, 62%)

Date/Time, File Pass to?

☐ : Prel. Report

1)

☐ : Final Report

Date/Time, File Return to?

2) 22/11/22-typist

Days Of Repair: 14

Resurvey No. of Trip: 2

Add Fee: ☐ : Site Insp (\$

☐ : Interview (\$

☐ : Tech. Invs (\$

☐ : Weekend (\$

Survey Fee:

Transportation:

\$ + \$5.00

Photos

Others

TOTAL

Report Format: TP

Lump Sum H.B. (\$ 19,300)

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Company

Owner ID:

821R

Vehicle Details

Vehicle No.:

SHD4750B

Vehicle to be Exported:

Yes

Intended Deregistration Date:

30 Jun 2022

Vehicle Make:

HYUNDAI

Vehicle Model:

AE IONIQ HEV FL 1.6 DCT

Primary Colour:

Blue

Manufacturing Year:

2019

Engine No.:

G4LEKU409100

Chassis No.:

KMHC851CVLU190022

Maximum Power Output:

103.6 kW (138 bhp)

Open Market Value:

\$25,351.00

Original Registration Date:

16 Jan 2020

First Registration Date:

16 Jan 2020

Transfer Count:

0

Actual ARF Paid:

\$12,492.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

15 Jan 2028

PARF Rebate Amount:

\$9,369.00

Intended COE Rebate Details

COE Expiry Date:

15 Jan 2028

COE Category:

A - Car up to 1600cc & 97kW (130bhp)

COE Period(Years):

8

PQP Paid:

\$25,895.00

COE Rebate Amount:

\$17,933.00

Total Rebate Amount:

\$27,302.00

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 29 Jun 2022

OK

CITY AUTO PTE LTD

BLK 8 SIN MING IND. EST., #01-58/60/62

SINGAPORE 575643

Phone Number: 6453-1235

Fax Number: 6453-7944

Customer:	LIM TAN	Date:	7/1/2022 11:42 AM
Company:	01-42	VIN	
License NO:	SHD 4750B	Technician:	
Odometer:		Order NO:	

VEHICLE ALIGNMENT REPORT

HYUNDAI, IONIQ (AE HEV) Hybrid, 17-17 (Customized)

Primary Angles			Initial	Specifications		Final
				Min.	Max.	
Front	Caster	Left	5°01'	4°00'	5°00'	5°18'
		Right	5°06'	4°00'	5°00'	5°24'
	Camber	Left	-2°24'	-0°53'	0°07'	-2°18'
		Right	0°00'	-0°53'	0°07'	0°00'
	Toe	Left	-0°06'	-0°03'	0°09'	-0°06'
		Right	0°09'	-0°03'	0°09'	0°09'
Total		0°03'	-0°06'	0°18'	0°03'	
Rear	Camber	Left	-0°36'	-1°42'	-0°42'	-0°30'
		Right	-0°48'	-1°42'	-0°42'	-0°48'
	Toe	Left	0°12'	-0°02'	0°10'	0°09'
		Right	0°09'	-0°02'	0°10'	0°12'
		Total	0°21'	-0°04'	0°20'	0°21'
	Thrust Angle		0°01'	----		-0°01'
Secondary Angles			Initial	Specifications		Final
				Min.	Max.	
SAI		Left	14°13'	13°30'	14°30'	14°13'
		Right	13°45'	13°30'	14°30'	13°45'
Included Angle		Left	11°49'	----	----	11°55'
		Right	13°45'	----	----	13°45'
Toe Out On Turns		Left	----	----	----	----
		Right	----	----	----	----
Max Turn Inside		Left	----	----	----	----
		Right	----	----	----	----
Toe Curve Change		Left	----	----	----	----
		Right	----	----	----	----
Setback		Front	-2mm	----	----	-2mm
		Rear	-3mm	----	----	-3mm
Track Width Diff.			0mm			0mm
Wheel Base Diff.			1mm			1mm
Front Ride Height		Left	----	373mm	393mm	----
		Right	----	373mm	393mm	----
Rear Ride Height		Left	----	372mm	392mm	----
		Right	----	372mm	392mm	----
Frame Angle						----

ONE STOP AUTOMOTIVE SOLUTION

BIFROST AUTO PTE LTD

REPAIR ESTIMATE

DATE: 30-Jun-22

INSURANCE: Budget Direct

MODEL: HYUNDAI IONIC

Budget Direct

VEHICLE NO.: SHD 4750 B

Description	Qty	List Price	Amount
Bonnet <i>ft</i>	1	\$ 2,253.80	\$ 2,253.80
Bonnet Hinge (LH/RH) <i>HH</i>	2	\$ 118.70	\$ 237.40
Bonnet Moulding <i>HH</i>	1	\$ 41.40	\$ 41.40
Bonnet Lock <i>HH</i>	1	\$ 127.30	\$ 127.30
Bonnet Insulator <i>HH</i>	1	\$ 230.10	\$ 230.10
Bonnet Insulator Clips <i>HH</i>	1	\$ 15.00	\$ 15.00
Flap Assy Active Air Upper, (LH) <i>HH</i>	1	\$ 824.60	\$ 824.60
Unit Assy-SMART CRU (Radar Sensor) <i>HH</i>	2	\$ 3,061.40	\$ 6,122.80
Front Bumper Cover <i>turn</i>	1	\$ 481.10	\$ 481.10
Front bumper top cover <i>HH</i>	1	\$ 476.30	\$ 476.30
Front Bumper Sponge <i>broken</i>	1	\$ 186.90	\$ 186.90
Front Bumper Reinforcement <i>HH</i>	1	\$ 1,136.70	\$ 1,136.70
Front Bumper Reinforcement ABSORBER (LH) <i>HH</i>	1	\$ 186.50	\$ 186.50
Front Bumper Moulding Centre Upper <i>distorted/mounty broken</i>	1	\$ 368.50	\$ 368.50
Front Bumper Bracket Top (LH) <i>broken</i>	1	\$ 35.00	\$ 35.00
Front Bumper Bracket (LH) <i>broken</i>	1	\$ 28.00	\$ 28.00
Front Bumper Retainer Mounting (LH) <i>HH</i>	1	\$ 65.30	\$ 65.30
Front Bumper Clips 10 pcs <i>Hee</i>	1	\$ 25.00	\$ 25.00
Front Bumper Grille (LH) <i>deformed</i>	1	\$ 186.90	\$ 186.90
Front bumper air duct (LH) <i>HH mounty broken</i>	1	\$ 153.80	\$ 153.80
Day Light ,LH <i>mounty broken</i>	1	\$ 642.50	\$ 642.50
Day Light Wire, <i>HH</i>	1	\$ 585.50	\$ 585.50
BUZZER ASSY - PIEZO (LH) <i>HH</i>	1	\$ 388.00	\$ 388.00
Headlamp Support Panel Assy <i>crack/broken</i>	1	\$ 1,139.30	\$ 1,139.30
Headlamp(LH) <i>crack/broken</i>	1	\$ 3,987.30	\$ 3,987.30
Horn Unit (LH) <i>HH</i>	1	\$ 72.80	\$ 72.80
Front Fender(LH) <i>Deck</i>	1	\$ 490.70	\$ 490.70
Front Fender Apron Panel side support (LH) <i>leg</i>	1	\$ 238.80	\$ 238.80
Front Fender Apron Panel (LH) <i>leg</i>	1	\$ 756.20	\$ 756.20
Front Fender Apron Panel Upper(LH) <i>leg</i>	1	\$ 329.00	\$ 329.00
Front Fender Shield (LH) <i>turn</i>	1	\$ 164.70	\$ 164.70
Front Wheel Rim (LH) <i>distorted</i>	1	\$ 1,124.20	\$ 1,124.20
Front Wheel Hub assy (LH) <i>Deu</i>	1	\$ 678.50	\$ 678.50
Front Wheel Hub Cap <i>distorted 1st/1st</i>	1	\$ 346.40	\$ 346.40
Front Shock Absorber(Assy)(LH) <i>distorted</i>	1	\$ 372.50	\$ 372.50
Front Shock Absorber Mounting (LH) <i>HH</i>	1	\$ 372.50	\$ 372.50
Front Drive Shaft (LH) <i>HH</i>	1	\$ 1,136.70	\$ 1,136.70
Rack & Pinion Assy <i>HH</i>	1	\$ 2,387.40	\$ 2,387.40
STG Tie Rod <i>HH</i>	1	\$ 125.60	\$ 125.60
STG Tie End <i>HH</i>	1	\$ 94.70	\$ 94.70
Stabilizer Bar <i>HH</i>	1	\$ 326.80	\$ 326.80
Stabilizer Bar Link <i>HH</i>	1	\$ 92.10	\$ 92.10

✓

X

X

X

X

X

X

X

✓

X

X

X

X

X

✓

X

✓

✓

X

✓

✓

✓

✓

X

X

✓

✓

✓

X

✓

X

X

X

✓

✓

✓

✓

✓

X

X

X

X

X

X

X

2110.30

10,786.10

SUB TOTAL				\$ 49,851.13
LESS 20%				\$ 9,970.23
DISCOUNTED TOTAL				\$ 39,880.90
Emblem-Blue Drive (LH) <i>Hec</i>	SN	1	\$ 26.60	\$ 26.60
Front Tyre(LH) <i>HN</i>	SN	1	\$ 216.00	\$ 216.00
Reverse camera ASSY <i>HN</i>	SN	1	\$983.20	\$983.20
Boot Lid Comfort Logo & Tel No. Sticker <i>Hec</i>	SN	1	\$ 35.00	\$ 35.00
Boot Lid Comfort Cablink Tel No. Sticker <i>Hf</i>	SN	1	\$ 30.00	\$ 30.00
Rear No. Plate + Trim Cover <i>cust order / dent</i>	SN	1	\$ 45.00	\$ 45.00
Rear Windscreen Sealant <i>Hec</i>	SN	2	\$ 46.00	\$ 92.00
Rear Bumper Reverse Sensor <i>Dan</i>	SN	1	\$ 180.00	\$ 180.00
SPARE TYRE PANEL TOP COVER SILICON <i>HN</i>	SN	1	\$ 250.00	\$ 250.00
SUB TOTAL				\$ 1,857.80
Labour Charge				
Panel Beating		1	\$2,800.00	\$2,800.00
Spray Painting Charge		1	\$2,200.00	\$2,200.00
Wiring Charge		1	\$100.00	\$100.00
Tuff Kote		1	\$100.00	\$100.00
Towing Charge		1	\$80.00	\$80.00
Remove/Refix Rear Windscreen Glass		2	\$120.00	\$240.00
Remove/Refix Reverse Sensor		1	\$120.00	\$120.00
Remove/Refix Exhaust Pipe		1	\$80.00	\$80.00
Four Wheel Alignment		1	\$120.00	\$120.00
Remove/Refix Undercarriage (Frt)		1	\$400.00	\$400.00
Remove/Refix Radiator		1	\$90.00	\$90.00
Remove/Refix Aircon & Refill Gas		1	\$130.00	\$130.00
Remove/Refix Steering Rack/Wheel/Dr Shaft		1	\$150.00	\$150.00
Diagnostic & Resetting To Erase Fault Code		1	\$550.00	\$550.00
Diagnostic & Resetting ADAS Optical sensor		1	\$550.00	\$550.00
TOTAL LABOUR				\$7,710.00
ESTIMATE TOTAL				\$49,448.70

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company. Please send your book value request to: claims_ltr@bifrostauto.com

30/06/2022 e 1700h

Not done

L/Sun 14 days.

3 you

LKK Auto

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

21,812.96

Supp 2,329.56

24,142.52

L/S 19,300/-

23,888.70

2,386.10

19,110.96

352.00

2350.00

BIFROST AUTO PTE LTD

REPAIR ESTIMATE (Supplementary)

DATE: 6-Jul-22

INSURANCE: China Taiping

MODEL: HYUNDAI IONIC

Brand Direct.

VEHICLE NO.: SHD 4531 S SHD 4750 B

Description	Qty	List Price	Amount
Spare Tyre Holder Top Board 1st	1	\$ 223.10	\$ 223.10
Rear Fender Trim Board (LH/RH) twin delayed	1	\$788.75	\$ 788.75
Assy BSD Blind Spot Radar (LH/RH) bracket 1st	1	\$ 1,784.40	\$ 1,784.40
SUB TOTAL			\$ 2,796.25
LESS 20%			\$ 559.25
DISCOUNTED TOTAL			\$ 2,237.00
SUB TOTAL			\$ 2,237.00
ESTIMATE TOTAL			\$ 2,237.00

338.80 ✓

✓

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company. Please send your book value request to: claims_ltr@bifrostable.com

R
1
n
2kk Auto

8

2911.95
20% 2,329.56