



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2302513

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 20/04/2023
Reference CC6/CTI22006312/Tya3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMP 2811A
Insured Veh. GBE 3196Z
Claim No. SNM22D204624/C02
Policy No. DMCVSNW00118542103
Accident Date 30/06/2022
Inspection Date 04/07/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22006312/Tya3q2	
			Date: 20/04/2023	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	GBE 3196Z	Veh. Inspected	SMP 2811A
	Policy No.	DMCVSNW00118542103	Coverage (\$)	0.00
	Claim No.	SNM22D204624/C02	Excess (\$)	0.00
	Assign From		Assign Date	04/07/2022
2. Vehicle Particulars & Condition				
	Make & Model	MINI COOPER 5DR HB	c.c	1499
	Engine No.	HIDDEN	Year of Reg.	2019
	Chassis No.	WMWXU720102L05971	Colour	RED
	Odometer	24356 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	205/45 R17	DUNLOP	6 mm
	L/H Front Tyre	205/45 R17	DUNLOP	6 mm
	R/H Rear Tyre	205/45 R17	DUNLOP	6 mm
	L/H Rear Tyre	205/45 R17	DUNLOP	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	30/06/2022	Inspection Date	04/07/2022
	Survey held at	AUTOMOTIVE REPAIR CENTRE PTE LTD 38 WOODLANDS INDUSTRIAL PARK E1 # 05-18 SINGAPORE 757700		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		2 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMP 2811A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER	TO REPAIR SEE LABOUR	1,080.70	-
1	REAR BUMPER SIDE RETAINER LH	NOT NECESSARY	176.70	-
1	REAR PARKING SENSOR LH	NOT NECESSARY	348.90	-
1	REAR PARKING SENSOR RETAINER LH	NOT NECESSARY	43.48	-
1	REAR TAIL LAMP LH	CUT	2,478.30	589.40
1	REAR TAILGATE LOGO (COOPER)	NECESSARY	86.80	86.80
	LESS 5% DISCOUNT		-210.74	-
	LESS 10% DISCOUNT		-	-67.62
			4,004.14	608.58
	<u>SPECIAL NETT ITEMS</u>			
10	REAR BUMPER CLIPS @\$5.00 (SN)	NECESSARY	50.00	30.00
			50.00	30.00
	<u>LABOUR</u>			
	REPAIR, REFIT, REMOVE AND REPLACE AFFECTED ACCIDENT PARTS. INCLUSIVE OF THE REPAIR OF REAR BUMPER.		400.00	200.00
	SPRAY PAINT (REAR BUMPER).		400.00	400.00
	REMOVE AND REFIT REAR BUMPER SENSOR.		100.00	30.00
	APPLY RUST PROOFING ON REPLACED / REPAIRED PANEL.	NOT NECESSARY	100.00	-
	CHECK AND RECTIFY ELECTRIC WIRING.		50.00	30.00
			1,050.00	660.00
	GRAND TOTAL		5,104.14	1,298.58
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			1,000.00

Report Ref No. CC6/CTI22006312/Tya3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMP 2811A

INSPECTION

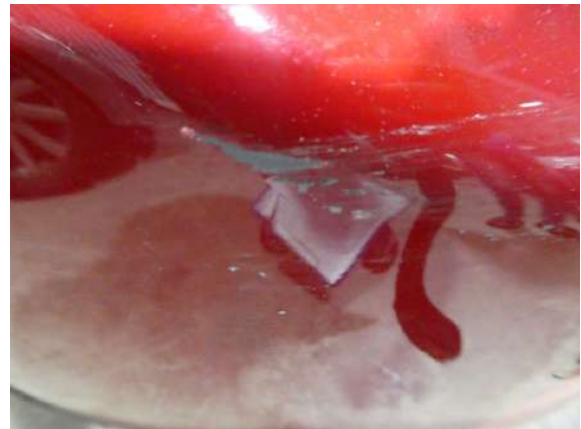



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMP 2811A

RE-INSPECTION

