

ASS. REC. BY:

REF:

ASM / 22006381/Kg

C

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

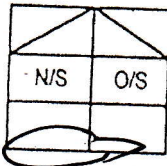
Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: 898k

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 04 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Library

Veh No: PCN 95814 Yr Regn: 05, 17Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: BMW X1 c.c. 1499Colour: 2. Silver A/C: Insured / Std / NI / NASp. Reading: 53094 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WBA14P120805H48854Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModl: Nil / S/Rlm / STD A/Rlm or

Tyre Size: F: _____

R: 225/50R18

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. 7 mm R/Bal. 7 mmL/Bal. 7 mm L/Bal. 7 mmD.O.A. 2/7/22 D.O.I. 7/7/2022Survey held at 11.20amDes. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

12/7 11.20am 83500 Curb (Red. \$4090, 90, 5490)

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: 4Resurvey No. of Trlp: 2

Survey Fee:

Transportation

S + RS. SI

F. P. S.

Others

TOTAL

Add Fee: ☐ : Site Insp (\$☐ : Interview (\$☐ : Tech Invs (\$☐ : Weekend (\$

Report Format :

Lump Sum / I.B.I: (\$ 3500)

Massive Trading & Auto

Blk 5034 #01-405 Ang Mo Kio Industrial Pk 2 Singapore 569541
Hp 91082728

Fax : 64816131

Choong Buat Ken
18 Stratton Drive
Singapore 806877

Vehicle No : SLN 9561 Y
Make/Model : BMW X1
Year : 2017

*Not Withheld
61 Rm @ 3500/hr
Resurvey B & P
9 days*

Qty	Description	Unit Price	Amount
-----	-------------	------------	--------

Estimate Cost Of Repair

1 pc	Rear end panel			<i>R</i>	\$480.00	<i>X</i>
1 pc	Rear end panel inner garnish			<i>1/2 R</i>	\$155.00	<i>X</i>
1 pc	Rear bumper	<i>903.40</i>		<i>my car</i>	\$985.00	<i>2</i>
1 pc	Rear bumper reinforcement	<i>496.35</i>		<i>R</i>	\$550.00	<i>2</i>
1 pc	Rear bumper inner bracket			<i>1/2 R</i>	\$205.00	<i>X</i>
1 pc	Rear bumper sponge			<i>1/2 R</i>	\$125.00	<i>X</i>
1 pc	Rear lower bumper			<i>R</i>	\$365.00	<i>1</i>
1 pc	Rear lower bumper cover			<i>1/2 R</i>	\$255.00	<i>1</i>
1 pc	Rear bumper lower garnish			<i>CM</i>	\$230.00	<i>1</i>
2 pcs	Rear bumper reverse sensor	<i>227.00</i>		<i>Shor</i>	\$328.00	<i>2</i>
2 pcs	Rear bumper side retainer				\$95.00	<i>1/2 R</i>
1 pc	Rear n/s bumper reflector			<i>1/2 R</i>	\$190.00	<i>X</i>
1 pc	Rear exhaust silencer	<i>1128</i>		<i>R</i>	\$75.00	<i>X</i>
1 pc	Rear exhaust heat shield			<i>R</i>	\$1,195.00	<i>2</i>
				<i>R</i>	\$135.00	<i>X</i>
					\$5,601.00	
					Less 10 %	\$560.10
						\$5,040.90

S Nett Item

15 pcs	Rear bumper clip	\$3.00	<i>1/2 R</i>	\$45.00	<i>1</i>
--------	------------------	--------	--------------	---------	----------

Labour Charges

Remove/renew the above accident parts including knocking, welding & cutting.	\$1,000.00	<i>2801</i>
To putty and spray paint	\$1,000.00	<i>5001</i>
Check & reconnect wiring.	\$45.00	<i>151</i>
Remove/renew rear exhaust silencer.	\$180.00	<i>601</i>
Remove/renew rear bumper sensor including reset same.	\$280.00	<i>601</i>

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Total
\$7,590.90