

金興(興)汽車私人有限公司

K. KIM HIN AUTO PTE LTD

160 Sin Ming Drive #02-18/19/20


Sin Ming AutoCity

Singapore 575722

Tel: 6452 7018 (5 Lines) Fax: 6458 3895

SJM045P7

269525

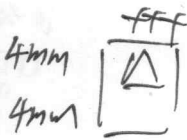

4mm Falken

4mm 265/65-R17

N/Aut - Tender
repair.

Your Reference : GA567298

Accident Date : 29-Jun-2022

No. : 32440

Date : 04-Jul-2022

Our Ref : 022130 / CARIN

PAGE : 1

AXA INSURANCE PTE LTD

ROBINSON ROAD

P.O BOX 1094

Singapore 902144

SAM
05/07/22 - 17:10 pm.

W/p - N/Authorize

5-w/days.

OIC: Gannet

XS-\$200- R/S Alpart & Term.

05/07/22

ESTIMATED COST OF REPAIR FOR TOYOTA PRADO 2.7TX A (2010) SBH1888H ✓

- 1 pc front bumper ✓ 4
- 2 pcs front bumper side retainer
X LH/RH X 2
- 1 pc front bumper centre beam ✓ 4
- 2 pcs front bumper side beam LH/RH ✓ 4
- 10 pcs front bumper clips ✓ Needs
- 1 pc front bumper lower centre grille ✓ 4
- 1 pc front bumper lower cover 7
- 1 pc front bumper sponge ✓ Cracked.
- 1 pc front bumper reinforcement
- 2 pcs front bumper reinforcement bracket LH/RH
- 2 pcs front bumper foglamp X LH/RH X
- 2 pcs front bumper foglamp cover
X LH/RH X
- 1 pc front bumper parking sensor ✓ Malfunction.
- 1 pc front grille ✓
- 2 pcs front grille top bracket LH/RH ✓ 4
- 10 pcs front grille clip ✓ Needs
- 1 pc front grille logo ✓
- 1 pc bonnet Repair
- 1 pc bonnet outer chrome ✓ Cracked.
- 1 pc bonnet inner seal X
- 1 pc bonnet insulator X
- 11 pcs bonnet insulator clip X
- 2 pcs bonnet hinge X LH/RH X
- 1 pc bonnet lock 7
- 1 pc bonnet lock cover X

Con't Page 2 ...

金興(龔)汽車私人有限公司

K. KIM HIN AUTO PTE LTD

160 Sin Ming Drive #02-18/19/20

Sin Ming AutoCity

Singapore 575722

Tel: 6452 7018 (5 Lines) Fax: 6458 3895

Your Reference : GA567298

Our Ref : 022130

Page : 2

No. : 32440

- 1 pc bonnet pull lock cable 7
- 1 pc bonnet pull lock cable cover X
- 1 pc front support panel Repair
- 2 pcs front support panel air guide LH/RH-? 44-?
- 1 pc front support panel top garnish X 82
- 10 pcs front support panel top garnish clip ✓ 44-?
- 1 pc front brace panel ✓ 44-?
- 2 pcs headlamp assy LH/RH ✓ 44-?
- 1 pc aircon condenser X
- 1 pc aircon condenser liquid pipe ✓ 44-?
- 1 pc aircon condenser discharge pipe 7
- 2 pcs horn LH/RH-? 44-?
- 1 pc steering airbag ✓ 44-?
- 1 pc steering clock spring ✓ 44-?
- 1 pc driver knee airbag ✓ 44-?
- 1 pc front passenger airbag ✓ 44-?
- 1 pc dashboard ✓ 44-?
- 2 pcs front airbag sensor ✓ 44-?
- 1 pc airbag control unit ✓ 44-?
- 2 pcs front seat belt LH/RH ✓ 44-?
- 2 pcs front seat belt buckle LH/RH-? 44-?

Add 10% : 0.00

0.00

- 1 pc front number plate ✓ 44-?

To remove, cut out damaged parts,
panel beating, welding, align,
refix and to renew affected parts.

Con't Page 3 ...

金興(龔)汽車私人有限公司

K. KIM HIN AUTO PTE LTD

160 Sin Ming Drive #02-18/19/20

Sin Ming AutoCity

Singapore 575722

Tel: 6452 7018 (5 Lines) Fax: 6458 3895

Your Reference : GA567298

Our Ref : 022130

Page : 3

No. : 32440

To focus headlamps. To check front wiring and lighting operation.

To remove aircon condenser, pipes and driers. Vaccum and recharge gas

To remove and renew front instrument panel assy, to rewiring and transfer instrument fittings.

To remove and renew air bag sensors seat belts assy, to rewiring and re-setting program

To putty and respray on affected portions.

Total : S\$ 0.00
=====