

ASS. REC. BY:

REF:

C721 2200 6694/KV

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No. DMPCSNW00097322100

Claims No. SNM22D204883/C01/TANKL

Sum Insured:

Excess:

12500

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

8165K

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

24

days

Res.: Yes or No

Lum Sum:

201871

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SLV 1888R Yr Regn: 10.19

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toy Vell fire c.c 2494

Colour

M. Black A/C: Insured / Std / NI / NA

Sp. Reading

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

JTNGF-30H80 8022645

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD / R/Rim or

Tyre Size:

F: 235/50R18

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

7 mm

R/Bal.

8 mm

L/Bal.

7 mm

L/Bal.

8 mm

D.O.A.

2/7/22

D.O.I.

15/7/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

N/S Rear & old body

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1 / Midnight case, M1 N/S rear too tired, Better Plot.
Sight inspection needed.

4/1/23

Lump Sum \$32,300 confirmed by email (red 19,184.66, 37%)

Date/Time, File Pass to?

☐

: Prel. Report

1)

☐

: Final Report

Date/Time, File Return to?

2) 5/1/23-typist

Days Of Repair: 24

Resurvey No. of Trip: 1

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Survey Fee:

Transportation:

S + RS. SI

F. + RS

Others

TOTAL

Report Format: Merimen

Lump Sum H.B.: (\$ 32,300

S&H Motor Pte Ltd
160 Sin Ming Drive #07-02
Sin Ming Autocity
Singapore 575722

Insurer Reference:
Repairer Reference: 048856
Date calculated: 09/07/2022 11:02 AM

Full Report
Registration: SLV1888R
Printed: 09/07/2022 11:10 AM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	SH Motor	Currency:	SGD
Claim Reference:		Date of Incident:	02/07/22
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle
 Manufacturer: TOYOTA
 Model: ALPHARD/VELLFIRE
 Sub Model: BASE MODEL
 Model Sheet Number: 70 VF 01
 Registration: SLV1888R
 VIN number: JTNGF3DH608022645
 Odometer:

Model Specs

FROM 05.2019
 DOOR LIGHT
 TRIM WOOD
 VERSION VELLFIRE
 TYRES 215/65 R16..H
 SUNROOF

EL VERSION
 RADIO WITH DISP 9.0
 CAPTAIN SEAT
 CHROME DOOR HANDLES
 WHEELS 7.5J X 18 ALU
 JAPAN VERSION

ADD REAR OUT MIRROR
 LED FOG LAMPS
 8-SEATER
 2.5 LTR 134 KW
 SPARE WHEEL
 TWO COAT METALLIC

HEATED DOOR MIRROR
 TAILGATE HSG BLACK
 PASS SEAT SLIDE
 CVT AUTO GEARBOX
 FRONT DRIVE
 PREPARE OFF VEHICLE

Not Notarized
Repairing
Ex 812506
1/1/2022

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
M050 ZAX	R + R FRONT ASSEMBLIES INCLUDES: R + R WHEELS, ENGINE WITH GEARBOX AND ENGINE SUPPORT, DETACH + REFIT CONTROL ARMS, TIE RODS, UPPER SUSPENSION STRUTS, DRIVE SHAFTS, STABILIZER AND FRONT EXHAUST, BLEED BRAKE SYSTEM		46.0	193.20
043233	ALIGN VEHICLE CPL		12.0	50.40
M250 ZAX	R + R REAR AXLE CPL INCLUDES: DETACH + REFIT SHOCK ABSORBERS BLEED REAR BRAKE SYSTEM		27.0	113.40
B040	RENEW BOTH HEADLAMPS (BUMPER REMOVED) INCLUDES: ADJUST HEADLAMPS		5.0	21.00
B030	RENEW RADIATOR GRILLE		6.0	25.20

Code	Description	WU	Price SGD
520011	RENEW FRONT BUMPER (RADIATOR GRILLE REMOVED) INCLUDES: FRONT BUMPER AND REQUIRED ATTACHED PARTS R + R	9.0	37.80
B140 NO NUMBER B010)	RENEW FRONT PANEL CPL RENEW R/FRT SIDE MEMBER R + R FRONT BUMPER REINFORCEMENT (BUMPER REMOVED) INCLUDES: ABSORBER REMOVE AND REFIT	13.0 17.0 2.0	54.60 71.40 8.40
531011)	RENEW L/FRT WING INCLUDES: WHEELHOUSE LINER AND REQUIRED ATTACHED PARTS R + R NOT INCLUDED: HEADLAMP AND R + R BUMPER	7.0	29.40
531011)	RENEW R/FRT WING INCLUDES: WHEELHOUSE LINER AND REQUIRED ATTACHED PARTS R + R NOT INCLUDED: HEADLAMP AND R + R BUMPER	7.0	29.40
30051	RENEW BONNET INCLUDES: R + R BONNET, ATTACH PARTS ASSEMBLE AND IF NEC RENEW	7.0	29.40
B080 530121 851091)	R + R BONNET HINGE/S R + R BONNET OPENER CABLE R + R WASHER RESERVOIR	1.0 10.0	4.20 42.00
B085)	R + R WIRE LINKAGE	3.0	12.60
554011	R + R WINDSCREEN (AIR GUIDE TRIM REMOVED) INCLUDES A-PILLAR TRIM, REAR VIEW MIRROR AND ALL REQUIRED ATTACHED PARTS R + R.	1.0 41.0	4.20 172.20
B085	R + R COWL PANEL TRIM INCLUDES: WIPER ARMS REMOVE AND REFIT	2.0	8.40
B085) 670301)	R + R WATER BOX CLOSING PANEL R + R L/F DOOR TRIM	2.0	8.40
670301)	R + R R/F DOOR TRIM	2.0	8.40
B216	RENEW L/R DOOR INCLUDES: R + R LEFT REAR DOOR AND ADJUST, ATTACH PARTS ASS IF NECESS RENEW	2.0 33.0	8.40 138.60
B270 NO NUMBER B420	RENEW L/R LOWER SIDE PANEL R + R TAILGATE INNER SIDE TRIM/S R + R L/R BUMPER TRIM	73.0 2.0	306.60 8.40
NO NUMBER 743401	R + R REAR BUMPER R + R RIGHT REAR LOWER SIDE TRIM	1.0 4.0	4.20 16.80
G030 B430	R + R LEFT REAR SIDE WINDOW GLASS R + R HEADLINING	5.0 22.0	21.00 92.40
893401) ZAX M230	R + R HEAD AIRBAG (COMPOSITE WORK) R + R UPPER INSTRUMENT PANEL	10.0 1.0	42.00 4.20
893111) M010	R + R PASSENGER AIRBAG DRAIN AIR CONDITIONING	16.0 13.0	67.20 54.60
NO NUMBER B440	R + R COMPRESSOR PIPE R + R LEFT FRONT SEAT	4.0 1.0	16.80 4.20
NO NUMBER 711731)	DIS/ASS LEFT FRONT SEAT R + R L/F SEAT BACKREST COVER	3.0 4.0 5.0	12.60 16.80 21.00

Code	Description	WU	Price SGD
B440	R + R RIGHT FRONT SEAT		
NO NUMBER	DIS/ASS RIGHT FRONT SEAT	3.0	12.60
711731)	R + R R/F SEAT BACKREST COVER	4.0	16.80
893401) ZAX	R + R L/HEAD AIRBAG	5.0	21.00
893401) ZAX	R + R R/HEAD AIRBAG	1.0	4.20
B450	R + R L/R 3RD ROW SEAT	1.0	4.20
B450	R + R R/R 3RD ROW SEAT	3.0	12.60
711501	R + R LEFT FRONT SEAT BELT	3.0	12.60
711501	R + R RIGHT FRONT SEAT BELT	4.0	16.80
893011	R + R AIRBAG CONTROL UNIT	4.0	16.80
893061)	R + R L/SIDE AIRBAG SENSOR	5.0	21.00
893061)	R + R R/SIDE AIRBAG SENSOR	2.0	8.40
881151 ZAX	RENEW CONDENSER	2.0	8.40
	(BUMPER REMOVED)	13.0	54.60
160011	INCLUDES: REFILL AIR CONDITIONING		
	RENEW RADIATOR		
	INCLUDES: BLEED COOLING SYSTEM	13.0	54.60
NO NUMBER	R + R HEAT SHIELD PANEL		
160251)	R + R DRIVE BELT	2.0	8.40
271011)	R + R ALTERNATOR	1.0	4.20
893361)	R + R L/F SIDE AIRBAG	1.0	4.20
893361)	R + R R/F SIDE AIRBAG	2.0	8.40
M240)	R + R CENTRE EXHAUST PIPE	2.0	8.40
170151	R + R REAR EXHAUST SECTION	2.0	8.40
420018)	R + R TYRE/S AND/OR WHEEL/S	5.0	21.00
420091)	R + R R/F WHEEL/TYRE	3.0	12.60
NO NUMBER	R + R FRONT AXLE CARRIER	2.0	8.40 ?
431011)	R + R R/F CONTROL ARM REAR	10.0	42.00
434211)	R + R R/F STEERING KNUCKLE	1.0	4.20
420091)	R + R L/R TYRE AND WHEEL	1.0	4.20
420091)	R + R R/R TYRE AND WHEEL	2.0	8.40 ?
473201)	DETACH + REFIT REAR BRAKE CALIPER	2.0	8.40 ?
042214)	BALANCE WHEEL/S	4.0	16.80
422041)	R + R L/R WHEEL HUB	1.0	4.20
	INCLUDES: R + R BRAKE DISC	1.0	4.20 ?
422041)	R + R R/R WHEEL HUB		
	INCLUDES: R + R BRAKE DISC	1.0	4.20 ?
422041)	R + R REAR WHEEL HUB		
NO NUMBER	R + R L/REAR DRIVE SHAFT END	1.0	4.20 ?
NO NUMBER	R + R R/REAR DRIVE SHAFT END	7.0	29.40 ?
NO NUMBER	R + R REAR AXLE CARRIER	7.0	29.40 ?
1481	LEFT FRONT DOOR REPAIR	9.0	37.80 ?
1482	RIGHT FRONT DOOR REPAIR	20.0*	84.00 ?
1782	R/R DOOR REPAIR	20.0*	84.00 ?
2581	REAR BUMPER REPAIR	30.0*	126.00 ?
		15.0*	63.00 ?
Labour Cost			
Panel / Mechanical Labour		Hrs	WU
Alignment		62.20	622.0
Measuring Work		1.20	12.0
Total of Labour			2,662.80

} check consistency

Paint

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description - TWO COAT METALLIC	WU	Price SGD
	BONNET NEW PART PAINTING	18.0	
	L/F WING NEW PART PAINTING	12.0	
	R/F WING NEW PART PAINTING	12.0	
	FRT LWR RAD SUPPORT SURFACE PAINT	4.0	
	FRT LOCK CARRIER SURFACE PAINT	4.0	
	CTR PNL CARRIER BAR SURFACE PAINT	4.0	
	L/RADIATOR BRACKET SURFACE PAINT	4.0	
	R/RADIATOR BRACKET SURFACE PAINT	4.0	
	R/F SIDE MEMBER CPL SURFACE PAINT	5.0	
	L/R DOOR NEW PART PAINTING	19.0	?
	L/R LOWER SIDE PANEL NEW PART PAINTING	32.0	?
	FRONT BUMPER NEW PART PAINT K1G	23.0	
	LEFT FRONT DOOR REPAIR PAINTING <50%	18.0	?
	RIGHT FRONT DOOR REPAIR PAINTING <50%	18.0	?
	R/R DOOR REPAIR PAINTING <50%	20.0	?
	REAR BUMPER REPAIR PAINT PLASTIC	13.0	?

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	52.63
0741	L/F WING NEW PART PAINTING	26.32
0742	R/F WING NEW PART PAINTING	26.32
1016	FRT LWR RAD SUPPORT SURFACE PAINT	2.99
1017	FRT LOCK CARRIER SURFACE PAINT	2.99
1187	CTR PNL CARRIER BAR SURFACE PAINT	2.99
1189	L/RADIATOR BRACKET SURFACE PAINT	2.99
1190	R/RADIATOR BRACKET SURFACE PAINT	2.99
1202	R/F SIDE MEMBER CPL SURFACE PAINT	4.98
1781	L/R DOOR NEW PART PAINTING	59.86
3481	L/R LOWER SIDE PANEL NEW PART PAINTING	45.10
0281	FRONT BUMPER NEW PART PAINT K1G	74.84
1481	LEFT FRONT DOOR REPAIR PAINTING <50%	32.95
1482	RIGHT FRONT DOOR REPAIR PAINTING <50%	32.95
1782	R/R DOOR REPAIR PAINTING <50%	37.47
2581	REAR BUMPER REPAIR PAINT PLASTIC	31.59

Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint			210.0	
Preparation Main Work Metal		2.50	25.0	105.00
Preparation Comp. Work Plastic		0.80	8.0	33.60
Total	10 WU/h	24.30	243.0	1,020.60

Material Cost - Paint

New Part Painting	Price SGD
New Part Painting - Plastic K1G	210.23
Repair Painting	74.84
Repair Painting Plastic	103.37
Surface-/Blend Paint	31.59
Material-constant Metal Preparation	19.93
Material-constant Plastic	28.60
Total	481.26

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01/01	
				Price SGD	
0281	FRONT BUMPER	52119 58983	Original	R ₁ 350.00	✓
0293	L/F BUMPER COVER	52128 58170	Original	R ₁ 60.00	✓
0294	R/F BUMPER COVER	52127 58300	Original	R ₁ 60.00	✓
0317	L/F BUMPER BRACKET	52116 58090	Original	CM 70.00	✓
0318	R/F BUMPER BRACKET	52115 58090	Original	CM 70.00	✓
0327	FRT BUMPER ABSORBER	52611 58050	Original	CM 70.00	✓
0340	BUMPER SUPPORT	52021 58030	Original	R ₁ 190.00	✓
0347	L/FOG LAMP COVER	52040 58170	Original	R ₁ 130.00	X
0348	R/FOG LAMP COVER	52030 58170	Original	R ₁ 130.00	X
0375	LWR RADIATOR GRILLE	53112 58180	Original	CM 130.00	✓
0410	GRILLE	53101 58410	Original	CM 580.00	✓
0423	BUMPER MOULDING	53105 58050	Original	CM 330.00	✓
0431	BADGE TOYOTA	75301 58260	Original	CM 75.00	✓
0471	BONNET	53301 58060	Original	R ₁ 280.00	✓
0473	BONNET MOULDING	75770 58140	Original	CM 230.00	✓
0475	L/F HINGE	53420 58080	Original	D ₁ 65.00	✓
0476	R/F HINGE	53410 58060	Original	D ₁ 65.00	✓
0493	BONNET LOCK	53510 58080	Original	R ₁ 90.00	✓
0500	BONNET CABLE	53630 58050	Original	60.00	?
0561	LEFT HEADLAMP ASSY	81185 58570	Original	M ₁ 1,600.00	✓
0562	RIGHT HEADLAMP ASSY	81145 58570	Original	M ₁ 1,600.00	✓
0637	L/F FOG LAMP CPL	81220 48051	Original	R ₁ 150.00	X
0638	R/F FOG LAMP CPL	81210 48051	Original	R ₁ 150.00	X
0741	L/F WING	53802 58160	Original	R ₁ 380.00	✓
0742	R/F WING	53801 58070	Original	R ₁ 380.00	✓
0743	L/F WING RR MOULDING	53883 58010	Original	180.00	?
0744	R/F WING RR MOULDING	53882 58030	Original	180.00	?
0841	L/F WHEELHOUSE COVER	53806 58110	Original	CM 160.00	✓
0842	R/F WHEELHOUSE COVER	53805 58090	Original	CM 160.00	✓
1016	FRT LWR RAD SUPPORT	53028 28050	Original	R ₁ 130.00	✓
1017	FRT LOCK CARRIER	53205 58080	Original	R ₁ 190.00	✓
1027	L/AIR FUNNEL	52546 58070	Original	CM 60.00	✓
1028	R/AIR FUNNEL	52545 58070	Original	CM 60.00	✓
1029	UPPER AIR GUIDE	53106 58111	Original	150.00	?
1187	CTR PNL CARRIER BAR	53209 58040	Original	R ₁ 50.00	✓
1189	L/RADIATOR BRACKET	53203 58060	Original	R ₁ 220.00	✓
1190	R/RADIATOR BRACKET	53202 58050	Original	R ₁ 220.00	✓
1202	R/F SIDE MEMBER CPL	57101 58040	Original	R 1,300.00	?
1331	BATTERY HOLDER	74431 42090	Original	75.00	?
1335	UPP BATTERY BRACKET	74404 58050	Original	60.00	?
1401	WINDSCREEN	56101 58440	Original	CM 750.00	✓

Code	Description	Part Number	Part Source	Price SGD
1411	WINDSCREEN BOND KIT	PZ49I 00C1131		0.00
1414	FRONT SCREEN PIPING	56115 30120		0.00
1415	FRONT SCREEN PIPING	56116 22050		0.00
1419	LWR W-SCREEN MLDG	56117 50130	Original	180.00 ✓
1436	WASHER CONTAINER	85315 58030	Original	150.00 ✓
1781	L/R DOOR	67004 58080	Original	1,300.00 ?
1847	L/R WINDOW	69802 30280	Original	230.00 ?
	REGULATOR			
1851	L/R WINDOW MOTOR	85720 58050	Original	350.00 ?
3481	L/R LOWER SIDE PANEL	61602 58110	Original	480.00 ?
3807	L/SIDE WINDOW	62720 58260		0.00
3861	L/SIDE WDW SEAL KIT	PZ49I 00C1131		0.00
4325	PASSENGER AIRBAG	73960 58030	Original	1,450.00 ✓
4331	INSTRUMENT PANEL	55400 58030C0	Original	1,500.00 ✓
4341	KNEE AIRBAG	73900 58030C0	Original	1,200.00 ✓
4465	CONDENSER CPL	88460 58040	Original	550.00 ✓
4481	COMPR OUTL LINE	88711 58130	Original	360.00 ✓
4482	CONDENS OUTL LINE	88710 58180	Original	160.00 ✓
4589	L/F BACKREST COVER	71074 58681C2	Original	320.00 ✓
4590	R/F BACKREST COVER	71073 58711C4	Original	320.00 ✓
4607	L/F SIDE AIRBAG	73920 42060	Original	450.00 ✓
4608	R/F SIDE AIRBAG	73910 58040	Original	450.00 ✓
4611	L/F SIDE AIRBAG SENS	89831 58010	Original	200.00 ✓
4612	R/F SIDE AIRBAG SENS	89831 58010	Original	200.00 ✓
4621	L/ITS HEAD AIRBAG	62180 58030	Original	1,300.00 ✓
4622	R/ITS HEAD AIRBAG	62170 58030	Original	1,700.00 ✓
4661	L/F SEAT BELT	73220 58071C0	Original	1,150.00 ✓
4662	R/F SEAT BELT	73210 58061C1	Original	1,150.00 ✓
4957	HEADLINING	63304 58720A1	Original	3,800.00 ✓
7054	R/F TRACK CONT ARM	48068 28140	Original	190.00 X
7066	R/CARRIER JOINT	43330 59155	Original	80.00 X
7082	R/F STEERING KNUCKLE	43211 78010	Original	250.00 X
7132	R/F WHEEL HUB	43550 28030	Original	290.00 X
7202	R/FR WHEEL	42611 58340	Original	950.00 X
7405	AIRBAG	45130 58040C0	Original	1,300.00 ✓
7435	SLIP RING	84307 58030	Original	350.00 ✓
7440	AIRBAG CONTROL UNIT	89170 58120	Original	1,380.00 ✓
7761	RADIATOR CPL	16400 28711	Original	650.00 ?
7767	RADIATOR SHROUD	16711 28420	Original	140.00 ?
7773	RADIATOR OUTLET HOSE	16572 36180	Original	70.00 ?
7775	L/UPP RADIATOR HOSE	16571 36190	Original	65.00 ?
7787	EXPANSION TANK	16470 28152	Original	140.00 ✓
7793	L/BLOWER FAN	16361 28370	Original	120.00 ?
7794	R/BLOWER FAN	16361 28380	Original	120.00 ?
7797	L/FAN MOTOR	16363 36200	Original	280.00 ?
7798	R/FAN MOTOR	16363 36210	Original	280.00 ?
8373	LOWER INTAKE HOUSING	17896 36030	Original	75.00 X
8375	AIR INTAKE HOSE	17751 36130	Original	95.00 X
8376	AIR HOSE ADAPTER	17752 36040	Original	80.00 ?
8411	ALTERNATOR	27060 0V280	Original	1,150.00 ?
8433	ALTERNATOR BELT	90916 02732	Original	95.00 ?
8781	FRT ENG COMP PROTECT	51440 58030	Original	140.00 ✓
8804	UPPER HEAT SHIELD	17168 36010	Original	130.00 ?
9121	L/R STABILIZER ARM	48790 58010	Original	250.00 ?
9127	L/R STRG KNUCKLE	42305 58010	Original	350.00 ?

Code	Description	Part Number	Part Source	Price SGD	
9128	R/R STRG KNUCKLE	42304 58010	Original	350.00	?
9181	L/R WHEEL HUB	42450 28030	Original	250.00	?
9182	R/R WHEEL HUB	42450 28030	Original	250.00	?
9201	L/RR SHOCK ABSORBER	48530 58110	Original	110.00	?
9551	L/RR WHEEL	42611 58340	Original	950.00	?
9552	R/RR WHEEL	42611 58340	Original	95.00	?
9645	LOW TONE HORN	86520 30670	Original	90.00	?
9646	HIGH TONE HORN	86510 48190	Original	90.00	?
1000	LH HEADLAMP ECU	LH HEAD LAMP	Original	350.00	?
1001	RH HEADLAMP ECU	RH HEAD LAMP	Original	350.00	?
1002	L/R DOOR LWR MLDING	LH REAR DOOR	Original	290.00	?
1003	L/R FENDER LWR TRIM	LH REAR FENDER	Original	180.00	?
8374	RH HORN BRACKET	HORN	Original	55.00	?
8375	LH HORN BRACKET	HORN	Original	55.00	?

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings 0.00
Subtotal 42,675.00
Fixed Sundry Parts Price 100.00
Total 42,775.00

Extras

Code	Description	Price SGD	
0293	[S]: L/F BUMPER COVE R: TOW COVER	0.00*	
0294	[S]: R/F BUMPER COVE R: TOW COVER	0.00*	
1004	AIRBAG ECU PROGRAM A/B ECU	380.00*	250
1005	Electrical work Electrical work	25.00*	✓
1006	Engine coolant Engine coolant	30.00*	✓
1007	FNT W/S INNER SEAL FRNT WINDSCREEN	35.00*	✓
1008	Air con coolant Air con	50.00*	✓
1009	FRONT W/S SEALANT FRNT WINDSCREEN	20.00*	✓
1010	Front number plate Number Plate	35.00*	✓
1011	Wheel alignment Wheel alignment	60.00*	✓
1187	[S]: CTR PNL CARRIER BAR: FRONT SUP	0.00*	
1187	PORT PANEL LOWER	0.00*	
1189	[S]: L/RADIATOR BRAC KET: FRONT SUPP	0.00*	
1189	ORT PANEL LH	0.00*	
1190	[S]: R/RADIATOR BRAC KET: FRONT SUPP	0.00*	
1190	ORT PANEL RH	0.00*	
4607	[S]: L/F SIDE AIRBAG : SEAT AIRBAG	0.00*	
4608	[S]: R/F SIDE AIRBAG : SEAT AIRBAG	0.00*	
7405	[S]: AIRBAG: STEERIN G WHEEL	0.00*	
7435	[S]: SLIP RING: CLOC KSPRING	0.00*	
8373	[S]: LOWER INTAKE HO USING: AIR RESO	0.00*	
8373	NATOR BOX	0.00*	
8376	BATTERY BATTERY	220.00*	?
8377	L/R QTR GLAS SEALANT L/R QTR GLASS	35.00*	?
8378	L/R QR GLAS INN SEAL L/R QTR GLASS	35.00*	?
Total Extras		925.00	

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and issued to final approval from Insurance Company

Audatex System Using Manufacturer Times

Page 7 of 8 PRINTED DATE 09/07/2022

Acknowledged by Repairer

Signature:

Date:

Final Calculation

	SGD	SGD
Parts		
Fixed Sundry Parts Price	42,675.00	
Total Parts	100.00	42,775.00
Labour Time Base 10 WU/h		
Total 622.0 WU X 42.00 SGD/h		
Alignment	2,612.40	
Measuring Work	50.40	
Total of Labour		2,662.80
Total Of Extras		925.00
Paint Work Time Base 10 WU/h		
Labour Cost 243.0 WU X 42.00 SGD/h	1,020.60	
Material Cost	481.26	
Total Paint Including Material		1,501.86
Repair Cost Excludes GST		47,864.66
GST (+7.0%)		3,350.53
Repair Cost Included GST		51,215.19

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Singapore NRIC

Owner ID:

486B

Vehicle Details

Vehicle No.:

SLV1888R

Vehicle to be Exported:

Yes

Intended Deregistration Date:

05 Jul 2022

Vehicle Make:

TOYOTA

Vehicle Model:

VELLFIRE ELEGANCE MOONROOF (AUTO)

Primary Colour:

Black

Manufacturing Year:

2019

Engine No.:

2ARJ291182

Chassis No.:

JTNGF3DH608022645

Maximum Power Output:

134.0 kW (179 bhp)

Open Market Value:

\$48,189.00

Original Registration Date:

18 Oct 2019

First Registration Date:

18 Oct 2019

Transfer Count:

1

Actual ARF Paid:

\$59,465.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

17 Oct 2029

PARF Rebate Amount:

\$44,598.00

Intended COE Rebate Details

COE Expiry Date:

17 Oct 2029

COE Category:

B - Car above 1600cc or 97kW (130bhp)

COE Period(Years):

10

QP Paid:

\$41,361.00

COE Rebate Amount:

\$30,120.00

Total Rebate Amount:

\$74,718.00

The information contained herein is correct as at 05 Jul 2022

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	05/07/2022 17:11 (SGT)
Reported by	Driver
Date of Accident	02/07/2022 02:40 (SGT)
Exact Location of Accident	Clemenceau Ave, Singapore
Additional Location Information	traffic junction of Merchant Road towards Clemenceau Ave
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLV1888R
INSURED/POLICYHOLDER	
Is company?	No
Name Of Registered Owner	Poh Kee Guan Richard
NRIC No	SXXXX486B
Email Address	ricpkg@gmail.com
Mobile Phone No	(Phone) +65-83839090
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Toyota
Model	Vellfire
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car
Transmission	Auto
CC	2494

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number	DMPCSNW00097322100

DRIVER

Name of Driver	Tan Wei Sian
NRIC No	SXXXX224C
Date Of Birth	27/06/1991
Occupation	Outdoor

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Traffic Police Department for investigation.**
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the making of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
(collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and


(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be cited outside of Singapore, for one or more of the above Purposes.

Policyholder's Signature / Date & Time

Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel
(Name as in NRIC/ID card)

Sketch Plan

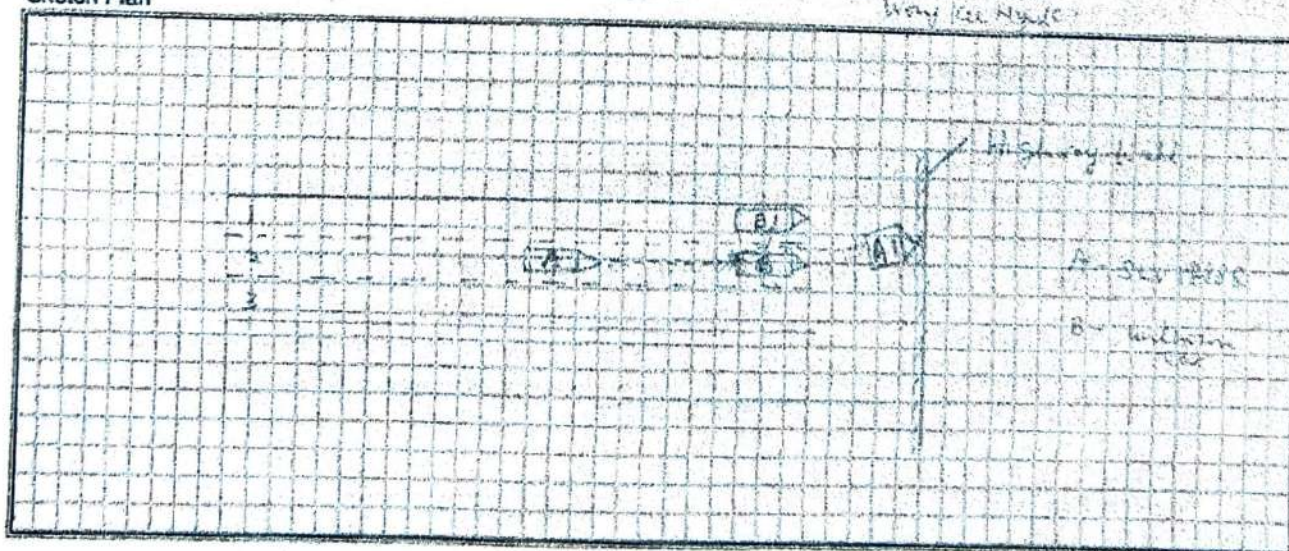



**SINGAPORE
POLICE FORCE**



T/20220705/2041

2 of 3

Police Station Of Origin:
Thomson NPP
25 Sin Ming Road #01-180 SINGAPORE
570025
Tel No: 1800-4529999

Report No. T/20220705/2041

CONTINUATION OF REPORT

Driver				
Name	TAN WEI SIAN		ID No.	S9123224C
Related Vehicle	SLV1888R (Car)		Contact No.	81896205
Hospital/Clinic	NIL		Class of Driving Licence & Expiry Date	Class: 3A Date of Expiry: NIL
Date Treatment	NIL		Date Discharge	NIL
No. of Days granted Medical Leave	NIL		Degree of Injury	NIL

Brief Details.

On 02/07/2022, at about 2.40am, I was driving my vehicle along Merchant Road towards Clemenceau Ave. When the traffic light turned red, I could not react on time and collided to another vehicle rear portion. After the collision, due to the strong force, the vehicle in front of me landed on the first lane while my car surge forward and hit against the front of the highway wall. Due to the enormous impact, all airbags were deployed and I instantly suffered a moment of shock and blackout for a few seconds. After the collision, my car landed in front of the highway wall, front portion, right and left portion were all damaged. I did not take the other party particulars as I was in a state of shock. Shortly later, I left the accident scene, my vehicle had to be towed away as it was badly damage. On the following day, I felt pain on the back and subsequently see a doctor and was given 3 days MC.