

ASS. REC. BY:

REF:

AGG/ 220067701Kc

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

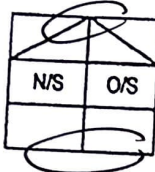

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

07 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SHD 104 T

Yr Regn:

08, 19

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toy Rnt

c.c

1788

Colour

M.P. White / Red

A/C:

Insured / Std / NI / NA

Sp. Reading

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

JTDKB3FU

003083247

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD / Rim or

Tyre Size:

F:

195/65R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Sailor

Front

Rear

R/Bal.

5

mm

R/Bal.

6

mm

L/Bal.

5

mm

L/Bal.

6

mm

D.O.A.

24/6/22

D.O.I.

18/7/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

& 1st

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1 Grot BZ, Battery Flat

Date/Time, File Pass to?



: Prell. Report

1)



: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS. SI

Fees

Others

TOTAL

Add Fee:



: Site Insp (\$



: Interview (\$



Tech Invs (\$



Weekend (\$

Report Format :

Lump Sum / I.B.I: (\$

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD104T*Not Notified*
*1/1/2022***AAD2207-**

Vehicle No.:

Chassis No.:

Co UEN:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration:

18 JUL 2022**SHD104T**

JTDKB3FU003083247

200303878K

TOYOTA

PRIUS

24/06/2022

SLJ9760K/AUTO GEN

30/08/2019

PART

- 1 COVER, REAR BUMPER
- 1 REINFORCEMENT SUB-ASSY, REAR BUMPER
- 1 COVER, REAR BUMPER, LOWER
- 1 GUARD, REAR BUMPER, CENTER
- 1 RETAINER, REAR BUMPER SIDE, LH
- 1 RETAINER, REAR BUMPER SIDE, RH
- 1 FILLER, REAR BUMPER EXTENSION, RH
- 1 FILLER, REAR BUMPER EXTENSION, LH
- 1 LENS & BODY, REAR COMBINATION LAMP, LH (**UPPER**)
- 1 LENS AND BODY, REAR LAMP, LH (**LOWER**)
- 1 LENS AND BODY, REAR LAMP, RH (**LOWER**)
- 1 LENS & BODY, REAR COMBINATION LAMP, RH (**UPPER**)
- 1 COVER, REAR COMBINATION LAMP, LH
- 1 COVER, REAR COMBINATION LAMP, RH
- 1 COVER, FLOOR UNDER, NO.1 LH
- 1 COVER, FLOOR UNDER, NO.2 RH
- 1 COVER, REAR FLOOR CTR
- 1 COVER, DECK TRIM, REAR
- 1 PANEL SUB-ASSY, BODY LOWER BACK
- 1 PANEL SUB-ASSY, BACK DOOR
- 1 GLASS, BACK WINDOW FIX
- 1 MOULDING, BACK WINDOW, LOWER NO.2
- 1 MOULDING, BACK WINDOW, OUTSIDE LH NO.2
- 1 MOULDING, BACK WINDOW, OUTSIDE RH NO.2
- 1 DAM, BACK DOOR GLASS ADHESIVE, NO.2
- 1 WEATHERSTRIP, BACK DOOR
- 1 GARNISH SUB-ASSY, BACK DOOR, OUTSIDE
- 1 BOARD ASSY, BACK DOOR TRIM
- 1 STAY ASSY, BACK DOOR, LH
- 1 STAY ASSY, BACK DOOR, RH
- 1 HINGE ASSY, BACK DOOR, LH
- 1 HINGE ASSY, BACK DOOR, RH
- 1 BOX, DECK FLOOR, RH
- 1 BOX, DECK FLOOR, LH

LIST		
\$	<i>At 1/2</i>	442.60 ✓
\$	<i>R</i>	332.70 ✓
\$	<i>mir</i>	15.40 ✓
\$	<i>mir</i>	576.30 ✓
\$	<i>CM</i>	116.50 ✓
\$	<i>CM</i>	117.70 ✓
\$	<i>mir</i>	123.70 ✓
\$		123.70 ?
\$	<i>CM</i>	443.30 ✓
\$	<i>Br</i>	502.00 ✓
\$	<i>SL</i>	502.00 X
\$	<i>SL</i>	451.80 X
\$		64.50 ?
\$	<i>SL</i>	64.50 X
\$		175.10 ?
\$		241.90 ?
\$	<i>mir</i>	229.90 ✓
\$	<i>SL</i>	126.70 X
\$	<i>R</i>	650.30 ✓
\$	<i>R</i>	1,147.80 ✓
\$	<i>Photo</i>	761.40 ✓
\$	<i>SL</i>	23.60 ✓
\$	<i>SL</i>	30.90 ✓
\$	<i>SL</i>	30.90 ✓
\$	<i>SL</i>	28.90 ✓
\$		372.30 ?
\$	<i>mir</i>	925.60 ✓
\$		259.20 ?
\$	<i>SL</i>	242.50 X
\$	<i>SL</i>	242.50 X
\$	<i>R</i>	61.00 X
\$	<i>R</i>	61.00 X
\$		313.60 ?
\$		313.00 ?

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

AAD2207-

SHD104T

1	BOARD, REAR FLOOR, NO.1
1	BOX, DECK FLOOR, REAR
1	PANEL ASSY, DECK TRIM SIDE, LH
1	PANEL ASSY, DECK TRIM SIDE, RH
1	REAR TAILGATE TOYOTA LOGO
1	REAR TAILGATE WORDING 'PRIUS'
1	REAR TAILGATE WORDING 'HYBRID'
1	PIPE ASSY, EXHAUST, TAIL
1	COVER, FRONT BUMPER
1	BRACKET, FRONT BUMPER EXTENSION MOUNTING
1	REINFORCEMENT SUB-ASSY, FRONT BUMPER
1	ABSORBER, FRONT BUMPER, LOWER
1	ABSORBER, FRONT BUMPER ENERGY
1	SUPPORT, FRONT BUMPER SIDE, RH
1	SUPPORT, FRONT BUMPER SIDE, LH
1	UNIT ASSY, HEADLAMP, LH
1	UNIT ASSY, HEADLAMP, RH
1	GRILLE SUB-ASSY, RADIATOR
1	GRILLE, RADIATOR, LOWER NO.1
1	EMBLEM ASSY, RADIATOR GRILLE
1	SUPPORT, RADIATOR, UPPER RH
1	SUPPORT, RADIATOR, UPPER LH
1	SUPPORT SUB-ASSY, RADIATOR, UPPER
1	HOOD SUB-ASSY
1	HINGE ASSY, HOOD, LH
1	HINGE ASSY, HOOD, RH
1	BRACE, HOOD LOCK SUPPORT
1	INSULATOR, HOOD
1	LOCK ASSY, HOOD

\$	519.00	X
\$	105.80	X
\$	355.90	?
\$	355.90	?
\$	47.90	—
\$	54.60	—
\$	54.60	—
\$	1,649.00	?
\$	516.00	✓
\$	103.40	?
\$	716.60	?
\$	132.70	?
\$	79.60	?
\$	80.10	✓
\$	82.30	X
\$	2,637.60	✓
\$	2,637.60	?
\$	346.00	✓
\$	170.10	?
\$	90.80	✓
\$	78.90	X
\$	78.90	X
\$	377.10	?
\$	983.10	✓
\$	58.90	?
\$	58.90	?
\$	78.30	X
\$	410.90	X
\$	135.00	X
TOTAL	\$ 23,110.30	
25%	\$ 5,777.58	
	\$ 17,332.73	

Special Nett

1SET	PARKING AID
1SET	REAR BUMPER CLIP
2	WINDSCREEN SEALANT
1	WINDSCREEN MOULDING
1	WINDSCREEN INNER SPONGE SEAL
1	REAR TAILGATE STICKER "Trans-Cab"
1	REAR TAILGATE STICKER "6555-3333"
1	REAR BUMPER PROTECTOR
2	SEAM SEALANT
1SET	REAR BUMPER RETAINER CLIP

\$	700.00	2201A
\$	95.00	601A
\$	150.00	801A
\$	200.00	—
\$	130.00	301A
\$	80.00	301A
\$	80.00	301A
\$	180.00	301A
\$	250.00	X
\$	85.00	X

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

AAD2207-

SHD104T

- 1 REAR NUMBER PLATE WITH HOLDER
- 1SET TAILLAMP LOWER CLIP
- 1SET TAILLAMP UPPER CLIP
- 1 END PANEL TRIM CLIP
- 1SET BUMPER CLIP FRT
- 1 FRONT NUMBER PLATE WITH MOULDING
- 1SET CLIP, FRONT FENDER LINER
- 1SET FRNT BUMPER RETAINER CLIP
- 1 HOOD INSULATOR CLIP

\$	By	140.00	455N
\$	na	55.00	—
\$	na	55.00	—
\$		65.00	7
\$	na	95.00	605N
\$	na	200.00	455N
\$	na	85.00	X
\$	na	85.00	X
\$	na	55.00	X
TOTAL		\$ 2,785.00	

TOTAL PARTS \$ 20,117.73**LABOUR**

To Remove And Refit Rear Big and Small W/Screen Glass To Facilitate Bodywork Repair.	\$	300.00	1801
To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	380.00	801
Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same	\$	2,200.00	1000
To transfer of rear end panel fittings, attachment and perform water seepage test.	\$	na 380.00	X
To transfer of Tailgate fittings, attachments and perform water seepage test.	\$	180.00	601
To remove and refit electrical wiring, battery and other necessary items to facilitate bodywork repair.	\$	na 480.00	X
To transfer of Fender fittings, attachments and perform water seepage test.	\$	na 480.00	X
To dismantle and refit aircon assy and attachment, vacuum and charge-in-gas.	\$	na 380.00	X
Labour charge to mount and dismount vehicle on jig bench, to facilitate repair.	\$	na 380.00	X
To check steering geometry and computer wheel alignment	\$	na 220.00	X

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD104T**AAD2207-**

To Rust-Proofing and apply undercoat Of The Affected Areas.	\$	250.00	601
Towing Fees	\$	150.00	501
Putty And Spray Painting Of The Affected Portion.	\$	2,200.00	11001
To reinstall rear bumper parking sensor.	\$	170.00	501
To Check Electrical Lighting Concerned.	\$	170.00	401
To transfer of luggage floor panel fittings, attachment and perform water seepage test.	\$	un 380.00	X
To transfer of tire, rim and on wheel balancing.	\$	4 220.00	X
To replace, refix and top up coolant for radiator	\$	4 170.00	X
To lift-up / out engine with gear box and refit.	\$	4 440.00	X
To remove and refit radiator support cross-member and other necessary items to enable bodywork repair.	\$	4 380.00	X
To conduct and perform a comprehensive vehicle diagnostic check and reset vehicle warning indicators.	\$	4 380.00	X
TOTAL	\$	10,290.00	
Over All Total	\$	30,407.73	

(PART-BY-PART) Repair Days~~25 DAYS~~

7 days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	27/06/2022 16:17 (SGT)
Reported by	Driver
Date of Accident	24/06/2022 21:25 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	PIE TOWARDS CHANGI BEFORE EUNOS LINK EXIT 9
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHD104T
INSURED/POLICYHOLDER	
Is company?	Yes
Name Of Registered Owner	TRANS-CAB SERVICES PTE LTD
Company Reg No	2XXXXX878K
Email Address	claims@transcab.com.sg
Mobile Phone No	(Phone) +65-62876666
Alternative Phone No	(Office) +65-62876666

VEHICLE PARTICULARS

Manufacturer	Toyota
Model	PRIUS 5 DR HATCHBACK (AUTO)
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private hire
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Taxi
Transmission	Auto
CC	1798


INSURANCE COMPANY

Name of Insurance Company	AXA Insurance Pte Ltd
Policy Number / Cover Note Number	VFX/P2413997

DRIVER

Name of Driver	TAY ENG BENG
NRIC No	SXXXX298G
Date Of Birth	19/10/1966
Occupation	Outdoor

Exit 9
Jalan Eunos/
Eunos Link

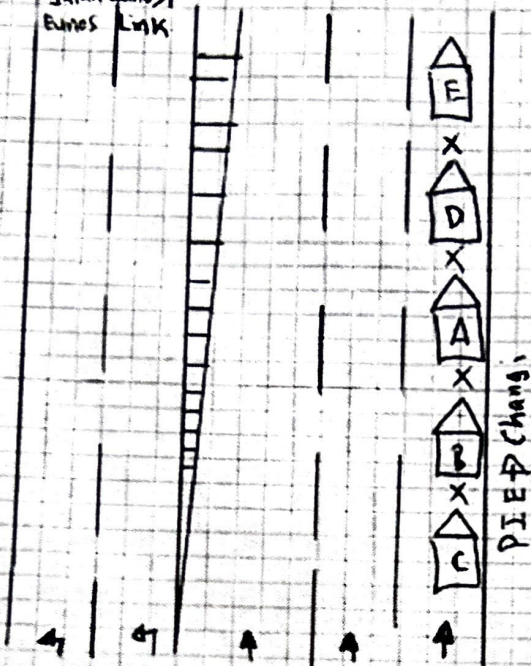

veh A: SHD104J

veh B: SLJ9760K

veh C: SLP7593H

veh D: SJA3963D

veh E: SHB3909D

VERIFIED BY AJAX MARS (ARC)
REPORTING OFFICER
ANG QI HAO, VICTOR

Policyholder's Signature
Date & Time:

AY
Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.: