

ASS. REC. BY:

REF:

C121

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: 823k

IDAC Accident Report: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: days Res.: Yes or No

Lum Sum: % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: Person Contacted:

Vehicle: IN / OUT

MAY 2022

Veh No:

SKT 99036 Yr Regn: 05.13

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Peugeot 5008 c.c. 1598

Colour:

M. Red A/C: Insured / Std / NI / NA

Sp. Reading

190040 T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

VI-30E5FVACS252183

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: NII / S/Rim / STD A/Rim or

Tyre Size:

F:

R:

215/55R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

R/Bal.

L/Bal.

L/Bal.

D.O.A.

D.O.A.

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐

Prell. Report

1) ☐ : Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS. SI

Fees

Others

Add Fee:

☐

Site Insp (\$)

☐

Interview (\$)

☐

Tech Invs (\$)

☐

Weekend (\$)

TOTAL

Report Format :

Lump Sum / I.B.I: (\$)

Auto Insure Pte. Ltd
6 Marsiling Lane
739145



Full Report
Registration: SKJ9903C
Printed: 16/07/2022 12:59 PM

Insurer Reference: SKJ9903C
Repairer Reference: M5573/SKJ9903C
Date calculated: 16/07/2022 12:59 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Marvyn Chua	Currency:	SGD
Claim Reference:	SKJ9903C	Date of Incident:	11/07/22
Estimated Repair Time:	6	Hire Car Start:	
Actual Repair Days:	6	Hire Car End:	

Vehicle Details

Vehicle
Manufacturer: PEUGEOT
Model: 5008 (0A-0E)
Sub Model: BASE MODEL
Model Sheet Number: 11 83 01
Registration: SKJ9903C
VIN number: VF30E5FVACS252183
Odometer:

Model Specs

FROM 10.2012	AUTO AIR CON	AIR CON 2 BLOWER	DEAD LOCKS
FRT/RR ELECT WINDOWS	ELEC CHILD LOCKING	ELECT FOLDING MIRROR	PHONE SYS BLUETOOTH
RADIO SYSTEM RD4 MP3	S-WHEEL RADIO CONT	RECEPTION IMPROVED	BI-TUNER
FOG LAMPS	CLOTH TRIM	HEIGHT ADJ PASS SEAT	7 SEATS
ACOUSTICS IMPROVED	RAIN SENSOR	TRIM TRAMONTANE	S/BELT W/WARNING DEV
MODULAR PASS SEAT	S-WDW ROLLER BLIND	USB SOCKET	ENTRANCE LAMPS
WDW MOULDING CHROME	INNER MIRROR/SENSOR	BATTERY 12V 60AH	1.6 LTR 82/84KW
LEATH S-WHEEL 3 SPK	HOUSING PREHEATING	HEAD-UP DISPLAY	CRUISE CONTROL
TYRES 215/55 R16..V	DUST ATMOSPHERE	TYRE REPAIR KIT	WHEELS 7J X 16 ALLOY
ENGINE FAN 140W	ALTERNATOR 150 AMP	CATALYST MORE 50PPM	HEAD AIRBAG
FRONT SIDE AIRBAG	PAINTED ROOF MLDG	PANORAMA SUNROOF	EMISSION STD EURO 5
STARTER MTR CLASS 3	PAINTED MOULDINGS	TWO COAT METALLIC	

*Not Authorised
May be T/Coss*

*Ex Nil
Henrich (C/Ck) 21/7/22*

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

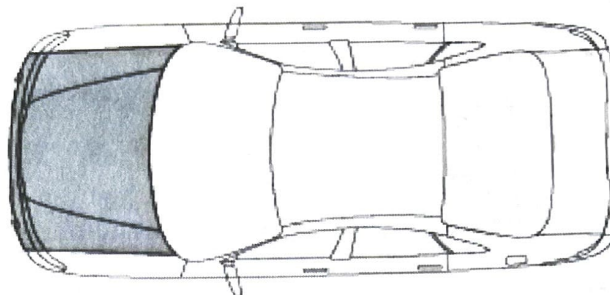

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
74.E7UA	REMOVE AND REFIT FRONT PART INCLUDES: FRONT BUMPER AND BOTH R + R HEADLAMP		15.0	63.00
74.E34A)	RENEW FRONT BUMPER		7.0	29.40
72.E1ES)	R + R FRONT C-MEMBER FRONT PART		2.0	8.40
72.E1ES)	RENEW FRONT C-MEMBER FRT PART (REMOVED)		1.0	4.20
62.E4HA)	RENEW BOTH HEADLAMPS (REMOVED)		1.0	4.20
79.E0YA	R + R BONNET		4.0	16.80
79.E0WA)	RENEW BONNET (REMOVED)		1.0	4.20
79.E0FS)	RENEW L/BONNET HINGE		1.0	4.20
79.E0FS)	RENEW R/BONNET HINGE		1.0	4.20
64.E3UA)	R + R AIR CONDITIONING CONDENSER		2.0	8.40
74.EP4A)	R + R FRONT LOWER AIR GUIDE		2.0	8.40
74.E86A)	RENEW FRONT LOWER AIR GUIDE (REMOVED)		1.0	4.20
NO NUMBER	R + R LEFT FRONT IMPACT DAMPER		1.0	4.20
NO NUMBER	R + R RIGHT FRONT IMPACT DAMPER		1.0	4.20
03.E41A)	R + R AIR INTERCOOLER		1.0	4.20
NO NUMBER	R + R TURBOCHARGER RESONATOR		2.0	8.40

Code	Description	WU	Price SGD
14.E6CA)	R + R AIR BATCHER	3.0	12.60
13.E76A)	R + R RADIATOR	3.0	12.60
	(BUMPER REMOVED)		
74.E9LA)	RENEW FRONT PART (REMOVED)	4.0	16.80
13.E15S	DRAIN + REFILL COOLING SYSTEM	4.0	16.80
64.E3US	ADD: DRAIN + REFILL AIR CONDITIONING	5.0	21.00
62.E1KS	ADD: ADJUST HEADLAMPS	3.0	12.60
62.E1KS	ALIGN FRONT FOG LAMPS	3.0	12.60
0741	L/F WING REPAIR	15.0*	63.00
0742	R/F WING REPAIR	na 15.0* X	63.00
1111	L/F WHEELHOUSE CPL REPAIR	20.0*	84.00
1112	R/F WHEELHOUSE CPL REPAIR	20.0*	84.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		13.80	138.0
Total of Labour			579.60

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	BONNET NEW PART PAINTING	16.0
	FRONT UPPER BUMPER NEW PART PAINT K1R	13.0
	FRONT LOWER BUMPER NEW PART PAINT K1R	8.0
	L/F WING REPAIR PAINT PLASTIC	11.0
	R/F WING REPAIR PAINT PLASTIC	11.0
	L/F WHEELHOUSE CPL SURFACE PAINT	6.0
	R/F WHEELHOUSE CPL SURFACE PAINT	6.0

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	45.41
0281	FRONT UPPER BUMPER NEW PART PAINT K1R	66.91
0285	FRONT LOWER BUMPER NEW PART PAINT K1R	35.42
0741	L/F WING REPAIR PAINT PLASTIC	12.96
0742	R/F WING REPAIR PAINT PLASTIC	12.96
1111	L/F WHEELHOUSE CPL SURFACE PAINT	12.45
1112	R/F WHEELHOUSE CPL SURFACE PAINT	12.45

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		71.0	
Preparation Main Work Metal	0.80	8.0	33.60
Preparation Comp. Work Plastic	2.10	21.0	88.20
Total	10 WU/h	100.0	420.00

Material Cost - Paint

New Part Painting
New Part Painting - Plastic K1R
Repair Painting Plastic
Surface-/Blend Paint
Material-constant Metal
Material-constant Plastic
Total

Price SGD
45.41
102.33
25.92
24.90
12.70
18.10
229.36

Spare Parts

prices as at 2001-01-01
Price SGD

Code	Description	Part Number	Part Source	Price SGD	
0281	FRONT UPPER BUMPER	7401 SS	Original	780.00	✓
0285	FRONT LOWER BUMPER	7401 SV	Original	360.00	✓
0287	L/LOCK	7429 K0	Original	170.00	X
0288	FRT BUMPER BRKT KIT	7416 R2	Original	100.00	✓
0291	L/F BUMPER COVER	7453 05	Original	170.00	?
0292	R/F BUMPER COVER	7453 06	Original	170.00	?
0304	FR LWR BUMPER GRILLE	7422 E2	Original	340.00	✓
0305	FRT BUMPER GRILLE	7422 V0	Original	120.00	✓
0308	FR UPP BUMPER GRILLE	7422 H7	Original	220.00	✓
0311	L/F BUMPER MOULDING	7453 07	Original	170.00	✓
0312	R/F BUMPER MOULDING	7453 08	Original	170.00	X
0316	C-MEMBER FRONT PART	98 118 669 80	Original	720.00	✓
0319	FRONT BUMPER	7422 C9	Original	0.00	
	DAMPING				
0325	FT IMPACT DAMPER SET	7422 93	Original	120.00	?
0340	FRT UPP BUMPER CARR	7422 E7	Original	220.00	?
0341	FRONT LOWER CARRIER	7422 E8	Original	340.00	?
0353	FRT LWR AIR DEFLECT	7013 GQ	Original	220.00	?
0431	GRILLE BADGE	7810 Y4	Original	100.00	✓
0471	BONNET	7901 R2	Original	1,200.00	X
0475	L/BONNET HINGE	7912 F8	Original	145.00	X
0476	R/BONNET HINGE	7913 48	Original	145.00	X
0493	BONNET LOCK	7934 E6	Original	75.00	X
0561	LEFT HEADLAMP ASSY	6208 P6	Original	600.00	✓
0562	RIGHT HEADLAMP ASSY	6206 P6	Original	600.00	✓
0637	L/F FOG LAMP	96 854 252 80	Original	220.00	X
0638	R/F FOG LAMP	96 854 252 80	Original	220.00	X
0639	FRT FOG LAMP BRK SET	7416 R3	Original	70.00	X
0920	FRONT PART	96 765 687 80	Original	360.00	?
4465	AIR CON CONDENSER	6455 GH	Original	720.00	?
7751	UPPER AIR GUIDE	7104 LK	Original	120.00	✓
7753	L/RADIATOR AIR GUIDE	7104 LG	Original	100.00	✓
7754	R/RADIATOR AIR GUIDE	7104 LJ	Original	100.00	✓
7761	RADIATOR	1330 W2	Original	480.00	?
7769	FRT AIR GRILLE	1308 V4	Original	25.00	?
7773	LWR RADIATOR HOSE	1352 23	Original	0.00	
7776	UPPER RADIATOR HOSE	1343 LP	Original	0.00	
7790	ELECTRIC FAN	98 287 198 80	Original	780.00	?
8739	INTERCOOLER	0384 N9	Original	540.00	?
f: OEM Parts	Savings			0.00	
n: Non-OEM Parts	Subtotal			10,990.00	
u: Used parts					

Total**10,990.00****Extras**

Code	Description	Price SGD
1000		
1001	SUNDRY	50.00*
1002	AIRCON GAS FRONT	60.00*
	RADIATOR COOLANT FRONT	30.00*
	Total Extras	140.00

7
501
251

Final Calculation

	SGD	SGD
Parts		
Total Parts	10,990.00	10,990.00
Labour Time Base 10 WU/h		
Total 138.0 WU X 42.00 SGD/h	579.60	
Total of Labour		579.60
Total Of Extras		140.00
Paint Work Time Base 10 WU/h		
Labour Cost 100.0 WU X 42.00 SGD/h	420.00	
Material Cost	229.36	
Total Paint Including Material		649.36
Repair Cost Excludes GST		12,358.96
GST (+7.00%)		865.13
Repair Cost Included GST		13,224.09
Deductions (Excludes GST)		
Deduction For Excess	-500.00	
Total Of Deductions (Excludes GST)		-500.00
Grand Total Excludes GST		11,858.96
GST (+7.00%)		830.13
Grand Total Included GST		12,689.09

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature: _____

Date: _____

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 12/07/2022 18:34 (SGT)
Reported by Both
Date of Accident 11/07/2022 12:30 (SGT)
Exact Location of Accident Stadium Walk, Singapore
Additional Location Information -
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SKJ9903C

INSURED/POLICYHOLDER

Is company? No
Name Of Registered Owner CHIANG SEOW PING
NRIC No SXXXX887F
Email Address cjason887@hotmail.com
Mobile Phone No (Phone) +65-94896470
Alternative Phone No -

VEHICLE PARTICULARS

Manufacturer Peugeot
Model 5008
Variant -
Exact purpose for which vehicle was being used at time of accident Private use
Are you claiming under your own insurance policy for repair to your vehicle? Yes
Vehicle Category Private car
Transmission Auto
CC 1598


INSURANCE COMPANY

Name of Insurance Company China Taiping Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number DMPCSNA00113432208

DRIVER

Name of Driver CHIANG SEOW PING
NRIC No SXXXX887F
Date Of Birth 22/10/1976
Occupation Indoor

Drawing of accident

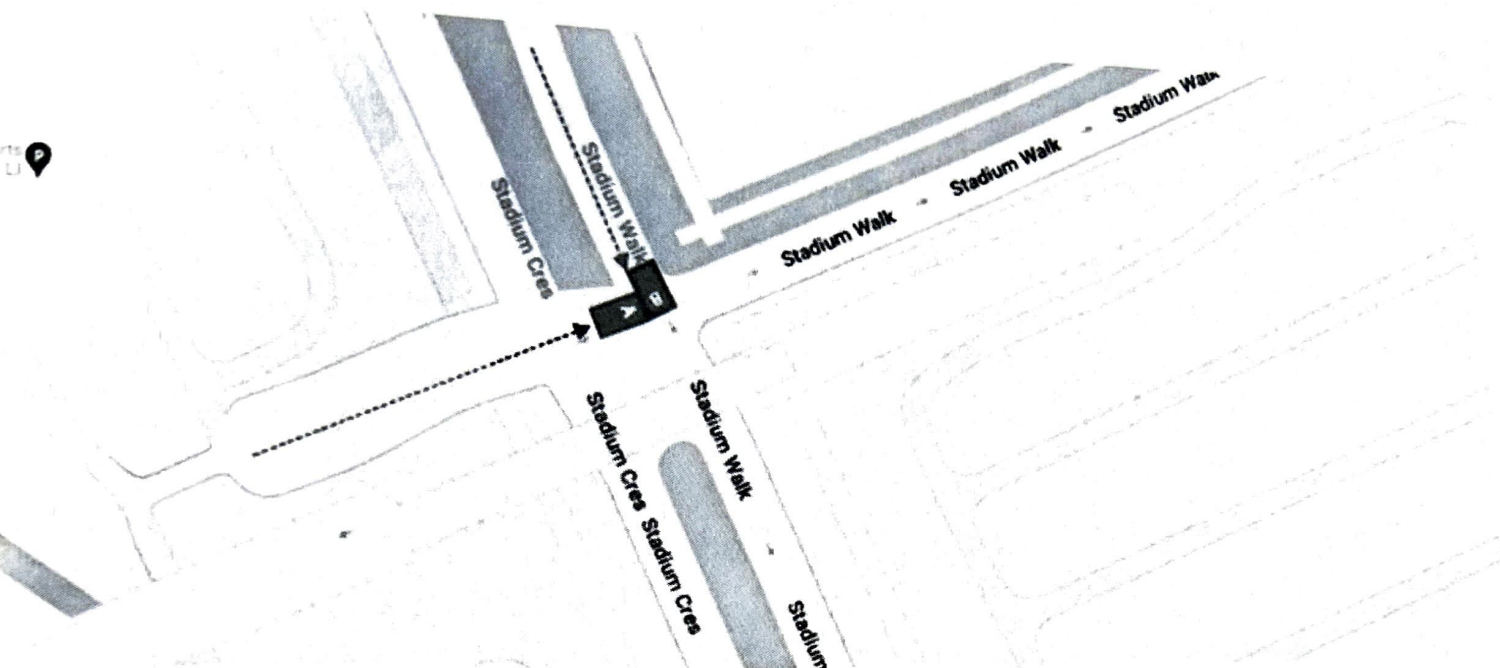

Accident report

- I, Chiang Seow Ping, NRIC S7633887F, am the driver of SKJ9903C.
- On the 11th of July 2022, at around 1220 hours, I drove the car exiting the Sports Hub carpark L.
- I was with my family (wife + 3 children)
- I intended to drive eastwards to Stadium Walk.
- After exiting the car park, I stopped at the junction of Stadium Crescent and Stadium Walk.
- I moved the car to the next junction.
- I moved the car to cross the next junction
- My car collided with another car moving down south along Stadium Walk
- We stopped along Stadium Walk. We confirmed that there are no injuries.
- We exchanged information and agreed to refer the incident to the insurers.
- Car B drove off.
- I arranged a tow truck to bring the car for reporting.

Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Singapore NRIC

Owner ID:

887F

Vehicle Details

Vehicle No.:

SKJ9903C

Vehicle to be Exported:

No

Intended Deregistration Date:

13 Jul 2022

Vehicle Make:

PEUGEOT

Vehicle Model:

5008 1.6 TURBO LUXURY

Primary Colour:

Red

Manufacturing Year:

2012

Engine No.:

10FJBW1684103

Chassis No.:

VF30E5FVACS252183

Maximum Power Output:

115.0 kW (154 bhp)

Open Market Value:

\$25,212.00

Original Registration Date:

31 May 2013

First Registration Date:

31 May 2013

Transfer Count:

0

Actual ARF Paid:

\$27,297.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

30 May 2023

PARF Rebate Amount:

\$13,648.00

Intended COE Rebate Details

COE Expiry Date:

30 May 2023

COE Category:

E - Open Category

COE Period(Years):

10

QP Paid:

\$62,301.00

COE Rebate Amount:

\$5,476.00

Total Rebate Amount:

\$19,124.00

The information contained herein is correct as at 13 Jul 2022

OK