

ASS. REC. BY:

REF: 0721

Kenneth

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
 To Inspect Vehicle No: OD/TP/WS/TP RES/OD RES/EVA/INV/MV
 at Workshop m/s Auto Inter
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: 1250k
 (Client's Record)
 Make of Veh: _____

Veh No: SMW 29386 Yr Regn: 11, 20
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Traller or (A) Wagon
 Make: Toy Vaux C.C. 17PZ
 Colour: W. Silver A/C: Insured / Std / NI / NA
 Sp. Reading: _____ T/Radio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: ZWR80 041968P
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: Inorder / Jammed / Leaked / Burnt or _____
 Brake: Inorder / Jammed / Leaked / Burnt or _____
 Mod: NI1 / 8Rim / STD A/Rim or _____
 Tyre Size: F: 225/45ZR17
 R: _____

(Policy Condition)
 Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: 8160k
 IDAC Accident Rport: _____ Consistent?: Yes or No
 GIA / PR Seen: _____ Consistent?: Yes or No
 Est. Repairs: 09 days Res.: Yes or No
 Lum Sum: 1-B.1 % 3 Val.: Yes or No

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or _____
 Front Rear
 R/Bal. 8 mm R/Bal. 8 mm
 L/Bal. 8 mm L/Bal. 8 mm
 D.O.A. 13/7/22 D.O.I. 22/7/2022
 Survey held at _____

CA / REV / REP. / 24 HRS
 Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or Frt O/S
 The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
<u>1</u>	<u>Report Plot, midnight car hit onto tree!!</u>

Date/Time, File Pass to? : Prell. Report
 : Final Report

Days Of Repair: _____
 Resurvey No. of Trip: _____

Add Fee: : Site Insp (\$ _____)
 : Interview (\$ _____)
 : Tech Invs (\$ _____)
 : Weekend (\$ _____)

Survey Fee: _____
 Transportation: _____
 S - RS. \$ _____

 TOTAL

Report Format : _____
 Lump Sum / I.B.I: (\$ _____)

Auto Insure Pte. Ltd
6 Marsiling Lane
739145



Insurer Reference: SMW2938G
Repairer Reference: M5604/SMW2938G
Date calculated: 18/07/2022 6:34 PM

Full Report
Registration: SMW2938G
Printed: 18/07/2022 6:34 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Marvyn Chua	Currency:	SGD
Claim Reference:	SMW2938G	Date of Incident:	13/07/22
Estimated Repair Time:	8	Hire Car Start:	
Actual Repair Days:	8	Hire Car End:	

Vehicle Details

Vehicle			
Manufacturer:	TOYOTA		
Model:	NOAH		
Sub Model:	BASE MODEL		
Model Sheet Number:	70 NB 01		
Registration:	SMW2938G		
VIN number:	ZWR800419689		
Odometer:			
Model Specs			
AIR CONDITIONING	2.0 LTR 113KW	CVT AUTO GEARBOX	TWO COAT METALLIC

Not Authorized
Repair B4 paint
Ex 81250/r

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All
Underbody

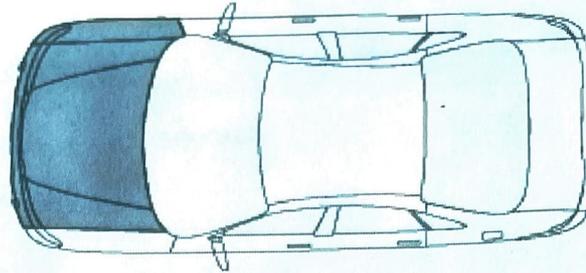

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
Spare Tyre Brand	Tread (Spare), mm						

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	Price SGD
			WU	
NO NUMBER	R + R FRONT ASSEMBLIES INCLUDES: R + R WHEELS, ENGINE WITH GEARBOX AND ENGINE SUPPORT, DETACH + REFIT CONTROL ARMS, TIE RODS, UPPER SUSPENSION STRUTS, DRIVE SHAFTS, STABILIZER AND FRONT EXHAUST, BLEED BRAKE SYSTEM	46.0	193.20	
NO NUMBER	ALIGN VEHICLE CPL	8.0	33.60	
NO NUMBER	R + R FRONT PROTECTIVE COVER	2.0	8.40	
NO NUMBER	R + R R/ENGINE COMPARTMENT COVER	1.0	4.20	
NO NUMBER	R + R HEADLAMPS (BUMPER REMOVED)	4.0	16.80	
NO NUMBER	INCLUDES: ADJUST HEADLAMPS RENEW FRONT BUMPER (RADIATOR GRILLE REMOVED)	15.0	63.00	
NO NUMBER	INCLUDES: FRONT BUMPER AND REQUIRED ATTACHED PARTS R + R RENEW R/HEADLAMP (REMOVED)	1.0	4.20	

Code	Description	WU	Price SGD
NO NUMBER	RENEW R/RADIATOR CARRIER	6.0	25.20
NO NUMBER	RENEW R/WHEELHOUSE	36.0	151.20
NO NUMBER	R + R FRONT BUMPER REINFORCEMENT (BUMPER REMOVED) INCLUDES: ABSORBER REMOVE AND REFIT	2.0	8.40
NO NUMBER	RENEW R/FRT WING INCLUDES: WHEELHOUSE LINER AND REQUIRED ATTACHED PARTS R + R NOT INCLUDED: HEADLAMP AND R + R BUMPER	8.0	33.60
NO NUMBER	R + R LEFT FRONT WING INCLUDES: WHEELHOUSE LINER AND REQUIRED ATTACHED PARTS R + R NOT INCLUDED: HEADLAMP AND R + R BUMPER	7.0	29.40
NO NUMBER	RENEW BONNET INCLUDES: R + R BONNET, ATTACH PARTS ASSEMBLE AND IF NEC RENEW	6.0	25.20
NO NUMBER	R + R FRONT LOCK CARRIER	4.0	16.80
NO NUMBER	R + R WIRE LINKAGE	1.0	4.20
NO NUMBER	R + R WINDSCREEN INCLUDES: WIPER ARMS, COWL COVER, A-PILLAR TRIMS, INSIDE MIRROR AND ALL NECESSARY ATTACHED PARTS REMOVE & REFIT	39.0	163.80
NO NUMBER	R + R COWL PANEL TRIM INCLUDES: WIPER ARMS REMOVE AND REFIT	2.0	8.40
NO NUMBER	R + R AIR CONDITIONING CONDENSER (BUMPER REMOVED) INCLUDES: FILL AIR CONDITIONING	12.0	50.40
NO NUMBER	R + R R/F AIRBAG SENSOR	1.0	4.20
NO NUMBER	R + R FRONT AIRBAG SENSORS	1.0	4.20
NO NUMBER	R + R RADIATOR (BUMPER AND CONDENSER REMOVED) INCLUDES: HOSE, BLOWER HOUSING AND REQUIRED ATTACHED PARTS R + R. COOLING SYSTEM DRAIN/REFILL AND BLEED.	6.0	25.20
NO NUMBER	R + R CENTRE EXHAUST PIPE	2.0	8.40
NO NUMBER	R + R REAR EXHAUST SECTION	2.0	8.40
NO NUMBER	R + R POWER STEERING CPL	3.0	12.60
NO NUMBER	R + R TYRE/S AND/OR WHEEL/S	3.0	12.60
NO NUMBER	R + R R/F WHEEL/TYRE	2.0	8.40
NO NUMBER	R + R RIGHT FRONT SHOCK ABSORBER	2.0	8.40
NO NUMBER	R + R R/F CONTROL ARM REAR	1.0	4.20
NO NUMBER	RENEW FRONT AXLE SUPPORT	19.0	79.80
NO NUMBER	R + R RIGHT FRONT DRIVE SHAFT	2.0	8.40
NO NUMBER	R + R R/F STEERING KNUCKLE	1.0	4.20
NO NUMBER	BALANCE WHEEL/S	1.0	4.20
0741	L/F WING REPAIR	10.0*	✓ 42.00
1016	FRT LWR RAD SUPPORT REPAIR	10.0*	? 42.00
1017	FRT LOCK CARRIER REPAIR	15.0*	X 63.00
1189	L/RADIATOR BRACKET REPAIR	10.0*	✓ 42.00
1202	R/F SIDE MEMBER CPL REPAIR	10.0*	✓ 42.00

Code	Description	WU	Price SGD
1482	RIGHT FRONT DOOR REPAIR	10.0* X	42.00
	Labour Cost	Hrs	WU
	Panel / Mechanical Labour	30.30	303.0
	Alignment	0.80	8.0
	Measuring Work		33.60
	Total of Labour		1,306.20

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h	WU	Price SGD
Code	Description - TWO COAT METALLIC			
	BONNET NEW PART PAINTING		18.0	
	R/F WING NEW PART PAINTING		12.0	
	R/WHEELHOUSE SURFACE PAINT		6.0	
	R/RADIATOR BRACKET SURFACE PAINT		4.0	
	FRONT BUMPER NEW PART PAINT K1R		13.0	
	L/F WING REPAIR PAINTING <50%		12.0	
	RIGHT FRONT DOOR REPAIR PAINTING <50%		18.0	
	FRT LWR RAD SUPPORT SURFACE PAINT		4.0	
	FRT LOCK CARRIER SURFACE PAINT		4.0	
	L/RADIATOR BRACKET SURFACE PAINT		4.0	

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	52.63
0742	R/F WING NEW PART PAINTING	26.32
1118	R/WHEELHOUSE SURFACE PAINT	12.70
1190	R/RADIATOR BRACKET SURFACE PAINT	2.99
0281	FRONT BUMPER NEW PART PAINT K1R	64.94
0741	L/F WING REPAIR PAINTING <50%	16.47
1482	RIGHT FRONT DOOR REPAIR PAINTING <50%	32.95
1016	FRT LWR RAD SUPPORT SURFACE PAINT	2.99
1017	FRT LOCK CARRIER SURFACE PAINT	2.99
1189	L/RADIATOR BRACKET SURFACE PAINT	2.99

Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint			95.0	
Preparation Main Work Metal		2.10	21.0	88.20
Preparation Comp. Work Plastic		0.50	5.0	21.00
Total		10 WU/h	121.0	508.20

Material Cost - Paint
 New Part Painting
 New Part Painting - Plastic K1R
 Repair Painting
 Surface-/Blend Paint
 Material-constant Metal
 Material-constant Plastic
Total

Price SGD
 78.95
 64.94
 49.42
 24.66
 18.10
 9.00
245.07

Spare Parts

prices as at 2015-06-01/01
Price SGD

Code	Description	Part Number	Part Source	Price SGD	
0281	FRONT BUMPER	52119 2J995	Original	315.00	✓
0318	R/F BUMPER BRACKET	52115 28220	Original	50.00	✓
0327	FRT BUMPER ABSORBER	52611 28110	Original	60.00	✓
0340	FRT BUMPER SUPPORT	52131 28170	Original	170.00	✓
0389	FRT LWR BUMP SPOILER	52618 28030	Original	85.00	?
0394	LOWER FRONT SPOILER	53152 28040	Original	100.00	?
0471	BONNET	53301 28160	Original	290.00	✓
0473	BONNET MOULDING	75770 28120	Original	120.00	X
0475	L/F HINGE	53420 28100	Original	50.00	✓
0476	R/F HINGE	53410 28100	Original	50.00	✓
0483	BONNET INSULATION	53341 28080	Original	160.00	X
0493	BONNET LOCK	53510 28160	Original	60.00	X
0562	RIGHT HEADLAMP ASSY	81130 28D01	Original	660.00	✓
0742	R/F WING	53811 28180	Original	375.00	✓
0744	R/F WING RR MOULDING	53827 28140	Original	60.00	?
0774	R/F WING BRACKET	53877 28060	Original	30.00	✓
0842	R/F WHEELHOUSE COVER	53805 28090	Original	85.00	✓
1118	R/WHEELHOUSE	53701 28890	Original	85.00	✓
1190	R/RADIATOR BRACKET	53202 28150	Original	120.00	✓
1367	L/WINDSCREEN MLDG	75552 28070	Original	0.00	
1368	R/WINDSCREEN MLDG	75551 28070	Original	0.00	
1401	WINDSCREEN	56101 28901	Original	0.00	✓
1419	WINDSCREEN SEAL	56117 64010	Original	0.00	✓
7011	FRT AXLE CARRIER	51201 28231	Original	1,140.00	?
7036	R/DRIVE SHAFT CPL	43410 28130	Original	0.00	?
7054	R/F TRACK CONT ARM	48068 29255	Original	315.00	✓
7078	R/FR SHOCK ABSORBER	48510 80655	Original	0.00	✓
7082	R/F STEERING KNUCKLE	43211 44040	Original	220.00	✓
7132	R/F WHEEL HUB	43502 42020	Original	100.00	✓
7202	R/FR WHEEL	42611 28711	Original	0.00	
7261	FRONT STABILISER	48811 44050	Original	0.00	?
7300	POWER STEERING CPL	45510 28210	Original	720.00	?
7312	R/TIE ROD BALL JOINT	45046 49095	Original	85.00	?
7452	L/HEAD AIRBAG SENSOR	89831 28030	Original	0.00	?
8784	R/ENGINE ROOM COVER	51441 28180	Original	60.00	✓
9585	ENGINE COMP HARNESS	82111 28Q80	Original	0.00	✓
f: OEM Parts	Savings			0.00	
n: Non-OEM Parts	Subtotal			5,565.00	
u: Used parts	Total			5,565.00	

Extras

Code	Description	Price SGD
1000	SUNDRY	85.00*
	Total Extras	85.00

Final Calculation

	SGD	SGD
Parts	5,565.00	
Total Parts		5,565.00
Labour Time Base 10 WU/h		
Total 303.0 WU X 42.00 SGD/h	1,272.60	
Alignment		
Measuring Work	33.60	
Total of Labour		1,306.20
Total Of Extras		85.00
Paint Work Time Base 10 WU/h		
Labour Cost 121.0 WU X 42.00 SGD/h	508.20	
Material Cost	245.07	
Total Paint Including Material		753.27
Repair Cost Excludes GST		7,709.47
GST (+7.00%)		539.66
Repair Cost Included GST		8,249.13
Deductions (Excludes GST)		
Deduction For Excess	-1,250.00	
Total Of Deductions (Excludes GST)		-1,250.00
Grand Total Excludes GST		6,459.47
GST (+7.00%)		452.16
Grand Total Included GST		6,911.63

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 14/07/2022 14:15 (SGT)
Reported by Both
Date of Accident 13/07/2022 04:40 (SGT)
Exact Location of Accident Lloyd Rd, Singapore
Additional Location Information -
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SMW2938G

INSURED/POLICYHOLDER

Is company? No
Name Of Registered Owner WONG CHUN HOE
NRIC No SXXXX211Z
Email Address Kawasakizx12rft1212@gmail.com
Mobile Phone No (Phone) +65-91474283
Alternative Phone No -

VEHICLE PARTICULARS

Manufacturer Toyota
Model Voxy
Variant -
Exact purpose for which vehicle was being used at time of accident Private hire
Are you claiming under your own insurance policy for repair to your vehicle? Yes
Vehicle Category Private hire
Transmission Auto
CC 1797

INSURANCE COMPANY

Name of Insurance Company China Taiping Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number DMHCSNW00013642100

DRIVER

Name of Driver WONG CHUN HOE
NRIC No SXXXX211Z
Date Of Birth 27/06/1986
Occupation Outdoor



**SINGAPORE
POLICE FORCE**

Police Station Of Origin:
Orchard N.P.C
51 Killiney Road SINGAPORE 239572
Tel No. 1800-7359999



T/20220713/2004

2 of 3

Report No. T/20220713/2004

CONTINUATION OF REPORT

Details of Person Involved			
Any Pedestrian Involved: No			
No. of Pedestrians Injured: NIL		Use of Pedestrian Crossing: NA	
Driver			
Name	WONG CHUN HOE	ID No.	S8619211Z
Related Vehicle	NIL	Contact No.	91474283
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: 2B,2A,2,3,4 Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL

Brief Details.

On the 13/07/2022, at around 0440hrs, I was driving my vehicle bearing VRN SMW2938G, along Lloyd road where I received a job offer from Grab where I will be picking up passengers at Cuppage Plaza.

Right before I approached the junction of Lloyd Road and Oxley road, I dozed off and my vehicle hit onto a tree. I alighted the car and realised that I suffered a cut on my right pinky and abrasion on my upper lip. I also observed the driver side front bumper and head light to be dent in. I am unsure if my engine was also damaged from the accident.

The police and ambulance arrived shortly after and I was attended by them. The paramedics made a check and suggested to convey me to hospital but I refused.

The traffic police who attended to me had seized the memory card of my in car camera. Breathalyzer test was also conducted on me and I have passed.

I am lodging this report as requested by Traffic Police

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC
Owner ID: 211Z

Vehicle Details

Vehicle No.: SMW2938G
Vehicle to be Exported: No
Intended Deregistration Date: 14 Jul 2022
Vehicle Make: TOYOTA
Vehicle Model: VOXY HYBRID 7-SEATER 1.8X CVT
Primary Colour: Silver
Manufacturing Year: 2019
Engine No.: 2ZR2F72975
Chassis No.: ZWR800419689
Maximum Power Output: 100.0 kW (134 bhp)
Open Market Value: \$32,911.00
Original Registration Date: 12 Nov 2020
First Registration Date: 12 Nov 2020
Transfer Count: 0
Actual ARF Paid: \$28,076.00

Intended PARF Rebate Details

PARF Eligibility: Yes
PARF Eligibility Expiry Date: 11 Nov 2030
PARF Rebate Amount: \$21,057.00

Intended COE Rebate Details

COE Expiry Date: 11 Nov 2030
COE Category: B - Car above 1600cc or 97kW (130bhp)
COE Period(Years): 10
QP Paid: \$39,000.00
COE Rebate Amount: \$32,472.00
Total Rebate Amount: \$53,529.00

The information contained herein is correct as at 14 Jul 2022

OK