

AUTOMAX SURVEY

Blk 110 Bedok Reservoir Road, #07-280, Singapore 470110
Mobile : 9855 6879 Email : automaxsurvey@gmail.com
Registration No. 53110062J

Report Ref : TP21020037

Date: 15 JUN 2021

Lee Yong Nee
c/o Hup Ley Huat Motor Spray Painting Services
Blk 1, #01- 35
Kaki Bukit Ave 6
Singapore 417883

THIRD PARTY SURVEY ACCIDENT OCCURED ON 01 FEB 2021

Workshop Name and Address

Hup Ley Huat Motor Spray Painting Services
Blk 1, #01- 35
Kaki Bukit Ave 6
Singapore 417883

As per your instruction dated 03 FEB 2021
We have carried out a physical inspection on the said
We enclosed herewith our report and findings as follows:

with regard to the above matter.
SMR3153Z

1. VEHICLE PARTICULARS

Registration No : SMR3153Z
Model : TOYOTA HARRIER
Year / Capacity : DEC 2019 / 1986 cc
Chassis No : ASU600004745

Engine No : 8ARZ091401
Mileage : 022 821 km
Colour : MetallicPurple

2. TYRES CONDITION

	<u>Size</u>	<u>Made</u>	<u>Balance</u>	<u>Rim</u>
FRONT O/S :	235/55/R18	Bridgestone	9.00 mm	Sport
REAR O/S :	235/55/R18	Bridgestone	9.00 mm	Sport
FRONT N/S :	235/55/R18	Bridgestone	9.00 mm	Sport
REAR N/S :	235/55/R18	Bridgestone	9.00 mm	Sport

Submit 2/s \$5000
5 days

AUTOMAX SURVEY

Blk 110 Bedok Reservoir Road , #07-280, Singapore 470110

Mobile : 9855 6879

Email : automaxsurvey@gmail.com

Registration No. 53110062J

3. DESCRIPTION OF DAMAGES

At the time of inspection, we noted that the vehicle has sustained an impact damages on the side portion(s). For more detail of the damages, please see photograph attached.

4. Estimated normal period of repair : 05 working days to complete

photo 40% only

5. In accordance to your instruction, we have Not Authorised repair to the vehicle and the survey done on a "Without Prejudice" basis. We hope that this report will be of assistance to you in dealing with the matter.

6. Should you discover any discrepancy in the report, please kindly notify us within 1 week, or the report will be treated as correct.

Disclaimer

The rates and assessment of damages as stated in this report is to be used solely for legal proceedings in relation to the surveyed vehicle and the accident in which the surveyed vehicle was involved in. The rates and assessment of damages must not be used in any circumstances for comparison with other vehicles and/or other accidents in other legal proceedings.

Vehicle Number : SMR3153Z

SPARE PARTS

QTY	PARTS DESCRIPTION	CONDITION	Workshop Estimation (S\$)	Our Revised Estimation (S\$)
<u>List Items</u>				
1 pc	Bonnet	bent R	\$ 952.80	\$ X 952.80
1 pc	Front bumper side retainer	deformed 11	\$ 65.00	\$ X 65.00
1 pc	Front bumper side sponge	distorted 11	\$ 102.00	\$ X 102.00
1 pc	Front bumper sub frame upper	distorted 11	\$ 250.00	\$ X 250.00
1 pc	Front fender	bent DD	\$ 781.45	\$ / 781.45
1 pc	Front fender side panel protector	distorted Tw	\$ 105.00	\$ / 105.00
1 pc	Front fender splash shield	bent 71.1	\$ 252.80	\$ / 252.80
8 pcs	Front fender splash shield clips	necessary 11	\$ 80.00	\$ / 80.00
1 pc	Front fender inner panel	distorted R	\$ 525.00	\$ X 525.00
1 pc	Headlamp assy	dent/distorted 11	\$ 1,980.00	\$ X 1,980.00
1 pc	Front door assy	dent/distorted DD	\$ 1,345.00	\$ / 1,345.00
2 pcs	Front door hinge	bent/distorted SW	\$ 163.00	\$ / 163.00
1 pc	Front door checker	bent/distorted SW	\$ 105.00	\$ / 105.00
2 pcs	Front door stopper	wrapped/deformed 11	\$ 92.00	\$ / 92.00
1 pc	Front door weatherstrip	wrapped/deformed 11	\$ 182.10	\$ / 182.10
1 pc	Front door protector	grazed/deformed new	\$ 174.40	\$ / 174.40
1 pc	Front door protector chrome	grazed/deformed new	\$ 132.10	\$ / 132.10
1 pc	Front door window frame black sticker	wrapped/deformed new	\$ 132.10	\$ / 132.10
1 pc	Front door fame moulding	deformed new	\$ 78.70	\$ / 78.70
1 pc	Side mirror housing assy	grazed/deformed 2ye	\$ 1,579.80	\$ / 1,579.80
1 pc	Front door pillar iner garnish	deformed 11	\$ 160.00	\$ X 160.00
Parts Sub-Total			\$ 9,238.25	\$ 9,238.25
Discount 25.00%			\$ 2,309.56	\$ 2,309.56
			\$ 6,928.69	\$ 6,928.69

Vehicle Number : SMR3153Z

SPARE PARTS

QTY	PARTS DESCRIPTION	CONDITION	Workshop Estimation (S\$)	Our Revised Estimation (S\$)
<u>Special Nett Items</u>				
1 pc	Door window glass solar flim	necessary 11	\$ 300.00	\$ X 300.00
1 pc	Sound clad	deformed 11	\$ 250.00	\$ X 250.00
1 pc	Rim Assembly	damaged 11	\$ 650.00	\$ X 650.00
1 pc	Tyre (NW Dye)	grazed/distorted 11	\$ 450.00	\$ X 400.00
Special Nett Sub-Total			\$ 1,650.00	\$ 1,600.00
Spare Parts Total			\$ 8,578.69	\$ 8,528.69


LABOUR COST

S/No	JOB DESCRIPTIONS	Workshop Estimation (S\$)	Our Revised Estimation (S\$)
	Spare Parts Total c/f \$	8,578.69	\$ 8,528.69
1	To tuff coat affected areas	\$ 180.00	\$ 60 150.00
2	To remove replace interior upholstery	\$ 180.00	\$ 111 X 150.00
3	To respray affected areas	\$ 1,200.00	\$ 800 1,000.00
4	To renew damaged parts, straighten and repair door center pillar (inner), rear fender inner panel and aligned all parts.	\$ 1,600.00	\$ 600 1,400.00
5	To remove & replace door assy	\$ 180.00	\$ 60 150.00
6	To check and adjust computer wheel alignment	\$ 180.00	\$ 111 X 150.00
7	To apply paint coating protection	\$ 1,200.00	\$ 111 X 1,200.00
8	To supply & install wrap on replacement parts	\$ 1,800.00	\$ 850 1,800.00
	Total \$	15,098.69	\$ 14,528.69

The repairer has agreed to undertake the repair under a Lump Sum Basis. We have further adjusted the amount to a Lump Sum Repair of :

\$ 12,150.00


Fong Kok Heng
Qualified Appraiser

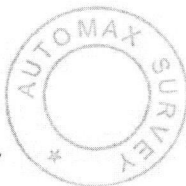

1-5203-45
252
3902-58
2870
6272-58
202
8018

AUTOMAX SURVEY

Blk 110 Bedok Reservoir Road , #07-280, Singapore 470110

Mobile : 9855 6879

Email : automaxsurvey@gmail.com

Registration No. 53110062J

Billing To: Lee Yong Nee
c/o Hup Ley Huat Motor Spray Painting Services
Blk 1, #01- 35
Kaki Bukit Ave 6
Singapore 417883

Invoice no.: TP21020037

Date: 15 JUN 2021

Vehicle no: SMR3153Z

Model : TOYOTA HARRIER

ITEM	DESCRIPTION	AMOUNT
1	Date of Inspection : 03 FEB 2021 Copies of the inspection / survey report Correspondence, postages and etc.	\$ 750.00
2	Photography Services Develop photographs Storage of digital photographs	
3	To submit report by hand.	
4	Charges on photocopies, posting, faxes and others incidental works entrusted.	
5	Transportation Charges	
6	Reinspection Charges	
	TOTAL :	\$ 750.00

Notes :

1. All cheque payment should be "crossed" and made payable to "Automax Survey".
2. Please contact us if there are further enquiries on the invoice.

Official Stamp