



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2302788

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 04/05/2023
Reference CC6/CTI22007029/Dya3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHA 4053X
Insured Veh. SLM 9225Z
Claim No. SNM22D205121/C02
Policy No. DMHCSNW00006102200
Accident Date 23/07/2022
Inspection Date 26/07/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22007029/Dya3q2 Date: 04/05/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SLM 9225Z	Veh. Inspected	SHA 4053X	
Policy No.	DMHCSNW00006102200	Coverage (\$)	0.00	
Claim No.	SNM22D205121/C02	Excess (\$)	0.00	
Assign From		Assign Date	26/07/2022	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI IONIQ	c.c	1580	
Engine No.	HIDDEN	Year of Reg.	2021	
Chassis No.	KMHC851CVLU192331	Colour	BLUE	
Odometer	208448 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	WEST LAKE	5 mm	
L/H Front Tyre	195/65 R15	WEST LAKE	5 mm	
R/H Rear Tyre	195/65 R15	WEST LAKE	5 mm	
L/H Rear Tyre	195/65 R15	WEST LAKE	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	23/07/2022	Inspection Date	26/07/2022	
Survey held at	Blk 9 Sector C #01-42, Sin Ming Industrial Estate			
Repairer	BIFROST AUTO PTE LTD			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			9 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHA 4053X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BOOT LID	BENT	2,549.70	2,549.70
1	BOOT LID RUBBER	NECESSARY	187.40	187.40
2	BOOT LID HINGE (LH/RH) @\$71.30	NOT NECESSARY	142.60	-
2	BOOT LID ABSORBER (LH/RH) @\$86.70	NOT NECESSARY	173.40	-
1	BOOT LID LOCK UPPER	NOT NECESSARY	224.00	-
1	BOOT LID 'H' EMBLEM	NECESSARY	28.00	28.00
1	EMBLEM -HYBRID	NECESSARY	24.30	24.30
1	EMBLEM -LONIQ	NECESSARY	31.30	31.30
1	BOOT LID LAMP (LH)	NOT NECESSARY	822.00	-
1	BOOT LID TRIMBOARD	NOT NECESSARY	259.70	-
10	BOOT LID TRIMBOARD CLIPS	NOT NECESSARY	11.00	-
1	BOOT LID TRIMBOARD ,CENTRE	NOT NECESSARY	159.60	-
1	BOOT LID TRIMBOARD SIDE (LH)	NOT NECESSARY	92.50	-
1	BOOT LID GLASS UPPER MOULDING	NOT NECESSARY	186.30	-
1	BOOT LID GLASS LOWER MOULDING	NOT NECESSARY	145.20	-
1	REAR BUMPER	CRACKED	459.40	459.40
1	REAR BUMPER REINFORCEMENT	CRACKED	394.80	394.80
1	REAR BUMPER REINFORCEMENT BRACKET (LH)	BENT	188.10	188.10
1	ANTENNA ASSY -SMARTK OUTER	NOT NECESSARY	689.50	-
1	REAR BUMPER CENTRE MOULDING ASSY	BROKEN	451.25	451.25
1	REAR BUMPER LOWER CENTRE MOULDING ASSY	MTG CRACKED	155.00	155.00
1	REAR BUMPER STAY	NOT NECESSARY	138.10	-
1	REAR BUMPER SIDE RETAINER (LH)	BROKEN	85.80	85.80
1	REAR BUMPER COVER CLIPS	NECESSARY	22.00	22.00
1	REAR BUMPER UNDER CENTRE	BROKEN	123.85	123.85
1	REAR BUMPER SIDE UNDER (LH)	BROKEN	123.10	123.10
1	REAR BUMPER REAR HOOK	NOT NECESSARY	94.60	-
1	REAR BUMPER REFLECTOR LAMP (LH)	BROKEN	82.90	82.90
1	REAR BUMPER TOWING COVER	DISLODGE	98.80	98.80
1	REAR BUMPER REVERSE LIGHT (PARKING BRAKE LIGHT)	NOT NECESSARY	328.60	-

Report Ref No. CC6/CTI22007029/Dya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TAIL LAMP (LH)	MTG CRACKED / BROKEN	935.40	935.40
1	TAIL LAMP QUARTER PANEL (LH)	DENTED	208.90	208.90
1	REAR PANEL	DENTED	532.00	532.00
1	ANTENNA ASSY -TRUNK	NOT NECESSARY	689.50	-
1	REAR PANEL GARNISH	NOT NECESSARY	346.80	-
1	REAR TRAY TOOLS BOX LH	NOT NECESSARY	693.20	-
1	REAR TRAY LUGGS CENTER	NOT NECESSARY	354.20	-
1	REAR FENDER (LH)	DENTED	1,768.30	1,768.30
1	REAR FENDER SHIELD REAR PIECE (LH)	TORN	173.60	173.60
1	REAR FENDER SHIELD ,FRT PIECE (LH)	NOT NECESSARY	165.50	-
1	REAR FENDER CORNER INNER UPPER GARNISH (LH)	NOT NECESSARY	486.70	-
1	REAR FENDER AIR-DUCT (LH)	DEFORMED	87.30	87.30
1	REAR FENDER TRIM BOARD (LH)	BENT / DEFORMED	788.75	788.75
1	REAR FENDER TRIM BOARD TOP GARNISH (LH)	NOT NECESSARY	167.90	-
1	ASSY BSD BLIND SPOT RADAR (LH)	MTG BENT / DAMAGED	1,784.40	1,784.40
1	REAR TYRE RIM (LH)	DISTORTED	1,124.20	1,124.20
1	REAR WHEEL HUP-CAP (LH)	CUT	346.40	346.40
1	REAR WHEELBEARING & HUB ASSY	DAMAGED	554.00	554.00
1	REAR TRAILING ARM (LH)	DISTORTED	265.40	265.40
1	REAR ASSIST (LH)	DISTORTED	227.90	227.90
1	REAR SHOCK ABSORBER (LH)	DISTORTED	230.50	230.50
1	REAR SHOCK ABSORBER MOUNTING (LH)	NOT NECESSARY	133.10	-
1	REAR ABSORBER STOPPER (LH)	NOT NECESSARY	137.60	-
1	REAR ABSORBER COVER (LH)	NOT NECESSARY	175.60	-
1	STABILIZER BAR	NOT NECESSARY	387.30	-
1	STABILIZER LINK (LH)	NOT NECESSARY	147.30	-
1	REAR UPPER ARM (LH)	DISTORTED	239.50	239.50
1	REAR LOWER ARM (LH)	DISTORTED	393.10	393.10
1	REAR KNUCKLE ARM (LH)	DISTORTED	538.10	538.10
	LESS 20% DISCOUNT		-4,511.05	-3,040.69
			18,044.20	12,162.76

Report Ref No. CC6/CTI22007029/Dya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	BOOT LID COMFORT LOGO & TEL NO.STICKER (SN)	NECESSARY	35.00	35.00
1	BOOT LID CAB LINK NO.STICKER (SN)	NOT FITTED	30.00	-
1	BOOT LID ADVERTISEMENT LOGO (SN)	NECESSARY	100.00	100.00
2	REAR WINDSCREEN SEALANT @\$46.00 (SN)	NECESSARY	92.00	92.00
1	REAR BUMPER ADVERTISEMENT LOGO (SN)	NECESSARY	50.00	50.00
1	REAR BUMPER RUBBER MAT (SN)	NECESSARY	50.00	50.00
1	REAR BUMPER REVERSE SENSOR (SN)	DAMAGED	180.00	180.00
1	REAR FENDER ADVERTISEMENT LOGO (LH) (SN)	NECESSARY	100.00	100.00
1	REAR TYRE (LH) (SN)	SERVICEABLE	216.00	-
			853.00	607.00
	<u>LABOUR</u>			
	PANEL BEATING.		2,000.00	800.00
	SPRAY PAINTING CHARGE.		1,800.00	700.00
	WIRING CHARGE.		100.00	30.00
	TUFF KOTE.		100.00	40.00
	TOWING CHARGE.	NOT NECESSARY	80.00	-
	REMOVE /REFIX CUSHION & UPHOLSTERY REAR .		150.00	80.00
	REMOVE/REFIX REAR WINDSCREEN GLASS .		240.00	80.00
	REMOVE/REFIX REVERSE SENSOR .		120.00	40.00
	REMOVE/REFIX UNDERCARRIAGE (RR).		400.00	150.00
	REMOVE/REFIX FUEL TANK.	NOT NECESSARY	80.00	-
	FOUR WHEEL ALIGNMENT.		120.00	60.00
	DIAGNOSTIC & RESETTING TO ERASE FAULT CODE . }		550.00	150.00
	DIAGNOSTIC & RESETTING ADAS OPTICAL SENSOR .}		550.00	-
			6,290.00	2,130.00
GRAND TOTAL			25,187.20	14,899.76

RECOMMENDED COST OF REPAIRS			14,899.76
------------------------------------	--	--	------------------

Report Ref No. CC6/CTI22007029/Dya3q2

ANG BRYAN TANI

Automotive Assessor / Investigator

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHA 4053X

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

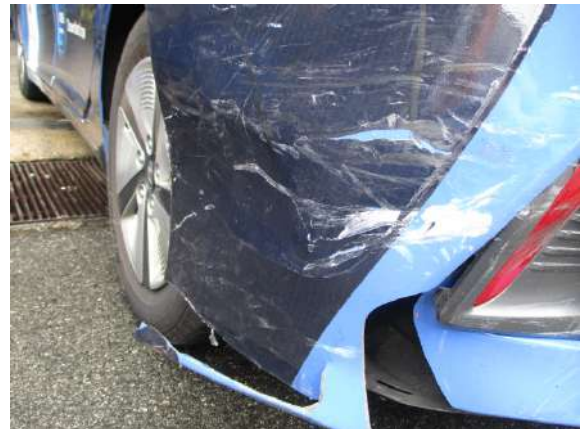



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHA 4053X

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHA 4053X

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

