



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2207363

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 29/11/2022
Reference CC6/CTI22007084/Upa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SNA 8875T
Insured Veh. SJG 9989H
Claim No. SNM22D205276/C02
Policy No. DMPCSNW00151262101
Accident Date 25/07/2022
Inspection Date 26/07/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22007084/Upa3q2 Date: 29/11/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SJG 9989H	Veh. Inspected	SNA 8875T	
Policy No.	DMPCSNW00151262101	Coverage (\$)	0.00	
Claim No.	SNM22D205276/C02	Excess (\$)	0.00	
Assign From		Assign Date	26/07/2022	
2. Vehicle Particulars & Condition				
Make & Model	JAGUAR XE 2.0 (A)	c.c	1999	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	SAJAB4AG1HA970173	Colour	BLUE	
Odometer	108674 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	225/45Z R18	MICHELIN	7 mm	
L/H Front Tyre	225/45Z R18	MICHELIN	7 mm	
R/H Rear Tyre	245/40Z R18	MICHELIN	7 mm	
L/H Rear Tyre	245/40Z R18	MICHELIN	7 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR O/S & FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	25/07/2022	Inspection Date	26/07/2022	
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SNA 8875T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BOOTLID	BADLY DENTED	3,500.00	2,056.70
1	BOOTLID INNER LOCK	SHORTED	658.00	455.00
1	BOOTLID WEATHERSTRIP	TWISTED	385.00	385.00
1	BOOTLID REAR LOGO	NECESSARY	150.00	142.00
1	BOOTLID 'JAGUAR' EMBLEM	NECESSARY	120.00	110.00
1	BOOTLID '20 I' EMBLEM	NECESSARY	98.00	80.00
1	BOOTLID 'XE' EMBLEM	NECESSARY	105.00	80.00
1	REAR BUMPER	DISTORTED	2,450.00	2,100.00
1	REAR BUMPER LOWER	DEFORMED	1,150.00	620.00
1	REAR BUMPER BEAM	BENT	1,420.00	950.00
1	REAR BUMPER INNER TOP RETAINER	CRACKED	455.00	305.00
2	REAR BUMPER PDC SENSORS @\$205.00	SHORTED	410.00	360.00
1	SET REAR BUMPER PDC SENSOR WIRE	TORN	320.00	266.00
1	REAR END PANEL OUTER	BADLY DENTED	820.00	820.00
1	REAR END PANEL INNER	TO REPAIR SEE LABOUR	1,250.00	-
1	REAR END PANEL TOP GARNISH	TWISTED	385.00	385.00
1	REAR BOOTLID REFLECTOR O/S	BROKEN	320.00	320.00
1	REAR EXHAUST	NOT NECESSARY	1,820.00	-
1	REAR EXHAUST HEAT SHIELD	NOT NECESSARY	311.00	-
1	REAR EXHAUST MOUNTING	NOT NECESSARY	60.00	-
2	TAILLAMPS @\$1300.00	O/S BROKEN	2,600.00	642.00
1	TAILLAMP HOUSING PANEL O/S	DENTED / BENT	550.00	500.00
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	1,650.00	-
1	REAR FLOOR PANEL TOP BOARD	NOT NECESSARY	558.00	-
1	REAR FENDER O/S	TO REPAIR SEE LABOUR	3,450.00	-
1	REAR FENDER INNER TRIM O/S	NOT NECESSARY	650.00	-
1	REAR FENDER UNDER TRIM O/S	TORN	485.00	322.00
1	REAR FLOOR TOOL SPONGE O/S	NOT NECESSARY	365.00	-
1	FRONT BUMPER	DEFORMED / TORN	2,820.00	2,120.00

Report Ref No. CC6/CTI22007084/Upa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT BUMPER CENTRE GRILLE	NOT NECESSARY	605.00	-
1	FRONT BUMPER SPONGE	TORN	545.00	266.00
2	FRONT BUMPER SIDE RETAINERS @\$65.00	BENT	130.00	130.00
1	FRONT BUMPER BEAM	BENT	1,285.00	1,012.00
1	FRONT GRILLE	CRACKED	945.00	920.00
1	FRONT GRILLE LOGO	NOT NECESSARY	95.00	-
1	FRONT GRILLE CHROME	CRACKED	850.00	477.51
1	FRONT SUPPORT PANEL	DENTED / BENT	1,020.00	1,005.00
1	BONNET	TO REPAIR SEE LABOUR	2,200.00	-
1	BONNET INNER LOCK	NOT NECESSARY	266.00	-
2	HEADLAMPS @\$4800.00	HOLDER CRACKED	9,600.00	7,898.00
1	CONDENSER	NOT NECESSARY	1,180.00	-
1	RADIATOR	NOT NECESSARY	1,450.00	-
	LESS 10% DISCOUNT		-	-2,472.72
			49,486.00	22,254.49
	<u>SPECIAL NETT ITEMS</u>			
1	REAR WINDSCREEN SEALANT (SN)	NOT NECESSARY	50.00	-
1	SET REAR FLOOR PANEL INSULATOR (SN)	NOT NECESSARY	200.00	-
1	REAR LICENCE PLATE (SN)	NOT NECESSARY	50.00	-
1	REAR END PANEL SEALANT (SN)	NECESSARY	50.00	50.00
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	50.00	50.00
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	50.00	50.00
1	FRONT LICENCE PLATE (SN)	BENT	50.00	40.00
			500.00	190.00
	<u>LABOUR</u>			
	TO CHECK WIRING .		80.00	30.00
	TO DISMANTLE & REPLACED REVERSE SENSOR .		80.00	50.00
	TO DISMANTLE & REFIX REAR WINDSCREEN.	NOT NECESSARY	150.00	-
	TO DISMANTLE & REFIX CUSHION UPHOLSTERY .		120.00	80.00
	TO DISMANTLE & REFIX REAR UNDER CARRIAGE.	NOT NECESSARY	280.00	-
	TO CONDUCT WHEEL ALIGNMENT.	NOT NECESSARY	120.00	-
	TO DISMANTLE & REPLACED REAR EXHAUST .	NOT NECESSARY	120.00	-

Report Ref No. CC6/CTI22007084/Upa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO SPRAY RUST PROOFING .		150.00	90.00
	TO REFILL AIR CON GAS.		120.00	100.00
	TO RESET & REPROGRAMME SYSTEM.		200.00	100.00
	LABOUR FOR PANEL BEATING & REPLACED PARTS.INCLUSIVE OF THE REPAIR OF REAR END PANEL INNER ,REAR FLOOR PANEL,REAR FENDER O/S AND BONNET .		2,800.00	1,600.00
	TO PUTTY & SPRAY PAINTING.		2,600.00	1,800.00
			6,820.00	3,850.00
GRAND TOTAL			56,806.00	26,294.49
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				21,000.00

Report Ref No. CC6/CTI22007084/Upa3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SNA 8875T

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

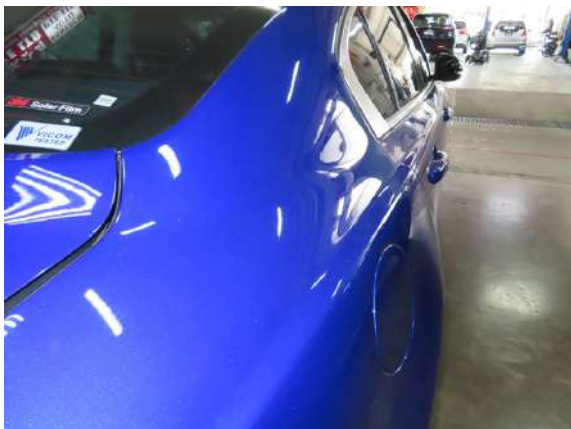



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

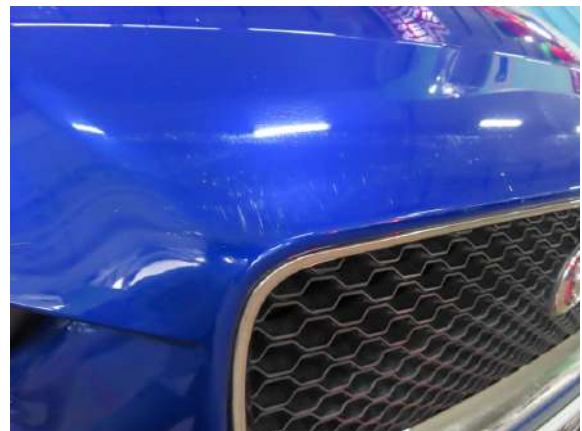



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SNA 8875T

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

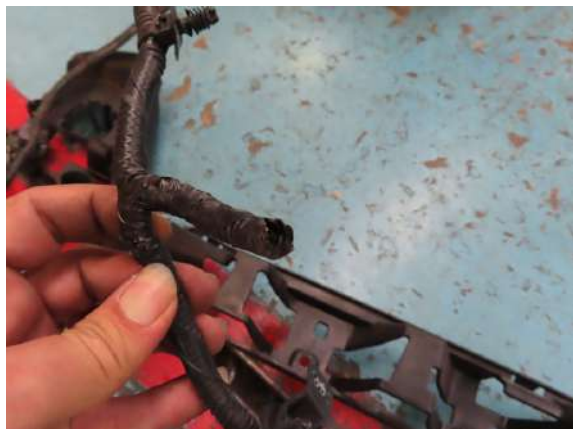



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SNA 8875T

RE-INSPECTION

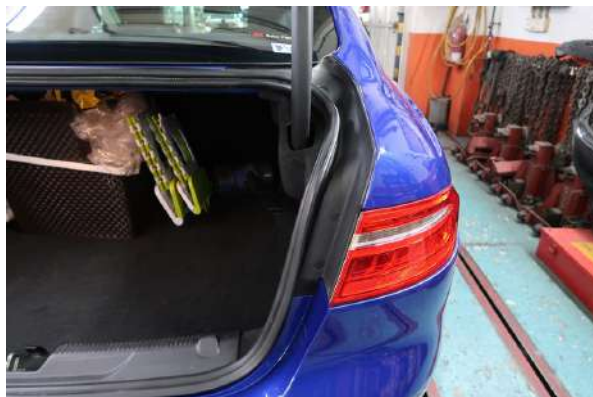



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

