

Jin Auto Services Pte Ltd
#01-410/412, 14 Defu Lane 10
539195

Insurer Reference: SKA1166M
Repairer Reference: SKA1166M
Date calculated: 26/07/2022 3:15 PM

Full Report
Registration: SKA1166M
Printed: 26/07/2022 3:16 PM

Summary Information

Claim Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	JOUIS SEOW	Currency:	SGD
Claim Reference:	SKA1166M	Date of Incident:	24/07/22
Estimated Repair Time:	5	Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle Manufacturer:	CITROEN		
Model:	C5 AIRCROSS (AC)		
Sub Model:	BASE MODEL		
Model Sheet Number:	10 CA 01		
Registration:	SKA1166M		
VIN number:	VR7A45GFRKL072409		
Odometer:	50230		
Model Specs			
FROM 04.2019	COOLANT R134	CONDENS 16MM 23.5DM2	AUTO AIR CON
AUTO CIRC AIR CONTR	LAMINATED S-WINDOW	ACCESS FOOT OPENING	DEAD LOCKS
ELECTRIC TAILGATE	BLIND SPOT SENSOR	KEYLESS ENTRY/START	ELECT FOLDING MIRROR
SMARTPHONE CHARGING	FUNC MIRROR SCREEN	RADIO SYSTEM COLOUR	FOG LAMPS
HEADLAMP LED/H7	ULTRASONIC PARK SYS	VISIO PARK 1	LEATHER TRIM
PEDAL CARRIER ALU	LEATHER STRG WHEEL	CHROME SILL MLDGS	INTERIOR LIGHT LED
INT MIRROR AUTODIP	LUMBAR SUPPORT MECH	ELEC ADJ DRIVER SEAT	RADIATOR 28DM2 28MM
OUT FUEL FILTER	STOP-START SYSTEM	HOUSING PREHEATING	1.6 LTR 166KW HYBRID
AUTO GEARBOX ATN8	REAR AXLE 30000N.M	REAR BUMPER 2 STOP	FRT SUPP FRAME STEEL
AUTOMATIC BRAKE SYS	ELECT POWER STEERING	TYRES 235/55 VR 18	WHEELS 7.5J X 18 ALU
ALTERNATOR 150 AMP	ENGINE FAN 180W	ROOF RAILS	EMISSION STD EURO6.2
HEAD/SIDE AIRBAG	DIAGNOSIS EOBD	BATTERY 12V 70AH	DUST ATMOSPHERE
PAINTED MOULDINGS	REAR SKIRT GLOSS	TWO COAT METALLIC	PREPARE OFF VEHICLE

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) for resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Not Authorised
21/7/22
2 days.
29/7/22

Vehicle Condition

Vehicle Status


Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐

Underbody ☐

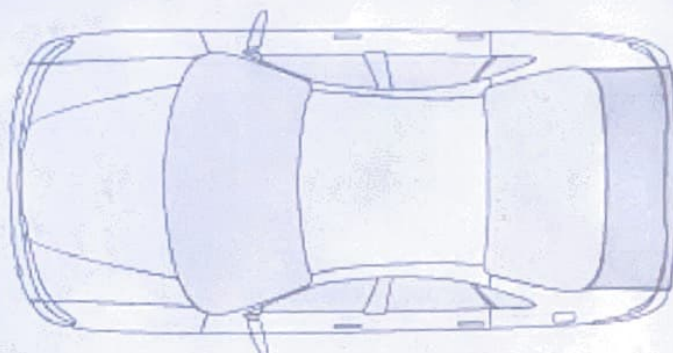

Tyres Condition

Tyre Brand	Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner),Tread (Right Outer),Tread (Right Middle), mm					Condition
Continental	10	10	10	10	10	10
Pirelli	10	10	10	10	10	10
Michelin	10	10	10	10	10	10
Goodyear	10	10	10	10	10	10
Maxxis	10	10	10	10	10	10
Yokohama	10	10	10	10	10	10
Sumitomo	10	10	10	10	10	10
BF Goodrich	10	10	10	10	10	10
Firestone	10	10	10	10	10	10
General	10	10	10	10	10	10
Cooper	10	10	10	10	10	10
Continental	10	10	10	10	10	10
Pirelli	10	10	10	10	10	10
Michelin	10	10	10	10	10	10
Goodyear	10	10	10	10	10	10
Maxxis	10	10	10	10	10	10
Yokohama	10	10	10	10	10	10
Sumitomo	10	10	10	10	10	10
BF Goodrich	10	10	10	10	10	10
Firestone	10	10	10	10	10	10
General	10	10	10	10	10	10
Cooper	10	10	10	10	10	10

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

		Time Base 10 WU/h	Price = 42.00 SGD/h	
Code	Description		WU	Price SGD
6815 0210	R + R REAR BUMPER		11.0	46.20
6815 0910)	RENEW REAR BUMPER		3.0	12.60
NO NUMBER	ADD: REMOVE + REFIT REAR PARKING SENSORS		1.0	4.20
7089 0911ZAX	R + R REAR BUMPER CROSSMEMBER		2.0	8.40
6991 0911ZAX	R + R REAR BUMPER IMPACT ABSORBER		1.0	4.20
2711	REAR PANEL REPAIR		20.0*	84.00
	Labour Cost	Hrs	WU	
	Panel / Mechanical Labour	3.80	38.0	159.60
	Total of Labour			159.60

Paint

Paint Work		SYSTEM AZT	Time Basis 10 WU/h	
Code	Description - TWO COAT METALLIC		WU	Price SGD
	REAR BUMPER NEW PART PAINT K1R		8.0	

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description - TWO COAT METALLIC	WU	Price SGD
	REAR BUMPER SKIRT NEW PART PAINT K1R	7.0	
	REAR PANEL REPAIR PAINTING >50%	15.0	

Paint Material Per Part

Code	Description	Price SGD
2581	REAR BUMPER NEW PART PAINT K1R	35.42
2585	REAR BUMPER SKIRT NEW PART PAINT K1R	26.57
2711	REAR PANEL REPAIR PAINTING >50%	14.22

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor			42.00 SGD/h
Time Paint		30.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.50	5.0	21.00
Total	6.00	60.0	252.00

Material Cost - Paint

	Price SGD
New Part Painting - Plastic K1R	61.99
Repair Painting	14.22
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	113.81

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2001-01-01	Price SGD
2581	REAR BUMPER CPL	16 389 537 80	Original	?	1,100.00
2624	RR CTR IMPACT ABSORB	98 266 764 80	Original	'	180.00
2640	REAR BUMPER SUPPORT	98 160 715 80	Original	?	380.00
2665	L/R INN PARKING SENS	16 099 810 80	Original	?	120.00
2666	R/R INN PARKING SENS	16 099 810 80	Original	?	120.00
1000	RR BUMPER LOWER	BUMPER LOWER	Original	Torn	480.00
1001	RR BUMPER TOW CVR	TOW COVER	Original	See	95.00x

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings

Subtotal

Fixed Sundry Parts Price

Total

0.00
2,475.00
100.00
2,575.00

Final Calculation

	SGD	SGD
Parts		
Fixed Sundry Parts Price	2,475.00	
Total Parts	100.00	2,575.00
Labour Time Base 10 WU/h		
Total 38.0 WU X 42.00 SGD/h	159.60	
Total of Labour		159.60
Paint Work Time Base 10 WU/h		
Labour Cost 60.0 WU X 42.00 SGD/h	252.00	
Material Cost	113.81	
Total Paint Including Material		365.81
Repair Cost Excludes GST		3,100.41
GST (+7.00%)		217.03
Repair Cost Included GST		3,317.44

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.