

ASS. PLO. BY:

REF: C4/AIS 22007248/Dpc<sup>3</sup>

**ASSIGNMENT**

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: \_\_\_\_\_

at Workshop m/s \_\_\_\_\_

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. \_\_\_\_\_

Claims No. \_\_\_\_\_


Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

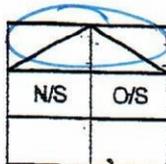

Bal. or Market Value: \_\_\_\_\_

IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: 18 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_ Vehicle: IN / OUT

Veh No: SFL 6000 B Yr Regn: NOV / 2016

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover / Truck / Trailer or

Make: Honda Vezel Hybrid c.c. 1496

Colour: Purple A/C: Insured / Std / NI / NA

Sp. Reading: N.A. T/Radio: Insured / Std / NI / NA

Eng/No: LEB5914821

C/No: RU31214810

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or Don't

Brake: C Inorder / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 215/60 R16

R: 11

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or Yokohama

Front \_\_\_\_\_ Rear \_\_\_\_\_

R/Bal. S mm R/Bal. S mm

L/Bal. S mm L/Bal. S mm

D.O.A. 19/07/2022 D.O.I. 01/08/2022

Survey held at Vin's Motor Sinc King

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	Allianz 55B 44985
	MV 63K
	LTA 26K
	HL 37K-37K
6/3/22	Inspected 2/3 36,000 - with 18 days of rep

Date/Time, File Pass to?  : Prel. Report  : Final Report

1) \_\_\_\_\_  
Date/Time, File Return to?

Report Format: \_\_\_\_\_

1 series 2 series 3 series 4 series

Days Of Repair: \_\_\_\_\_

Resurvey No. of Trip: \_\_\_\_\_

Add Fee:  : Site Insp (\$)  : Interview (\$)  : Tech. Invs (\$)

Survey Fee:	
Transportation:	
S + RS	\$
Photos	
Others	



**Vin's Motor Pte Ltd**  
 160 Sin Ming Drive  
 #03-03 Sin Ming Autocity  
 Singapore 575722  
 Tel : 6453 2121 Fax : 6459 9795  
 GST Registration No. 199906067G

**Estimated Cost of Repair**

Attention To : Allianz Insurance Singapore Pte Ltd  
 79 Robinson Road  
 #09-01  
 Singapore 068897

**Claim Details**

Case Ref. No. : TP/072022/5551  
 Date : 27-07-2022  
 Accident Date : 19-07-2022

**Vehicle Details**

Make & Model : Honda VEZEL 1.5X HYBRID A  
 Chassis No : RU31214810  
 Registration No : SFL6000B

**Third Party Vehicle Details**

Registration No : SJB4498S

S/N	Description	Qty	Amount (S\$)
1	FRONT BONNET <i>Denke</i>	1.00	\$510.00
2	BONNET HINGE - RH <i>ist</i>	1.00	\$30.00
3	BONNET HINGE - LH <i>ist</i>	1.00	\$30.00
4	BONNET INSULATOR <i>crumpled</i>	1.00	\$80.00
5	BONNET LOCK <i>ist</i>	1.00	\$70.00
6	BONNET LOCK COVER <i>broken</i>	1.00	\$20.00
7	BONNET RUBBER - LONG @ \$20.00 <i>svc</i>	2.00	\$40.00
8	BONNET RUBBER - SHORT @ \$20.00 <i>svc</i>	2.00	\$40.00
9	FRONT GRILLE BASE <i>broken</i>	1.00	\$220.00
10	FRONT GRILLE EMBLEM <i>white</i>	1.00	\$40.00
11	FRONT GRILLE OUTER GARNISH <i>broken</i>	1.00	\$250.00
12	FRONT GRILLE LOWER CHROME <i>broken</i>	1.00	\$60.00
13	FRONT GRILLE RH SUPPORT BRACKET <i>dislodge</i>	1.00	\$10.00
14	FRONT GRILLE LH SUPPORT BRACKET <i>dislodge</i>	1.00	\$10.00
15	RH HEADLAMP <i>broken / dislodge</i>	1.00	\$1,200.00
16	LH HEADLAMP <i>broken</i>	1.00	\$1,200.00
17	RH HEADLAMP LOWER BRACKET <i>dislodge</i>	1.00	\$20.00
18	LH HEADLAMP LOWER BRACKET <i>broken</i>	1.00	\$20.00
19	FRONT BUMPER <i>trim</i>	1.00	\$270.00
20	FRONT BUMPER TOWING COVER <i>dislodge</i>	1.00	\$15.00
21	FRONT BUMPER CENTER LOWER GRILLE <i>broken</i>	1.00	\$40.00
22	FRONT BUMPER RH FOG LAMP <i>dislodge</i>	1.00	\$170.00
23	FRONT BUMPER LH FOG LAMP <i>broken</i>	1.00	\$170.00
24	FRONT BUMPER RH FOG LAMP COVER <i>dislodge</i>	1.00	\$20.00
25	FRONT BUMPER LH FOG LAMP COVER <i>broken</i>	1.00	\$20.00
26	FRONT BUMPER RH SIDE RETAINER <i>ist broken</i>	1.00	\$10.00
27	FRONT BUMPER LH SIDE RETAINER <i>broken ist</i>	1.00	\$10.00
28	FRONT BUMPER REINFORCEMENT <i>Denke</i>	1.00	\$210.00
29	FRONT BUMPER LOWER LIP <i>broken</i>	1.00	\$170.00
30	FRONT BUMPER UNDER COVER <i>E.H.H</i>	1.00	\$80.00

4875-w

# Vin's

**Vin's Motor Pte Ltd**  
 160 Sin Ming Drive  
 #03-03 Sin Ming Autocity  
 Singapore 575722  
 Tel : 6453 2121 Fax : 6459 9795  
 GST Registration No. 199906067G

31	FRONT BUMPER CLIPS <i>new</i>	10.00	\$20.00	✓
32	FRONT SUPPORT PANEL <i>new</i>	1.00	\$370.00	✓
33	FRONT SUPPORT PANEL TOP COVER <i>broken</i>	1.00	\$70.00	✓
34	FRONT SUPPORT PANEL AIR DUCT <i>deformed</i>	1.00	\$50.00	✓
35	AIRCON CONDENSER <i>BT / damaged</i>	1.00	\$380.00	✓
36	AIRCON CONDENSER RECEIVER PIPE <i>BT</i>	1.00	\$160.00	✓
37	AIRCON CONDENSER DISCHARGE PIPE <i>BT</i>	1.00	\$150.00	✓
38	AIRCON CONDENSER SUCTION PIPE <i>BT</i>	1.00	\$190.00	✓
39	AIRCON CONDENSER FAN MOTOR <i>Done</i>	1.00	\$160.00	✓
40	AIRCON CONDENSER FAN BLADE <i>broken</i>	1.00	\$50.00	✓
41	AIRCON CONDENSER FAN COWLING <i>broken</i>	1.00	\$70.00	✓
42	RADIATOR <i>BT / damaged</i>	1.00	\$950.00	✓
43	RADIATOR TOP HOSE <i>broken</i>	1.00	\$40.00	✓
44	RADIATOR LOWER HOSE <i>new</i>	1.00	\$40.00	x
45	RADIATOR FAN MOTOR <i>Done</i>	1.00	\$220.00	✓
46	RADIATOR FAN BLADE <i>broken</i>	1.00	\$50.00	✓
47	RADIATOR FAN COWLING <i>broken</i>	1.00	\$80.00	✓
48	RADIATOR RH SIDE GUIDE <i>deformed</i>	1.00	\$30.00	✓
49	RADIATOR LH SIDE GUIDE <i>deformed</i>	1.00	\$30.00	✓
50	RADIATOR T-JOINT <i>BT</i>	1.00	\$40.00	✓
51	WIPER TANK <i>broken</i>	1.00	\$60.00	✓
52	WIPER TANK MOTOR <i>broken</i>	1.00	\$40.00	✓
53	HORN-HIGH <i>broken</i>	1.00	\$70.00	✓
54	HORN-LOW <i>new</i>	1.00	\$80.00	x
55	INLET MANIFOLD <i>broken</i>	1.00	\$390.00	✓
56	INLET MANIFOLD HOSE <i>new</i>	1.00	\$20.00	x
57	ENGINE MOUNTING <i>broken</i>	1.00	\$120.00	✓
58	GEARBOX MOUNTING <i>broken</i>	1.00	\$190.00	✓
59	RH ENGINE MOUNTING BRACKET <i>broken BT</i>	1.00	\$110.00	✓
60	ELECTRIC WATER PUMP <i>socket broken</i>	1.00	\$490.00	✓
61	AIRCON COMPRESSOR <i>broken</i>	1.00	\$1,400.00	✓
62	ENGINE OIL SUMP <i>Done</i>	1.00	\$310.00	✓
63	ABS PUMP <i>broken / valve</i>	1.00	\$2,100.00	✓
64	RH FUSE BOX <i>broken</i>	1.00	\$620.00	✓
65	AIR CLEANER BOX <i>broken</i>	1.00	\$140.00	✓
66	BRAKE PUMP <i>Done</i>	1.00	\$920.00	✓
67	FRONT RH FENDER <i>new</i>	1.00	\$240.00	✓
68	FRONT LH FENDER <i>new</i>	1.00	\$240.00	✓
69	FRONT RH FENDER INNER SHIELD <i>deformed</i>	1.00	\$80.00	✓
70	FRONT LH FENDER INNER SHIELD <i>new</i>	1.00	\$80.00	✓
71	FRONT FENDER INNER SHIELD CLIPS <i>new</i>	20.00	\$40.00	✓
72	FRONT RH FENDER SIDE PANEL - INNER <i>Done</i>	1.00	\$90.00	✓
73	FRONT RH FENDER SIDE PANEL - OUTER <i>Done</i>	1.00	\$70.00	✓
74	FRONT RH FENDER BRACKET - INNER <i>Done</i>	1.00	\$30.00	✓

10.620.00

# Vin's

Vin's Motor Pte Ltd  
 160 Sin Ming Drive  
 #03-03 Sin Ming Autocity  
 Singapore 575722  
 Tel : 6453 2121 Fax : 6459 9795  
 GST Registration No. 199906067G

75	FRONT RH FENDER BRACKER - OUTER <i>St/Dent</i>	1.00	\$40.00	✓
76	FRONT RH FENDER "HYBRID" EMBLEM <i>hlc</i>	1.00	\$40.00	✓
77	FRONT RH WHEEL ARCH GARNISH <i>cut</i>	1.00	\$140.00	✓
78	FRONT LH WHEEL ARCH GARNISH <i>deform</i>	1.00	\$140.00	✓
79	FRONT WINDSCREEN GLASS <i>crack</i>	1.00	\$1,450.00	✓
80	FRONT WINDSCREEN GLASS MOULDING <i>hlc</i>	1.00	\$110.00	✓
81	WIPER GRILLE GARNISH <i>St</i>	1.00	\$160.00	X
82	DASHBOARD <i>broken</i>	1.00	\$610.00	✓
83	STEERING AIRBAG (ORDER) <i>actual</i>	1.00	\$1,500.00	✓
84	PASSENGER AIRBAG (ORDER) <i>actual</i>	1.00	\$1,700.00	✓
85	FRONT RH SEAT BELT <i>actual</i>	1.00	\$480.00	✓
86	FRONT LH SEAT BELT <i>actual</i>	1.00	\$480.00	✓
87	AIRBAG ECU <i>actual</i>	1.00	\$740.00	✓
88	ROOF - LINING <i>crushed</i>	1.00	\$720.00	✓
89	ROOF RH AIRBAG (ORDER) <i>actual</i>	1.00	\$910.00	✓
90	FRONT RH SEAT AIRBAG (ORDER) <i>actual</i>	1.00	\$850.00	✓
91	AIRBAG SENSOR <i>actual</i>	1.00	\$280.00	✓
92	AIRBAG ECU <i>reported</i>	1.00	\$710.00	X
93	FRONT RH SHOCK ABSORBER <i>St</i>	1.00	\$280.00	✓
94	FRONT RH KNUCKLE ARM <i>St</i>	1.00	\$180.00	✓
95	FRONT RH WHEEL BEARING <i>St</i>	1.00	\$100.00	✓
96	FRONT RH LOWER ARM <i>St</i>	1.00	\$180.00	✓
97	FRONT RH DRIVE SHAFT <i>St</i>	1.00	\$850.00	✓
98	FRONT RH STABILIZER LINK <i>St</i>	1.00	\$40.00	✓
99	STEERING RACK N PINION <i>St</i>	1.00	\$900.00	✓
100	ANTI ROLL BAR <i>St</i>	1.00	\$130.00	✓
101	FRONT CROSS MEMBER <i>St</i>	1.00	\$510.00	✓

13,360.00

28,855.00

31,740.50

\$30,345.00  
 \$3,034.50

Margin: 10%

\$33,379.50

102	FRONT BUMPER DAY LIGHT <i>o/s damaged</i>	1.00	\$500.00	✓ 200/-
103	FRONT NO.PLATE <i>St</i>	1.00	\$40.00	✓
104	FRONT RH TYRE <i>St cut 50% dep</i>	1.00	\$280.00	✓ 140/-
105	WINDSCREEN GUM <i>hlc</i>	1.00	\$80.00	✓ 40/-
106	ERP BRACKET <i>hlc</i>	1.00	\$26.00	✓
107	COOLANT <i>hlc</i>	1.00	\$60.00	✓
108	TO REFILL AIRCON GAS <i>hlc</i>	1.00	\$150.00	✓ 120/-
109	TO CHECK WHEEL ALIGNMENT	1.00	\$150.00	✓ 60/-
110	TO REMOVE AND REFIX FRONT UNDERCARRIAGE	1.00	\$380.00	✓ 180/-
111	TO REMOVE AND REPLACE FRONT WINDSCREEN	1.00	\$150.00	✓ 120/-
112	TO REMOVE AND REPLACE DASHBOARD	1.00	\$380.00	✓ 180/-
113	TO REMOVE AND REFIX ENGINE	1.00	\$500.00	✓ 250/-

506.00 SH

# Vin's

**Vin's Motor Pte Ltd**  
 160 Sin Ming Drive  
 #03-03 Sin Ming Autocity  
 Singapore 575722  
 Tel : 6453 2121 Fax : 6459 9795  
 GST Registration No. 199906067G

114	TO RESET HEADLAMP SYSTEM	1.00	<del>\$280.00</del> 30/-
115	TO RESET AIRBAG AND ENGINE ECU SYSTEM	1.00	<del>\$380.00</del> 150/-
116	TO REPAIR DAMAGES	1.00	<del>\$1,800.00</del> 1200/-
117	TO SPRAY PAINTING	1.00	<del>\$1,600.00</del> 1000/-

3290.00 =

**Subtotal w/o GST: \$40,135.50**

01/08/2022 @ 1100m  
 HA Auto  
 2/sum 18 days  
  
 LKK Auto  


35,536.50  
 Exp 11,792.00  
 -----  
 47,328.50  
 L/S 36,000/-

Check repair unit.

**LKK Auto Consultants** hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
 Signature:  
 Date:

# Vin's

**Vin's Motor Pte Ltd**  
 160 Sin Ming Drive  
 #03-03 Sin Ming Autocity  
 Singapore 575722  
 Tel : 6453 2121 Fax : 6459 9795  
 GST Registration No. 199906067G

## Estimated Cost of Repair (Supplementary)

Attention To : Allianz Insurance Singapore Pte Ltd  
 79 Robinson Road  
 #09-01  
 Singapore 068897

### Claim Details

Case Ref. No. : TP/072022/5551  
 Date : 27-07-2022  
 Accident Date : 19-07-2022

### Vehicle Details

Make & Model : Honda VEZEL 1.5X HYBRID A  
 Chassis No : RU31214810  
 Registration No : SFL6000B

### Third Party Vehicle Details

Registration No : SJB4498S

S/N	Description	Qty	Amount (S\$)
1	✓ GEARBOX <i>Down photo</i>	1.00	\$5,000.00 ✓
2	✓ ENGINE WIRE HARNESS <i>Down photo</i>	1.00	\$1,100.00 ✓
3	✓ TIMING COVER <i>broken</i>	1.00	\$300.00 ✓
4	✓ MAIN PULLEY <i>damaged</i>	1.00	\$150.00 ✓
5	✓ VVTI SENSOR <i>broken</i>	1.00	\$180.00 ✓
6	✓ STARTER <i>Down</i>	1.00	\$970.00 ✓
7	✓ LH ENGINE MOUNTING (LOWER) <i>Down</i>	1.00	\$270.00 ✓
8	✓ AIRCON SUCTION PIPE NO. 2 <i>bt photo</i>	1.00	\$130.00 ✓
9	✓ FRONT BUMPER LOWER PAD <i>Down</i>	1.00	\$190.00 ✓
10	✓ FENGINE UNDER COVER - CENTRE <i>broken</i>	1.00	\$80.00 ✓
11	✓ ENNGINE UNDER COVER - RH <i>broken</i>	1.00	\$40.00 ✓
12	✓ ENNGINE UNDER COVER - LH <i>damaged</i>	1.00	\$40.00 ✓
13	✓ LH RESONATOR <i>broken</i>	1.00	\$90.00 ✓
14	✓ SPARE TANK <i>damaged</i>	1.00	\$60.00 ✓
15	✓ LH DRIVE SHAFT <i>photo Down</i>	1.00	\$900.00 ✓
16	✓ HEADLAMP WIRE HARNESS <i>broken photo</i>	1.00	\$820.00 ✓

\$10,320.00

Margin: 10%

\$1,032.00

\$11,352.00

17	✓ FRONT LH TYRE <i>cut 50%</i>	1.00	\$280.00 <i>140/-</i>
18	TO REPAIR FRONT RH CUSHION SEAT <i>tom</i>	1.00	\$450.00 <i>300/-</i>

Subtotal w/o GST:

\$12,082.00

*05/08/2022 @ 10:00am*

*Raymond*

*JKK Auto*

*11,792.00*

Issued by Raymond Teo

This is a computer-generated document. No signature is required.