



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2300645

INV Date 02/02/2023

Reference CC4/LPC22007251/Epa3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SMZ 3898R

Insured Veh. YN 1523G

Claim No. 22/22/22/VC05/026085

Policy No. Z22VC05010212

Accident Date 29/07/2022

Inspection Date 01/08/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC22007251/Epa3q2 Date: 02/02/2023 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YN 1523G	Veh. Inspected	SMZ 3898R	
Policy No.	Z22VC05010212	Coverage (\$)	0.00	
Claim No.	22/22/22/VC05/026085	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	29/07/2022	
2. Vehicle Particulars & Condition				
Make & Model	MERCEDES BENZ GLC200	c.c	1991	
Engine No.	HIDDEN	Year of Reg.	2021	
Chassis No.	W1N2539802F907227	Colour	BLACK	
Odometer	42060 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	235/60 R18	DUNLOP	5 mm	
L/H Front Tyre	235/60 R18	DUNLOP	5 mm	
R/H Rear Tyre	235/60 R18	DUNLOP	5 mm	
L/H Rear Tyre	235/60 R18	DUNLOP	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	29/07/2022	Inspection Date	01/08/2022	
Survey held at	CYCLE & CARRIAGE INDUSTRIES PL 188 PANDAN LOOP SINGAPORE 128378 (MERCEDES-BENZ)			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			10 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMZ 3898R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	LH/R TAIL LAMP (SN)	CRACKED	533.10	533.10
1	REAR BUMPER (SN)	BROKEN	1,002.77	1,002.77
1	REAR BUMPER BOTTOM PANEL (SN)	CUT	535.33	535.33
1	REAR BUMPER BOTTOM PANEL CHROME (SN)	NOT NECESSARY	780.48	-
1	LH/R BUMPER SIDE BRACKET (SN)	NECESSARY	165.24	165.24
1	LH/R OUTER PARKING SENSOR (SN)	NOT NECESSARY	195.43	-
1	LH/R PARKING SENSOR SEAL (SN)	NECESSARY	7.10	7.10
1	LH/R FENDER (SN)	DENTED	3,452.02	3,452.02
1	LH/R FENDER AIR FLAP (SN)	NOT NECESSARY	53.78	-
1	LH/R FENDER SIDE TRIM (SN)	CUT	256.65	256.65
1	LH/R WHEEL ARCH (SN)	NOT NECESSARY	216.69	-
1	LH/R FENDER 3/4 GLASS (SN)	NECESSARY	422.92	422.92
1	GLAZING REPAIR KIT (SN)	NECESSARY	179.31	179.31
1	ADHESIVE SEALANT (SN)	NECESSARY	858.76	858.76
1	SEAM SEALANT (SN)	NECESSARY	116.07	116.07
1	CAVITY WAX PROTECTION (SN)	NECESSARY	116.04	116.04
1	REAR CROSS MEMBER (SN)	NOT NECESSARY	850.57	-
1	BASIC MOUNTING FOR BUMPER (SN) (ADDITIONAL)	BROKEN	46.59	46.59
2	PLUG (SN) (ADDITIONAL)	NECESSARY	5.40	5.40
			9,794.25	7,697.30
	<u>LABOUR</u>			
	USE XENTRY TO CHECK CONTROL UNITS & RESET MEMORY TO STANDARD SETTINGS.		380.00	380.00
	CHECK REAR LIGHTING SYSTEM AND CONDUCT WATER TEST FOR ANY LEAKAGE .		120.00	120.00
	REMOVE & INSTALL REAR BOOT LID COMPARTMENT INTERIOR.		1,440.00	960.00
	CAVITY PRESERVATION ON REPLACED OR REPAIRED BODY PANELS PERFORM.		180.00	180.00
	BEADS ,SEAMS AND FLANGES ON REPLACEMENT BODY PANELS /COMPONENTS .		120.00	120.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE & RELACE REAR BUMPER REAR LEFT FENDER & REMOVE REAR SUPPORT ASSY COMPONENTS & REFINISH.		5,760.00	4,320.00
	RESPRAY REAR BUMPER ,REAR LEFT FENDER & REAR END PANEL.		2,400.00	2,000.00
	SUPPLY 1PC REAR LEFT FENDER 3/4 GLASS SOLAR FILM.		100.00	100.00
			10,500.00	8,180.00
GRAND TOTAL			20,294.25	15,877.30
RECOMMENDED COST OF REPAIRS				15,877.30

Report Ref No. CC4/LPC22007251/Epa3q2

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMZ 3898R

INSPECTION

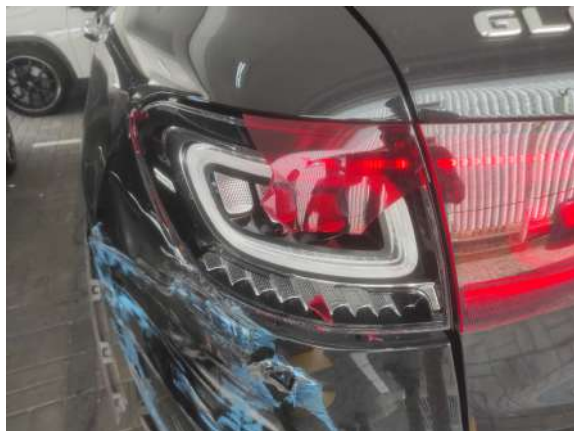



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

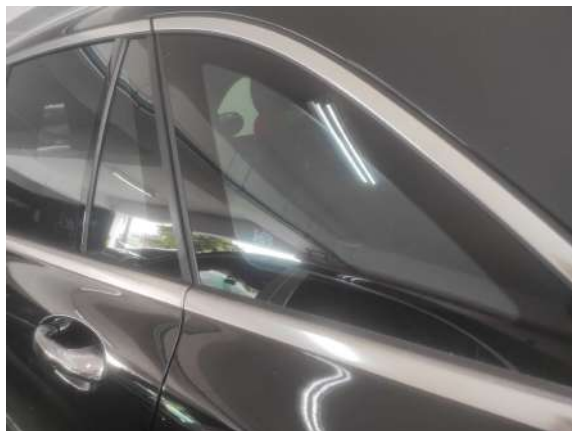



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMZ 3898R

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

