

Success United Pte Ltd (Co.Reg.No 200402570G)2 Kaki Bukit Ave 2 #01-33, Kaki Bukit AutoHub
Singapore 417921

Tel: 6746 1515 Fax: 6748 5015 Email: sirina@successunited.com.sg

INSURER: Allianz Insurance Singapore Pte. Ltd. (HQ)**PARTICULARS OF CLAIM**

Claim Type:	OD (Own Damage)	Ref. No:	SU220089
Policy No:	SP2000683520-01	Date of Loss:	03/08/2022
Vehicle Reg. No.:	SLT7798M	Driveable?	
Driver Age/Info:	51 / MALE	Party At Fault:	UNKNOWN
TP Injury Involved?	NO	Third Party Involved?	YES
Insured/Claimant:	Law Johnny	Contact No:	+6594560564
Driver:	Law Johnny		
Make/Model:	MERCEDES-BENZ GLC250D, 2.1 4MATIC (A)	Vehicle Reg. Date:	05/12/2017
Vehicle Colour:	Blue		
Engine No:	65192134164018	Chassis No:	WDC2539092F285839
Odometer:	84173 KM		
Paint Type:			
Total Loss?	NO		
Est. Duration of Repair (day)	10		
Description of Accident/Loss	REFER TO SKETCH PLAN.		
Present Location:	SUCCESS UNITED PTE LTD (HQ)		

COST OF CLAIMS	Amount
Parts	18,086.30
Miscellaneous Items	0.00
Labour	1,880.00
Paintwork Labour	1,000.00
Towing	0.00
Calculated Gross Total (S\$)	20,966.30
- Excess (S\$)	300.00
(S\$)	20,666.30
+ GST 7.00% (S\$)	1,446.64
Nett Amount (S\$)	22,112.94

This claim is handled by: TEO WEE KEONG

Generated using Merimen e-Claims Internet Estimation & Adjusting System

REPAIR DETAILS

Reference

Part Source: MRM-SG **Version:** 1.0 (Last Synchronised: 04 Aug 2022)
Parts: 143 **MERCEDES-BENZ GLC250D 2.1 4MATIC (A) (Catalogue:Merimen Singapore 1.0)**
Labour: Repairer's **(Price-denominated Standard List)**
Print Code: Success United Pte Ltd/SLT7798M/04/08/2022 18:21
Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*FRT BONNET <i>Deleted</i>	0.00	0.00	*1,200.00 F ✓
2	2		*FRT BONNET HINGE L/R <i>new</i>	0.00	0.00	*300.00 F ✓
3	2		*FRT BONNET DAMPER ABSORBER L/R <i>new</i>	0.00	0.00	*160.00 F ✓
4	1		*FRT BONNET WEATHERSTRIP <i>cut new</i>	0.00	0.00	*50.00 F ✓
5	1		*FRT BONNET MERCEDES LOGO	0.00	0.00	*35.00 F ✓
6	2		*FRT BONNET TOP HOOK LOCK L/R <i>new</i>	0.00	0.00	*64.00 F ✓
7	1		*FRT BONNET CENTRE TOP LOCK LEVER <i>Best</i>	0.00	0.00	*45.00 F ✓
8	2		*FRT BONNET LOCK SPRING L/R <i>RH new</i>	0.00	0.00	*50.00 F ✓
9	1		*FRT BONNET LOCK PANEL <i>Best</i>	0.00	0.00	*28.00 F ✓
10	1		*FRT BONNET LOCK CABLE	0.00	0.00	*68.00 F ✓
11	2		*FRT FENDER L/R <i>asked</i>	0.00	0.00	*900.00 F ✓
12	1		*FRT FENDER GUARD RH <i>cut</i>	0.00	0.00	*155.00 F ✓
13	2		*HEADLAMP ASSY L/R <i>RH smashed, LH ?</i>	0.00	0.00	*3,300.00 F ✓
14	2		*HEADLAMP BRACKET L/R	0.00	0.00	*76.00 F ✓
15	1		*FRT GRILLE BRACKET <i>smashed</i>	0.00	0.00	*42.00 F ✓
16	1		*FRT GRILLE ASSY	0.00	0.00	*600.00 F ✓
17	1		*FRT GRILLE MERCEDES LOGO	0.00	0.00	*120.00 F ✓
18	1		*FRT CAMERA UNIT	0.00	0.00	*1,050.00 F ✓
19	1		*FRT BUMPER UNDER SHIELD COVER <i>new found</i>	0.00	0.00	*195.00 F ✓
20	1		*FRT BUMPER ASSY <i>Distahed</i>	0.00	0.00	*850.00 F ✓
21	2		*FRT BUMPER SIDE HOLDER L/R <i>RH new</i>	0.00	0.00	*50.00 F ✓
22	2		*FRT BUMPER BRACKET L/R	0.00	0.00	*90.00 F ✓
23	1		*FRT BUMPER INNER BASE FRAME SUPPORT	0.00	0.00	*150.00 F ✓
24	1		*FRT BUMPER INNER SPONGE <i>could</i>	0.00	0.00	*110.00 F ✓
25	1		*FRT BUMPER REINFORCEMENT <i>Best</i>	0.00	0.00	*300.00 F ✓
26	2		*FRT BUMPER REINFORCEMENT BRACKET L/R	0.00	0.00	*290.00 F ✓
27	1		*FRT BUMPER TOW HOOK COVER <i>missing</i>	0.00	0.00	*38.00 F ✓
28	1		*FRT BUMPER LOWER AIR GRILLE <i>could</i>	0.00	0.00	*195.00 F ✓
29	1		*FRT BUMPER LOWER EXTENSION <i>could</i>	0.00	0.00	*220.00 F ✓
30	1		*FRT BUMPER LOWER CENTRE CHROME TRIM	0.00	0.00	*385.00 F ✓
31	6		*FRT BUMPER PARKING SENSO PDC	0.00	0.00	*750.00 F ✓
32	1		*FRT NO. PLATE GARNISH <i>Deleted</i>	0.00	0.00	*83.00 F ✓
33	1		*FRT PARKING SENSOR WIRE HARNESS	0.00	0.00	*135.00 F ✓
34	1		*RADIATOR SUPPORT PANEL ASSY <i>Brined</i>	0.00	0.00	*320.00 F ✓
35	2		*RADIATOR SUPPORT BRACE PANEL L/R <i>Best</i>	0.00	0.00	*136.00 F ✓
36	1		*HORN	0.00	0.00	*135.00 F ✓
37	1		*RADIATOR ASSY	0.00	0.00	*700.00 F ✓
38	2		*RADIATOR SIDE AIR GUIDE DUCT L/R <i>Deleted</i>	0.00	0.00	*134.00 F ✓
39	1		*AIRCON CONDENSER <i>Deleted</i>	0.00	0.00	*825.00 F ✓
40	1		*AIRCON LIQUID PIPE <i>new</i>	0.00	0.00	*195.00 F ✓
41	1		*RADIATOR LOWER SUPPORT	0.00	0.00	*135.00 F ✓
42	2		*FRT BUMPER SIDE FOGLAMP COVER L/R <i>fit new</i>	0.00	0.00	*106.00 F ✓
43	1		*AIR INTAKE DUCT <i>could</i>	0.00	0.00	*175.00 F ✓
44	1		*OUTSIDE TEMPERATURE SENSOR	0.00	0.00	*58.00 F ✓
45	1		*FRT WINDSCREEN SIDE TRIM MOULDING LH	0.00	0.00	*135.00 F ✓
46	1		*RADIATOR AUXILIARY FAN ASSY <i>new</i>	0.00	0.00	*980.00 F ✓
47	1		*BUMPER CLIPS <i>new</i>	0	0.00	*40.00 FS ✓


48	1	*FENDER INNER LINER CLIPS <i>new</i>	0	0.00	*40.00 FS ✓
49	1	*FRT NO. PLATE W/FAME <i>missing</i>	0	0.00	*40.00 FS ✓
50	1	*FRT FENDER INNER LINER RH (FRT) ?	0.00	0.00	*130.00 F ?
51	1	*FRT FENDER INNER LINER RH (REAR) <i>new</i>	0.00	0.00	*85.00 F +

F=Franchise part. S=SpcNett.

Sub Total (\$\$) **16,453.00**
+ Margin on L,N Items 10.00% (\$\$) **1,633.30**

Total Parts (\$\$) **18,086.30**

Success United Pte Ltd/SLT7798M/04/08/2022 18:21. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

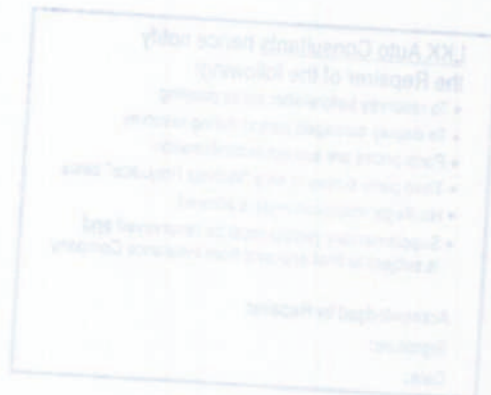

Estimates on Miscellaneous Items

There are no new miscellaneous items selected.

Estimates on Labour

No	Particulars	Lab.Type	Amount
Paintwork Labour			
1	TO PUTTY AND RESPRAY PAINTING ON AFFECTED AREA.	New	1,000.00 <i>800</i>
Labour Items			
2	TO REMOVE, REARRANGE ELECTRICAL WIRINGS, CHECK LIGHTING.	New	80.00 <i>50</i>
3	TO REMOVE, REINSTAL AIRCON PARTS, VACUM, REFILL GAS.	New	300.00 <i>150</i>
4	TO REMOVE, REPAIR AND REPLACED DAMAGED BODYPARTS, REALIGN BODYWORKS & WHERE CONSISTENT TO THE ACCIDENT.	New	1,500.00 <i>1000</i>
Gross Labour Cost (\$\$)			2,880.00

Success United Pte Ltd/SLT7798M/04/08/2022 18:21. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

Adm Lj
P/P 08/08/22
HE Authorised,
Exen \$300

- LKK Auto Consultants hence notify the Repairer of the following:
- To resurvey before/after spray painting
 - To display damaged part(s) during resurvey
 - Parts prices are subject to confirmation
 - Third party survey is on a "Without Prejudice" basis
 - No illegal modification(s) is allowed
 - Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: