



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

LONPAC INSURANCE BHD  
300 BEACH ROAD  
#17-04/07 THE CONCOURSE  
SINGAPORE 199555

INV No. AC2300147  
INV Date 10/01/2023  
Reference CC4/LPC22007637/Kpa3q2  
Code LPC2

#### PROFESSIONAL SERVICE FEE

Vehicle No. SMY 8272T  
Insured Veh. SCG 2266P  
Claim No. 21/22/22/VC05/026125  
Policy No. Z21VP05030250  
Accident Date 07/08/2022  
Inspection Date 29/08/2022

Description	Total
Third Party Express Settlement	400.00
<b>Subtotal</b>	<b>400.00</b>
<b>GST (8%)</b>	<b>32.00</b>
<b>Grand Total</b>	<b>432.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## Affiliated to Federation Internationale Des Experts En Automobile

LONPAC INSURANCE BHD  
300 BEACH ROAD  
#17-04/07 THE CONCOURSESINGAPORE 199555

Ref: CC4/LPC22007637/Kpa3q2

Date: 10/01/2023

Code: LPC2

### 1. Policy Particulars :- THIRD PARTY CLAIM

<b>Insured Veh.</b>	SCG 2266P	<b>Veh. Inspected</b>	SMY 8272T
<b>Policy No.</b>	Z21VP05030250	<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	21/22/22/VC05/026125	<b>Excess (\$)</b>	0.00
<b>Assign From</b>	GERALD	<b>Assign Date</b>	11/08/2022

### 2. Vehicle Particulars & Condition

<b>Make &amp; Model</b>	AUDI A4 (A)	<b>c.c</b>	1984
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2021
<b>Chassis No.</b>	WAUZZZF46LN014386	<b>Colour</b>	WHITE
<b>Odometer</b>	8311 KM	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	STANDARD ALLOY RIM
<b>General</b>	GOOD		

### 3. Conditions of Tyres

	Size	Make	Balance
<b>R/H Front Tyre</b>	225/50 R17	HANKOOK	4 mm
<b>L/H Front Tyre</b>	225/50 R17	HANKOOK	4 mm
<b>R/H Rear Tyre</b>	225/50 R17	HANKOOK	3 mm
<b>L/H Rear Tyre</b>	225/50 R17	HANKOOK	3 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY.  
DAMAGES SEE DETAILS.

### 5. General Information

<b>Accident Date</b>	07/08/2022	<b>Inspection Date</b>	29/08/2022
<b>Survey held at</b>	DING AUTO PTE LTD 176 SIN MING DRIVE #04-06 SIN MING AUTOCARE SINGAPORE 575721		

### 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.  
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **5 Working Days**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMY 8272T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b>REPLACEMENT OF PARTS</b>				
1	REAR BUMPER	TO REPAIR SEE LABOUR	2,177.64	-
1	REAR FENDER RHS	TO REPAIR SEE LABOUR	2,600.54	-
1	REAR DOOR RHS	BENT	1,999.75	1,999.75
1	FRONT DOOR RHS	BENT	1,999.75	1,999.75
1	ROCKER PANEL RHS	TO REPAIR SEE LABOUR	2,507.54	-
1	REAR RIM RHS	DENTED	2,000.32	1,511.20
	LESS 5% DISCOUNT		-664.28	-275.54
			12,621.26	5,235.16
<b>SPECIAL NETT ITEMS</b>				
1	BUMPER CLIPS (SN)	NOT NECESSARY	50.00	-
1	FENDER INNER SHIELD CLIPS (SN)	NOT NECESSARY	50.00	-
			100.00	-
<b>LABOUR</b>				
	PANEL BEAT -ACCIDENT AREA .INCLUSIVE OF THE REPAIR OF REAR FENDER RHS ,REAR BUMPER AND ROCKER PANEL RHS .		1,000.00	500.00
	SPRAY PAINT-REAR BUMPER ,REAR FENDER LHS ,REAR DOOR LHS ,FRONT DOOR LHS ,ROCKER PANEL LHS. RUST PROOFING.}		1,500.00	800.00
	REMOVE AND REFIT DOOR COMPONENTS .}		60.00	120.00
	REMOVE AND REFIT DOOR REGULATOR MOTOR .}		150.00	-
	REMOVE AND REFIT DOOR GLASS TO TRANSFER .}		150.00	-
	CHECK WIRING AND CHECK ALIGNMENT.		60.00	60.00
			3,070.00	1,480.00
<b>GRAND TOTAL</b>			<b>15,791.26</b>	<b>6,715.16</b>



<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>			<b>5,400.00</b>
---	--	--	-----------------

Report Ref No. CC4/LPC22007637/Kpa3q2

**KONG SENG CHEONG**

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.**

**No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.**



# LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SMY 8272T

## INSPECTION

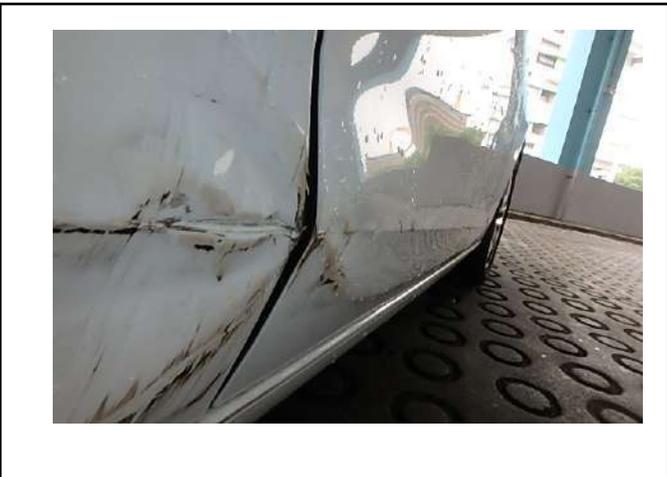



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMY 8272T

RE-INSPECTION

