


Repair Estimate

# Fulco Autocare Pte Ltd

176 Sin Ming Drive #03-02 Sin Ming Autocare Singapore 575721  
 Tel: (65) 6552 0302 Fax: (65) 6552 0780 Email: admin@fulcoautocare.com

Make/Model: CITROEN BERLINGO  
 Engine/Chassis No.: VF77FBHYMHJ758457  
 Date of accident:  
 Damaged area: O/S Front

Date: 11/08/2022  
 Claim Type: OD  
 VRN: GBH2141Y

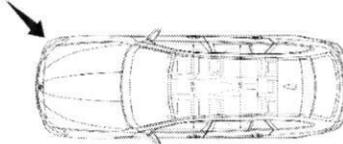

List items					
S/N	Parts description	QTY	UNIT PRICE	AMOUNT	
1	Bonnet	1	\$ 480.00	\$ 480.00	R X
2	Bonnet rubber seal	1	\$ 55.00	\$ 55.00	SVC X
3	Bonnet lock	1	\$ 75.00	\$ 75.00	R X
4	Bonnet hinge	2	\$ 85.00	\$ 170.00	R X
5	Front grille top panel	1	\$ 120.00	\$ 120.00	R X
6	Front grille chrome garnish	1	\$ 140.00	\$ 140.00	SVC X
7	Front bumper	1	\$ 320.00	\$ 320.00	R X
8	Front cross member	1	\$ 1,380.00	\$ 1,380.00	BT ✓
9	Front bumper side retainer	2	\$ 40.00	\$ 80.00	SVC X
10	Front bumper reinforcement	1	\$ 240.00	\$ 240.00	R X
11	Front bumper inner sponge	1	\$ 120.00	\$ 120.00	SVC X
12	Front bumper foglamp o/s	1	\$ 100.00	\$ 100.00	SVC X
13	Front bumper foglamp garnish o/s	1	\$ 135.00	\$ 135.00	?
14	Front bumper tow cover	1	\$ 35.00	\$ 35.00	SVC X
15	Front bumper lower cover	1	\$ 190.00	\$ 190.00	SVC X
16	Aircon condenser	1	\$ 190.00	\$ 190.00	?
17	Headlamp o/s	1	\$ 320.00	\$ 320.00	SVC X
18	Front fender o/s	1	\$ 350.00	\$ 350.00	R X
19	Front fender inner shield o/s	1	\$ 150.00	\$ 150.00	SVC X
20	Front bumper lower grille	1	\$ 240.00	\$ 240.00	SVC X
21	Day running lamp o/s	1	\$ 160.00	\$ 160.00	SVC X
22	Front lower arm o/s	1	\$ 150.00	\$ 150.00	BT ✓
23	Front shock absorber o/s	1	\$ 155.00	\$ 155.00	BT ✓
24	Front shock absorber top mount o/s	1	\$ 45.00	\$ 45.00	?
25	Front shock absorber top mount bearing o/s	1	\$ 30.00	\$ 30.00	?
26	Front end link o/s	1	\$ 40.00	\$ 40.00	BT ✓
27	Tie rod end o/s	1	\$ 40.00	\$ 40.00	?
28	Front wheel knuckle o/s	1	\$ 400.00	\$ 400.00	BT ✓
29	Front wheel knuckle bearing o/s	1	\$ 80.00	\$ 80.00	rec ✓
30	Steering rack & pinion assy	1	\$ 1,350.00	\$ 1,350.00	?

Repair Estimate

<b>Subtotal</b>	<b>\$ 7,340.00</b>
<b>Cost Plus</b>	10.00%
<b>Total</b>	<b>\$ 8,074.00</b>

Special nett items					
No.	Parts description	QTY	UNIT PRICE	AMOUNT	
1	Bonnet insulator clips	8	\$ 5.00	\$ 40.00	nn x
2	Bonnet rubber seal clips	4	\$ 5.00	\$ 20.00	nn x
3	Front bumper clips	10	\$ 5.00	\$ 50.00	nn x
4	Front fender inner shield o/s clips	8	\$ 5.00	\$ 40.00	rec ✓
5	Front bumper lower cover clips	10	\$ 5.00	\$ 50.00	nn x
6	Front bumper sensor o/s	1	\$ 140.00	\$ 140.00	svc x
7	Front steel wheel o/s	1	\$ 200.00	\$ 200.00	Bt ✓
8	Front wheel cover o/s	1	\$ 150.00	\$ 150.00	dd ✓
9	Front tyre o/s	1	\$ 120.00	\$ 120.00	pun 30% #36 ✓
10	Sundries	1	\$ 50.00	\$ 50.00	nn x
<b>Total</b>				<b>\$ 860.00</b>	

Labour				
No.	Description	Work unit	Amount	
1	To dismantle / renew accident damaged portions. To panel beat, reshape, straighten, orientate and align repair / replacement parts.	5	\$ 1,000.00	300
2	To disconnect front wire harness of electrical components to facilitate repairs, reconnect and check functions including focusing headlamps.	0.25	\$ 50.00	20
3	To remove and replace a/c condenser to facilitate repair work. To recharge system and check a/c functionality.	0.75	\$ 150.00	?
4	To remove and refit o/s front rim & tyre for replacement. To perform tyre balancing.	0.25	\$ 50.00	20
5	Supply spray paint material and necessary items to respray affected area / panel.	4	\$ 800.00	400
6	To rust proof all affected portions after repair.	0.5	\$ 100.00	not ins x
7	To remove and refit o/s front undercarriage for replacement of parts.	1	\$ 200.00	✓
8	To conduct computerized wheel alignment.	0.5	\$ 100.00	60
<b>Total labour</b>			<b>\$ 2,450.00</b>	

**Estimate Grand Total \$ 11,384.00**

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: