

ASS. REC. BY:

REF:

AIG / 220077141kg

C

Kenneth

## ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: \_\_\_\_\_

at Workshop m/s \_\_\_\_\_

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. \_\_\_\_\_

Claims No. \_\_\_\_\_

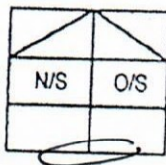
Sum Insured: \_\_\_\_\_

Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its  
repair at the time of inspection.

Bal. or Market Value: \_\_\_\_\_

IDAC Accident Rpt: \_\_\_\_\_

Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_

Consistent? : Yes or No

Est. Repairs: \_\_\_\_\_

02 days

Res.: Yes or No

Lum Sum: \_\_\_\_\_

1.81 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: \_\_\_\_\_

Person Contacted: \_\_\_\_\_

Vehicle: IN / OUT

Veh No: \_\_\_\_\_

SHC 5323A

Yr Regn: \_\_\_\_\_

02 21

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: \_\_\_\_\_

Toy Prius

c.c

1798

Colour: M.P. White / Red

A/C:

Insured / Std / NI / NA

Sp. Reading

108971

T/Radio:

Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: \_\_\_\_\_

JTDKB3124003093762

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F: Wanli

195/65R15

R: Sailun

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /  
TOYO / YOKO or

Front

Rear

R/Bal.

7

mm

R/Bal.

9

mm

L/Bal.

7

mm

L/Bal.

9

mm

D.O.A.

10/8/22

D.O.I.

11/8/2022

Survey held at \_\_\_\_\_

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

16/8 @ 1175.08 Cnh

Date/Time, File Pass to?

☐

: Prell. Report

1)

Date/Time, File Return to?

☐

: Final Report

2)

Days Of Repair: \_\_\_\_\_

Resurvey No. of Trip: \_\_\_\_\_

Survey Fee: \_\_\_\_\_

Transportation

S + RS. \$

Fees

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Report Format :

Lump Sum / I.B.I: (\$

Not Authored  
Resurvey B4 Paint

AAD2208-

81175.08

**Trans-cab Auto Services Pte Ltd**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

**SHC5323A**

Vehicle No.:

Chassis No.:

Co UEN:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration:

11 AUG 2022

**SHC5323A**

JTDKB3FU003093762

200303878K

TOYOTA

PRIUS GEN 4

10/08/2022

**SNG1617L/AIG**

25/02/2021

| PART |                                     |
|------|-------------------------------------|
| 1    | COVER, REAR BUMPER                  |
| 1    | REINFORCEMENT SUB-ASSY, REAR BUMPER |
| 1    | COVER, REAR BUMPER, LOWER           |
| 1    | GUARD, REAR BUMPER, CENTER          |
| 1    | RETAINER, REAR BUMPER SIDE, LH      |
| 1    | REFLECTOR ASSY, REFLEX, LH          |
| 1    | PANEL SUB-ASSY, BODY LOWER BACK     |
| 1    | LINER, REAR WHEEL HOUSE, LH         |
| 1    | COVER, REAR FLOOR CTR               |
| 1    | COVER, FLOOR UNDER, NO.1 LH         |

| LIST         |                    |
|--------------|--------------------|
| \$           | 485.60             |
| \$           | 332.70             |
| \$           | 22.00              |
| \$           | 374.50             |
| \$           | 132.60             |
| \$           | 39.00              |
| \$           | 651.00             |
| \$           | 139.80             |
| \$           | 229.90             |
| \$           | 175.10             |
| <b>TOTAL</b> | <b>\$ 2,582.20</b> |
| <b>25%</b>   | <b>\$ 645.55</b>   |
|              | <b>\$ 1,936.65</b> |

**Special Nett**

|                                |
|--------------------------------|
| 1SET PARKING AID               |
| 1SET REAR BUMPER CLIP          |
| 1 REAR BUMPER PROTECTOR        |
| 1SET REAR BUMPER RETAINER CLIP |
| 1 END PANEL TRIM CLIP          |

|              |                    |
|--------------|--------------------|
| \$           | 700.00             |
| \$           | 95.00              |
| \$           | 180.00             |
| \$           | 85.00              |
| \$           | 65.00              |
| <b>TOTAL</b> | <b>\$ 1,125.00</b> |

**TOTAL PARTS \$ 3,061.65**

**LABOUR**

To Remove And Refit Rear Big and Small W/Screen Glass To  
Facilitate Bodywork Repair.

\$ 300.00

**Trans-cab Auto Services Pte Ltd**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

**SHC5323A****AAD2208-**

|                                                                                                                           |    |    |          |      |
|---------------------------------------------------------------------------------------------------------------------------|----|----|----------|------|
| To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.                           | \$ | na | 380.00   | X    |
| Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same | \$ |    | 2,200.00 | 2001 |
| To transfer of rear end panel fittings, attachment and perform water seepage test.                                        | \$ | 4  | 380.00   | X    |
| To transfer of Tailgate fittings, attachments and perform water seepage test.                                             | \$ | 4  | 180.00   | X    |
| To remove and refit electrical wiring, battery and other necessary items to facilitate bodywork repair.                   | \$ | 4  | 480.00   | X    |
| To transfer of Fender fittings, attachments and perform water seepage test.                                               | \$ | 4  | 480.00   | X    |
| To check steering geometry and computer wheel alignment                                                                   | \$ | 4  | 220.00   | X    |
| To Rust-Proofing and apply undercoat Of The Affected Areas.                                                               | \$ | 4  | 250.00   | X    |
| Towing Fees                                                                                                               | \$ | 4  | 150.00   | X    |
| Putty And Spray Painting Of The Affected Portion.                                                                         | \$ |    | 2,200.00 | 2201 |
| To reinstall rear bumper parking sensor.                                                                                  | \$ |    | 170.00   | 501  |
| To Check Electrical Lighting Concerned.                                                                                   | \$ | 4  | 170.00   | X    |
| To transfer of luggage floor panel fittings, attachment and perform water seepage test.                                   | \$ | 4  | 380.00   | X    |
| To transfer of tire, rim and on wheel balancing.                                                                          | \$ | 4  | 220.00   | X    |

**Trans-cab Auto Services Pte Ltd**

AAD2208-

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC5323A

To conduct and perform a comprehensive vehicle diagnostic check  
and reset vehicle warning indicators.

|                       |    |                           |
|-----------------------|----|---------------------------|
|                       | \$ | <i>nn</i> 380.00 <i>X</i> |
| <b>TOTAL</b>          | \$ | <b>8,540.00</b>           |
| <b>Over All Total</b> | \$ | <b>11,601.65</b>          |

**(PART-BY-PART) Repair Days****25 DAYS**  
*2 days*

LKK Auto Consultants hence notify  
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and  
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: