

ASS. REC. BY:

REF: GRB1

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s S&H

of _____

Insured: _____

Policy No. _____

Claims No. _____


Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

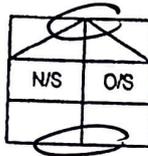

Bal. or Market Value: 859k

IDAC Accident Rport: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 10-12 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SIG 0339E Yr Regn: 10, 16

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or (A)

Make: Honda Vezel c.c. 1498

Colour: M.P. White A/C: Insured / Std / NI / NA

Sp. Reading: 196131 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: RU3 1202992

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD / RIM or

Tyre Size: F: _____ R: _____

225/45R18

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Aiten 80

Front _____ Rear _____

R/Bal. 8 mm R/Bal. 8 mm

L/Bal. 8 mm L/Bal. 8 mm

D.O.A. 8/8/22 D.O.I. 15/8/2022

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop, or

& P

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Date/Time, File Pass to?

: Prell. Report

Days Of Repair: _____

1) _____

: Final Report

Resurvey No. of Trlp: _____

Date/Time, File Return to?

Survey Fee:

2) _____

Add Fee: : Site Insp (\$ _____)

Transportation:

: Interview (\$ _____)

_____ S - RS. SI

: Tech Invs (\$ _____)

: Weekend (\$ _____)

_____ Others

Report Format :

Lump Sum / I.B.I. (\$ _____)

TOTAL

Not Authorized
U/Sing &
Provision After Paint



Ho Wee Lam
 Blk 96 #12-30 Lorong 3 Toa Payoh
 Singapore 310096

10-12 days

File No :
 Date : 12-August-2022

Estimated cost of repair for vehicle no : SLG6339E Honda Vezel
 Accident involving vehicle no: SLG6339E & SLR2981T on 08.08.2022

| Description | Quantity | Cost Price |
|--|----------|----------------------------|
| Bonnet | 1 | \$ <i>B</i> 450.00 ✓ |
| RH bonnet hinge | 1 | \$ <i>D17</i> 38.00 ✓ |
| LH bonnet hinge | 1 | \$ <i>D17</i> 38.00 ✓ |
| Bonnet lock | 1 | \$ <i>B1</i> 90.00 ✓ |
| RH bonnet inner rubber seal | 1 | \$ 25.00 ? |
| LH bonnet inner rubber seal | 1 | \$ 25.00 ? |
| RH bonnet inner centre seal | 1 | \$ 25.00 ? |
| LH bonnet inner centre seal | 1 | \$ 25.00 ? |
| RH head lamp | 1 | \$ <i>MB/CM</i> 1,050.00 ✓ |
| LH head lamp | 1 | \$ <i>u</i> 1,050.00 ✓ |
| RH head lamp bracket | 1 | \$ 30.00 ? |
| LH head lamp bracket | 1 | \$ 30.00 ? |
| Front grille | 1 | \$ <i>CM</i> 360.00 ✓ |
| Front grille clips (1 set) | 1 | \$ <i>na</i> 12.00 ✓ |
| Front grille emblem | 1 | \$ <i>na</i> 28.00 ✓ |
| Front grille chrome moulding centre | 1 | \$ <i>CM</i> 280.00 ✓ |
| Front grille centre upper bracket | 1 | \$ 58.00 ? |
| RH Front grille bracket | 1 | \$ 20.00 ? |
| LH Front grille bracket | 1 | \$ 20.00 ? |
| RH Front grille chrome moulding | 1 | \$ <i>CM</i> 55.00 ✓ |
| LH Front grille chrome moulding | 1 | \$ <i>CM</i> 55.00 ✓ |
| Front bumper | 1 | \$ <i>Bu</i> 450.00 ✓ |
| Front bumper clips (1 set) | 1 | \$ <i>na</i> 15.00 ✓ |
| Front bumper centre grille | 1 | \$ <i>su</i> 55.00 X |
| Front bumper reinforcement | 1 | \$ 260.00 ? |
| RH Front bumper retainer | 1 | \$ <i>D17</i> 20.00 ✓ |
| LH Front bumper retainer | 1 | \$ <i>D17</i> 20.00 ✓ |
| RH Front bumper daytime LED lamp | 1 | \$ <i>su</i> 380.00 X |
| LH Front bumper daytime LED lamp | 1 | \$ <i>su</i> 380.00 X |
| RH Front bumper daytime LED lamp cover | 1 | \$ <i>su</i> 60.00 X |
| LH Front bumper daytime LED lamp cover | 1 | \$ <i>su</i> 60.00 X |
| Front bumper lower spoiler | 1 | \$ <i>su</i> 280.00 X |
| RH Front bumper retainer | 1 | \$ <i>Repair</i> 20.00 X |
| LH Front bumper retainer | 1 | \$ <i>u</i> 20.00 X |
| RH Front bumper bracket | 1 | \$ 35.00 ? |
| LH Front bumper bracket | 1 | \$ 35.00 ? |
| RH front fender | 1 | \$ <i>B1</i> 220.00 ✓ |
| LH front fender | 1 | \$ 220.00 ? |

AWJ.
MTC
From
Estim

| | | | | |
|---|---|----|--------|---|
| RH front fender badge "hybrid" | 1 | \$ | 55.00 | ✓ |
| LH front fender badge "hybrid" | 1 | \$ | 55.00 | ✓ |
| Front support panel | 1 | \$ | 380.00 | ? |
| Front support panel top garnish | 1 | \$ | 65.00 | ? |
| Front support panel top garnish clips (1 set) | 1 | \$ | 18.00 | ? |
| Air con condensor | 1 | \$ | 380.00 | ? |
| Air con condensor pipe inlet | 1 | \$ | 130.00 | ? |
| Air con condensor pipe outlet | 1 | \$ | 160.00 | ? |
| RH Air con condensor air guide | 1 | \$ | 40.00 | ? |
| LH Air con condensor air guide | 1 | \$ | 40.00 | ? |
| Air con condensor fan cowling | 1 | \$ | 110.00 | ? |
| Air con condensor fan blade | 1 | \$ | 280.00 | ? |
| Air con condensor fan motor | 1 | \$ | 65.00 | ? |
| Radiator | 1 | \$ | 750.00 | ? |
| Radiator top hose | 1 | \$ | 25.00 | X |
| Radiator lower hose | 1 | \$ | 30.00 | X |
| Radiator auto fan cowling | 1 | \$ | 120.00 | ? |
| Radiator auto fan blade | 1 | \$ | 60.00 | ? |
| Radiator auto fan motor | 1 | \$ | 280.00 | ? |
| Radiator spare tank | 1 | \$ | 45.00 | ? |
| Engine air cleaner air duct | 1 | \$ | 60.00 | ? |
| Wiper water tank | 1 | \$ | 70.00 | ? |
| Rear tailgate | 1 | \$ | 680.00 | ✓ |
| Rear tailgate emblem | 1 | \$ | 28.00 | X |
| Rear tailgate moulding | 1 | \$ | 160.00 | X |
| Rear tailgate badge "Vezel" | 1 | \$ | 45.00 | — |
| Rear tailgate badge "RS" | 1 | \$ | 45.00 | — |
| Rear tailgate badge "hybrid" | 1 | \$ | 48.00 | — |
| Rear tailgate inner lock | 1 | \$ | 90.00 | — |
| Rear tailgate inner trim board | 1 | \$ | 150.00 | ? |
| Rear tailgate weatherstrip | 1 | \$ | 70.00 | ? |
| RH Rear tailgate inner taillamp | 1 | \$ | 320.00 | X |
| LH Rear tailgate inner taillamp | 1 | \$ | 320.00 | X |
| Rear windscreen moulding | 1 | \$ | 85.00 | ✓ |
| RH outer tail lamp | 1 | \$ | 330.00 | X |
| LH outer tail lamp | 1 | \$ | 330.00 | X |
| Rear bumper | 1 | \$ | 580.00 | ✓ |
| Rear bumper clips (1 set) | 1 | \$ | 15.00 | ✓ |
| RH Rear bumper retainer | 1 | \$ | 20.00 | X |
| LH Rear bumper retainer | 1 | \$ | 20.00 | X |
| RH Rear bumper reflector | 1 | \$ | 60.00 | X |
| LH Rear bumper reflector | 1 | \$ | 60.00 | X |
| Rear end panel | 1 | \$ | 360.00 | ? |

Cost:
WS/TP
Vehicle
top m/s

| | | | | | |
|---------------------------------|---|---------|----|------------------|---|
| Rear end panel top trim | 1 | | \$ | 70.00 | ? |
| Rear floor panel | 1 | | \$ | 650.00 | ? |
| Rear floor panel top trim board | 1 | | \$ | 360.00 | ? |
| | | | \$ | <u>14,408.00</u> | |
| | | Add 15% | \$ | <u>2,161.20</u> | |
| | | | \$ | <u>16,569.20</u> | |

| | | | | | |
|-------------------------------|---|---------|----|-------------------|-------------|
| Front number plate | 1 | S. nett | \$ | 45.00 | |
| Engine coolant | 1 | S. nett | \$ | 30.00 | |
| Rear windscreen sealant | 1 | S. nett | \$ | <i>M</i> 60.00 | <i>405N</i> |
| Rear windscreen inner seal | 1 | S. nett | \$ | <i>M</i> 28.00 | <i>—</i> |
| Rear parking sensors (1 set) | 1 | S. nett | \$ | <i>CMA</i> 260.00 | <i>200N</i> |
| Rear number plate | 1 | S. nett | \$ | <i>S</i> 45.00 | <i>X</i> |

To remove and check air con condenser, dryer, aluminium pipes, valves and reinstall components and vacuum and charge refrigerant R134a and check for leakage and full functionality

\$ 120.00 ?

To remove front damaged parts, to jack out front support panel, front body, and cut out damaged parts, to straighten out front chassis, to reweld, reshape and repair bonnet hinge panel, front fender and inner panel, head lamp inner panel, front support panel, front chassis member, to replace damaged parts and adjust body panel alignment

\$ 850.00 ?

To spray paint affected front and inner damaged portion inclusive of preparatory works and material

\$ 1,100.00 *1000l*

To apply anti-corrosion Tuff-Kote on front portion

\$ 100.00 *9d*

To remove and reinstall rear windscreen and conduct water leak test.

\$ 120.00 *✓*

To remove rear damaged parts, to jack out rear end panel and rear floor panel and cut out body panel, to reweld, reshape and repair rear end panel, rear floor panel, rear body panel, to straighten out rear chassis member, to replace damaged parts and adjust rear body and tailgate alignment

\$ 1,200.00 ?

To spray paint affected rear and inner damaged portion inclusive of preparatory works and material

\$ 850.00 *800l*

To disconnect wire harness to facilitate repairs and check for damage and reconnect wiring system and check for full functionality

\$ 80.00 *40l*

To perform computer diagnostic on drivetrain, ABS systems, parking system, headlamp systems, and clear fault codes

\$ 150.00 7

To apply anti-corrosion Tuff-Kote on rear portion

\$ 100.00 60

\$ 21,707.20

T/Party: India International Insurance Pte Ltd

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow Insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 08/08/2022 16:20 (SGT)
Reported by Both
Date of Accident 08/08/2022 09:05 (SGT)
Exact Location of Accident Upper Cross St, Singapore
Additional Location Information Upper Cross Street after traffic light to CTE
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SLG6339E

INSURED/POLICYHOLDER

Is company? No
Name Of Registered Owner Ho Wee Lam
NRIC No SXXXX922E
Email Address ho.steven@yahoo.com
Mobile Phone No (Phone) +65-98751717
Alternative Phone No -

VEHICLE PARTICULARS

Manufacturer Honda
Model Vezel
Variant -
Exact purpose for which vehicle was being used at time of accident Private hire
Are you claiming under your own insurance policy for repair to your vehicle? No - Claiming third party
Vehicle Category Private hire
Transmission Auto
CC 1500

INSURANCE COMPANY

Name of Insurance Company NTUC Income Insurance Co-operative Ltd
Policy Number / Cover Note Number 5108525001-03

DRIVER

Name of Driver Ho Wee Lam
NRIC No SXXXX922E
Date Of Birth 17/02/1972
Occupation Outdoor

IMPORTANT NOTICE

SKETCH PLAN

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Traffic Police Department for investigation.**
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**
I understand, acknowledge, agree and consent that:
 - (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes, mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
 (collectively the "Purposes")
 - (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
 - (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be cited outside of Singapore, for one or more of the above Purposes.

Policyholder's Signature / Date & Time

Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel (Name as in NPICID card)

Sketch Plan

