



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MINISTRY OF DEFENCE
HQ TRANSPORT COMMAND
KRANJI CAMP 3
151 CHOA CHU KANG WAYSINGAPORE 688248

Ref: CC2/MIDA22008153/Tpq2

Date: 28/02/2023

Code: MIDA

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	MID 95330	Veh. Inspected	YP 2182P
Policy No.	OA22019970	Coverage (\$)	0.00
Claim No.	CY22/MID95330/230822/0030	Excess (\$)	0.00
Assign From		Assign Date	25/08/2022

2. Vehicle Particulars & Condition

Make & Model	MITSUBISHI CANTER	c.c	2998
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	FEB21EA20439	Colour	WHITE
Odometer	423979 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/85 R15	KENDA	6 mm
L/H Front Tyre	195/85 R15	KENDA	6 mm
R/H Rear Tyre	195/85 R15 (D)	KENDA	6/6 mm
L/H Rear Tyre	195/85 R15 (D)	KENDA	6/6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	23/08/2022	Inspection Date	25/08/2022
Survey held at	TEAMWORK GARAGE PTE LTD 53 UBI AVENUE 1 #01-24 SINGAPORE 408934.		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	4 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. YP 2182P

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT DOOR PANEL LH	BENT	2,207.70	1,800.00
1	FRONT DOOR TRIM BOARD LH	NOT NECESSARY	678.70	-
1	FRONT DOOR WEATHERSTRIP LH	NOT NECESSARY	466.40	-
1	FRONT DOOR CHECKER LH	NOT NECESSARY	94.60	-
2	FRONT DOOR HINGE LH	TO REPAIR SEE LABOUR	356.40	-
1	FRONT STEP GARNISH LH	CUT	674.30	622.00
1	FRONT CORNER PANEL LH	TO REPAIR SEE LABOUR	556.60	-
1	PILLAR 'A' LH	TO REPAIR SEE LABOUR	1,629.10	-
1	FRONT HEADLAMP LH	CRACKED	551.10	551.10
1	FRONT HEADLAMP CORNER COVER LH	CRACKED	256.30	222.00
1	FRONT SIGNAL LAMP LH	CRACKED	357.00	256.00
1	FRONT BUMPER	TO REPAIR SEE LABOUR	1,111.00	-
2	FRONT BUMPER BRACKET	NOT NECESSARY	215.60	-
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	712.80	-
1	FRONT BUMPER SIDE COVER (BLACK)	CUT	375.10	334.00
1	FRONT GRILLE	CRACKED	1,215.50	952.00
1	FRONT GRILLE EMBLEM -LOGO	NECESSARY	90.20	90.20
	LESS 10% DISCOUNT		-1,154.84	-482.73
			10,393.56	4,344.57
<u>SPECIAL NETT ITEMS</u>				
1	SET FRONT GRILLE CLIP (SN)	NECESSARY	50.00	20.00
1	SET FRONT DOOR INNER TRIM CLIP (SN)	NOT NECESSARY	50.00	-
			100.00	20.00
<u>LABOUR</u>				
	CHECK WIRING AND LIGHTING SYSTEM.		80.00	30.00
	R&R DOOR TRIMS AND MECHANISM FOR REPAIR .		200.00	60.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	PANEL BEATING ON AFFECTED AREAS .INCLUSIVE OF THE REPAIR OF FRONT DOOR HINGE LH ,FRONT CORNER PANEL LH ,PILLAR 'A' LH AND FRONT BUMPER .		1,600.00	300.00
	SPRAY PAINTING ON AFFECTED AREAS .		1,600.00	300.00
	APPLY ANTI RUST ON AFFECTED AREAS .		150.00	30.00
			3,630.00	720.00
GRAND TOTAL			14,123.56	5,084.57
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,050.00

Report Ref No. CC2/MIDA22008153/Tpq2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. YP 2182P

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

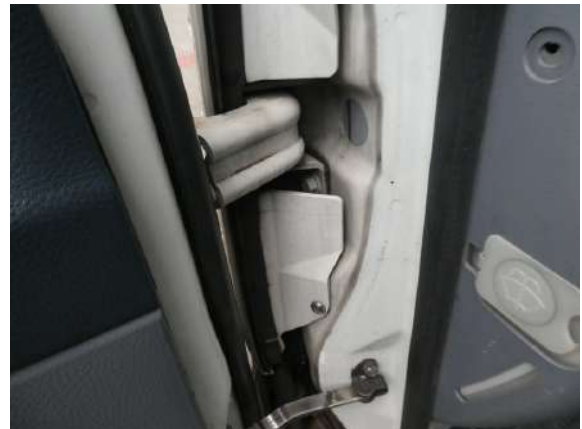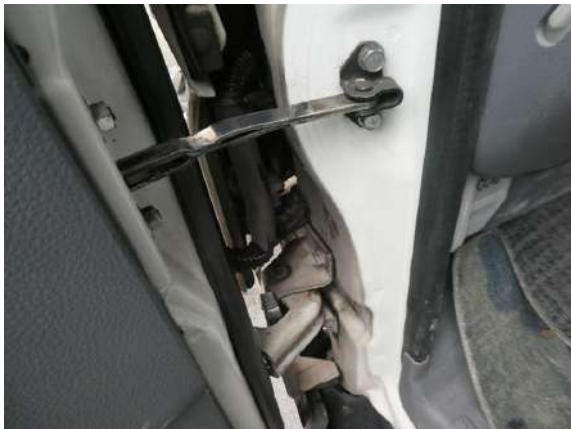



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. YP 2182P

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. YP 2182P

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

