



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2304622

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV Date 19/07/2023
Reference CC4/LPC22008314/Tpa3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. GBF 9864J
Insured Veh. YN 6902M
Claim No. 21/22/22/VC05/026197
Policy No. Z21VC05009036
Accident Date 16/08/2022
Inspection Date 26/08/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC22008314/Tpa3q2 Date: 19/07/2023 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YN 6902M	Veh. Inspected	GBF 9864J	
Policy No.	Z21VC05009036	Coverage (\$)	0.00	
Claim No.	21/22/22/VC05/026197	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	26/08/2022	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA HIACE	c.c	2982	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	KDH2015025349	Colour	WHITE	
Odometer	310143 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195 R15	MICHELIN	6 mm	
L/H Front Tyre	195 R15	MICHELIN	6 mm	
R/H Rear Tyre	195 R15	MICHELIN	6 mm	
L/H Rear Tyre	195 R15	MICHELIN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	16/08/2022	Inspection Date	26/08/2022	
Survey held at	60 JALAN LAM HUAT #02-32 CARRO CENTRE 737869			
Repairer	THINK ONE AUTOCARE PTE LTD			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBF 9864J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	TAIL GATE	BENT	2,062.00	1,855.00
1	TAIL GATE LOCK	NOT NECESSARY	509.20	-
1	TAIL GATE LOCK COVER	NOT NECESSARY	98.00	-
1	TAIL GATE (LOGO) EMBLEM	NECESSARY	165.00	79.00
2	TAIL GATE RUBBER STOPPER @\$20.00	NOT NECESSARY	40.00	-
1	REAR END PANEL INNER	TO REPAIR SEE LABOUR	1,288.00	-
1	REAR END PANEL OUTER	TO REPAIR SEE LABOUR	1,288.00	-
1	REAR BUMPER	DEFORMED	1,260.00	681.20
2	REAR BUMPER SIDE RETAINER R+L @\$121.50	NOT NECESSARY	243.00	-
1	TAIL LAMP LOWER COVER LH	DEFORMED	185.00	185.00
1	TAIL LAMP LH	NOT NECESSARY	764.50	-
	LESS 25% DISCOUNT		-1,975.68	-700.05
			5,927.02	2,100.15
<u>SPECIAL NETT ITEMS</u>				
1	REAR WINDSCREEN GLASS SEALANT (SN)	NECESSARY	90.00	60.00
1	REAR WINDSCREEN GLASS INNER SEAL (SN)	NECESSARY	135.00	135.00
1	70KM/H STICKER (SN)	NECESSARY	25.00	25.00
1	REVERSE SENSOR (SN)	NOT WORKING	250.00	200.00
1	COMPANY NAME & LOGO (SN)	NECESSARY	850.00	300.00
			1,350.00	720.00
<u>LABOUR</u>				
	TO REMOVE DAMAGED BODYPARTS WITH ALL NECESSARY COMPONENTS/ATTACHMENTS APPLY HOT-WORKS WHERE NECESSARY REPAIR ,RESHAPE BODY DENTED PANELS IN ACCORDANCE WITH FACTORY SPECIFICATIONS REPLACE NEW PARTS REFIT AND ALIGN INTO POSITION REFIT ALL NECESSARY COMPONENTS /ATTACHMENTS .INCLUSIVE OF THE REPAIR OF REAR END PANEL INNER AND REAR END PANEL OUTER .		1,400.00	600.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO SPRAY PAINT REPLACED /REPAIRED BODY PARTS INCLUSIVE OF PREPARATORY WORKS AND PAINTING MATERIALS .	NOT NECESSARY	1,000.00	600.00
	TO TRANSFER TAIL GATE COMPONENTS WITH ALL NECESSARY ATTACHMENTS .		150.00	60.00
	TO REMOVE ,REFIX REAR WINDSCREEN GLASS AND WATER TEST .		150.00	120.00
	TO INSTALL REVERSE SENSOR AND TEST FUNCTION .		100.00	30.00
			2,800.00	1,410.00
GRAND TOTAL			10,077.02	4,230.15
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,400.00

Report Ref No. CC4/LPC22008314/Tpa3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBF 9864J

INSPECTION

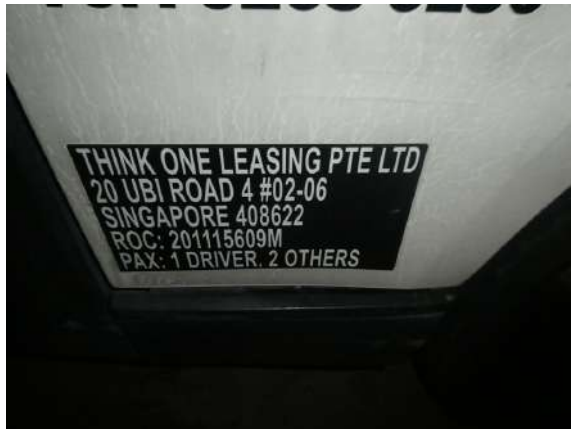




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

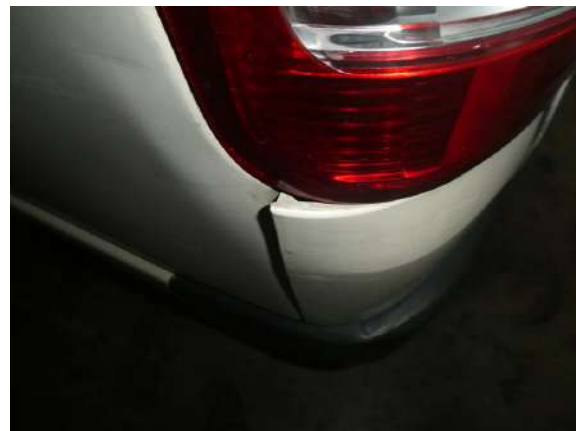



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBF 9864J

RE-INSPECTION

